

# Asbestos Removal Response Action Minillas Complex North Tower San Juan, Puerto Rico

## Clearance Sampling Report

**UNITED STATES ENVIRONMENTAL PROTECTION AGENCY – REGION 2**

2013

# Asbestos Removal Response Action Minillas Complex North Tower San Juan, Puerto Rico

## Clearance Sampling Report

### INTRODUCTION

On August 24, 2012, the Environmental Protection Agency (EPA) approved the work plan for the Asbestos Removal Response Action at the Minillas Complex North Tower, located in Santurce, Puerto Rico. This work plan is part of the Administrative Order on Consent No. CERCLA-02-2012-2022 signed on August 24, 2012. As part of the work plan, clearance sampling is required to ensure protection to the workers and general public. This report includes the final clearance sampling results for each one of the cleaned areas.

### UPDATE

Three of the six elevators have been cleaned up and sampled. Three wipe samples were randomly collected at each elevator cabin. All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>. One air sample was collected at each elevator cabin. All air samples results were below the benchmark of  $\leq 0.0020$  f/cc. Negative pressure was maintained in the elevator cabins until the results were cleared. The three elevator cabins are sealed as per the approved work plan.

One of the two elevator shafts has been cleaned up and sampled. Five wipe samples were randomly collected at the elevator shaft. All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>. Two air samples were collected at the elevator shaft area. All air samples results were below the benchmark of  $\leq 0.0020$  f/cc. Negative pressure was maintained in the elevator shaft until the results were cleared. The elevator shaft has been sealed as per the approved work plan.

The elevator mechanical room has been cleaned up and sampled. Five wipe samples were randomly collected. All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>. Four air samples were randomly collected. All air samples results were below the benchmark of  $\leq 0.0020$  f/cc. Negative pressure was maintained until the results were cleared. The elevator mechanical room has been sealed as per the approved work plan.

As per the approved cleanup work plan, the cleanup sequence used for the building started from top to bottom (Level 17<sup>th</sup> to 9<sup>th</sup>) due to the air flow direction of the first half of the building air conditioning (A/C) system.

Levels 9<sup>th</sup> to 17<sup>th</sup> have been cleaned up and sampled. A total of 90 wipe samples were randomly collected at non-porous areas and a total of 81 microvac (dust) samples were randomly collected at porous areas. For Level 9<sup>th</sup> there were no microvac samples collected since Level 9<sup>th</sup> was completely free of no porous surfaces (the area was empty). A total of 30 wipe samples were collected at A/C returns and four wipe samples were collected at A/C suppliers. All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>. In addition, a total of 90 air samples were randomly collected. All air samples results were below the benchmark of  $\leq 0.0020$  f/cc. Negative pressure was maintained until the results were cleared. Levels 9<sup>th</sup> to 17<sup>th</sup> have been sealed as per the approved work plan.

The second half of the building has a different A/C system that goes from the lower level (P) to Level 8<sup>th</sup>. This results on a change of cleanup sequence. According to the new sequence, levels P to 5<sup>th</sup> have been cleaned and sampled. A total of 45 wipe samples were randomly collected at non-porous areas and a total of 36 microvac (dust) samples were randomly collected at porous areas. For Level 3<sup>rd</sup> there were no microvac samples collected since Level 3<sup>rd</sup> was completely free of no porous surfaces (the area was empty). A total of 18 wipe samples were collected at A/C returns and three wipe samples were collected at A/C suppliers. All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>. In addition, a total of 45 air samples were randomly collected. All air samples results were below the benchmark of  $\leq 0.0020$  f/cc. Negative pressure was maintained until the results were cleared. Levels P to 5<sup>th</sup> have been sealed as per the approved work plan.

## **NEXT STEP**

Levels 6<sup>th</sup> and 7<sup>th</sup> have been cleaned and sampled. The sampling results are expecting by March 26, 2013. The cleanup of Level 8<sup>th</sup> was completed and sampling was conducted on March 26, 2013. Results are expected by March 28, 2013. The cleanup work at the stairway is scheduled to begin on March 25, 2013. The remaining work (elevator's shaft, elevator's cabins, and Ground Level) should be completed by March 30, 2013.

## **FIRST CLEANUP SEQUENCE**

South Elevator Cabins




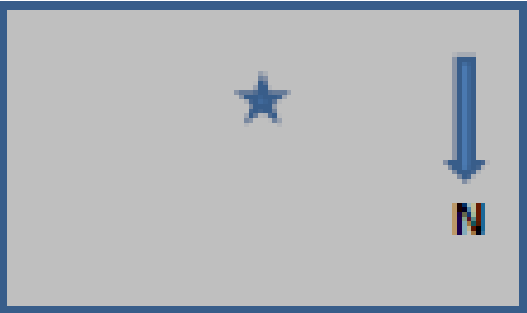

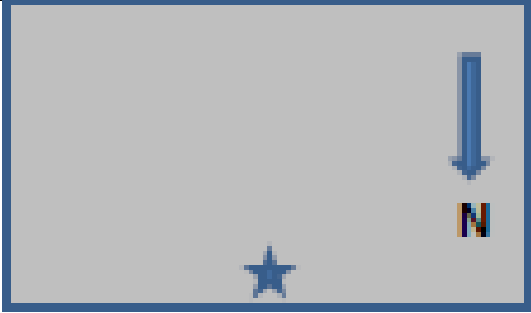
South Elevator's Shaft







Elevator Mechanical Room


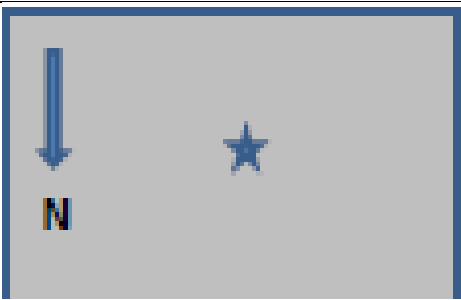

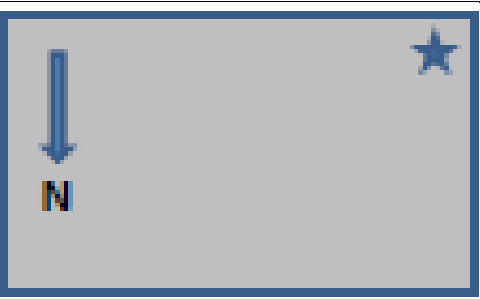

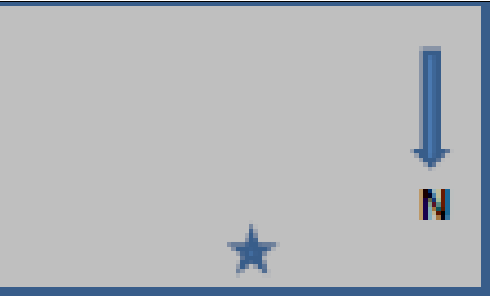


Area: South Elevator Cabins (three elevators)

Wipe Dust Samples Data\*



Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-Elev1-111212-1	3,900 (4 Chrysotile)			Floor Elevator #1
PBA-W-Elev1-120112-2	<1,000 (non detected)			Floor Elevator #1
PBA-W-Elev1-120612-1	<1,000 (non detected)			Floor Elevator #1

PBA-W-Elev1-120612-2	2,100 (2 Chrysotile)			Floor Elevator #1
PBA-W-Elev2-111212-2	< 980 (non detected)			Floor Elevator #2
PBA-W-Elev2-111212-3	< 1,000 (non detected)			Floor Elevator #2

PBA-W-Elev2-111212-4	< 1,000 (non detected)			Floor Elevator #2
PBA-W-Elev3-111212-3	< 980 (non detected)			Floor Elevator #3
PBA-W-Elev3-120112-5	< 1,000 (non detected)			Floor Elevator #3

PBA-W-Elev3-120112-6



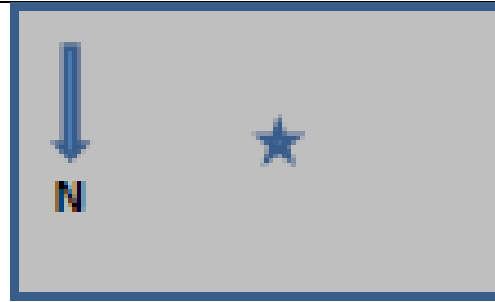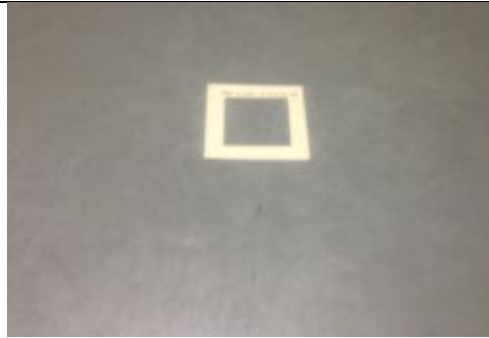


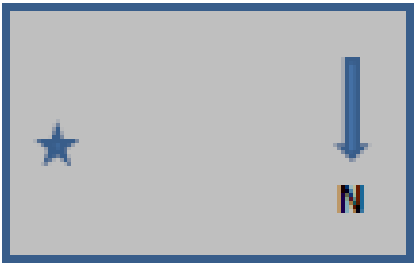
< 1,000  
(non detected)



Floor Elevator #3

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Sampling Data




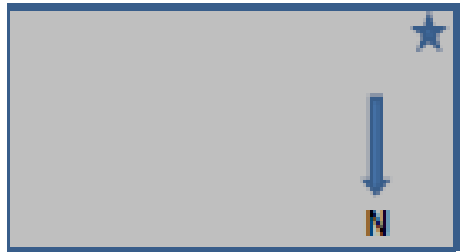
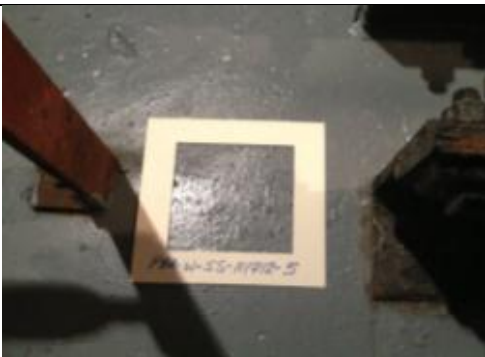

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-Elev1-111712-1	0.0016			Air-Elevator #1
PBA-A-Elev2-111712-2	0.0011			Air-Elevator #2
PBA-A-Elev3-111712-3	<0.00075			Air-Elevator #3

\*All air samples results were below the benchmark of  $\leq 0.0020$  f/cc

Area: South Elevator Shaft




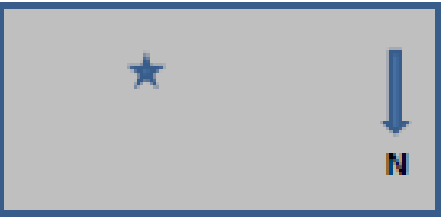
Wipe Dust Sampling Data\*

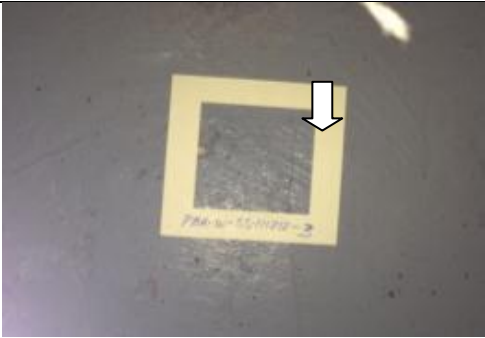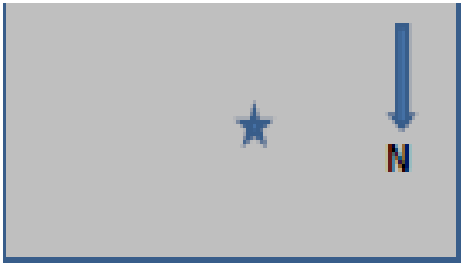Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-SS-111712-1	< 980 (non detected)			Floor
PBA-W-SS-111712-2	< 980 (non detected)			Floor

PBA-W-SS-111712-3	< 980 (non detected)			Floor
PBA-W-SS-111712-4	< 980 (non detected)			Floor
PBA-W-SS-111712-5	980 (1 Chrysotile)			Floor

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Sampling Data \*




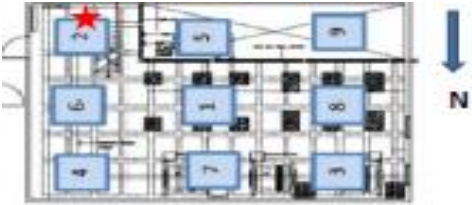
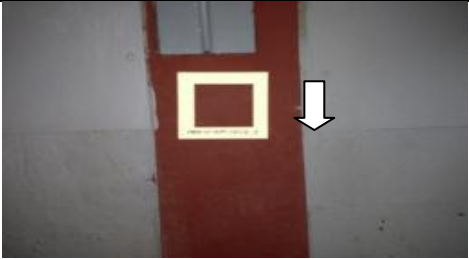
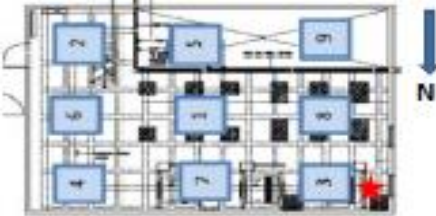
Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-SS-111212-1	< 0.00075			Air
PBA-A-SS-111212-2	< 0.00075			Air


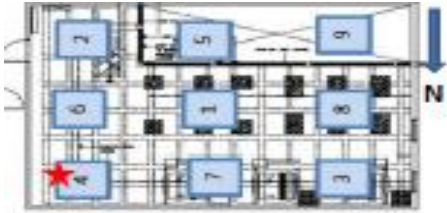


\*All air samples results were below the benchmark of  $\leq 0.0020$  f/cc



Area: Elevator Mechanical Room







Wipe Dust Sampling Data\*



Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-EM-112112-1	980 (1 Chrysotile)			Floor Beam
PBA-W-EM-112112-2	980 (1 Chrysotile)			Floor
PBA-W-EM-112112-3	980 (1 Chrysotile)			Equipment Base

PBA-W-EM-112112-4	2,900 (3 Chrysotile)			Equipment Base
PBA-W-EM-112112-9	980 (1 Chrysotile)			Floor

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Sampling Data \*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-EM-111212-5	0.0016			Air
PBA-A-EM-111212-6	< 0.00075			Air
PBA-A-EM-111212-7	0.0016			Air

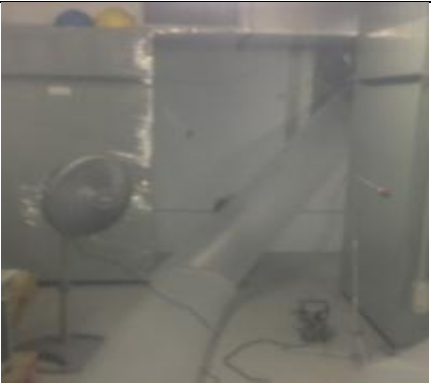
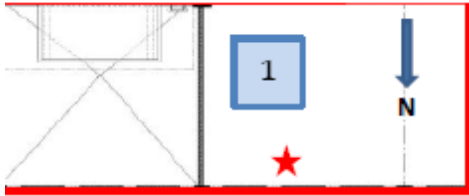



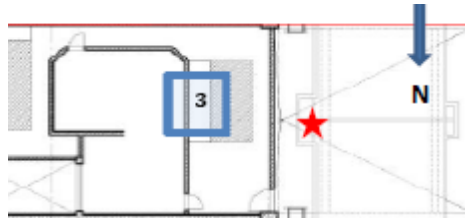
PBA-A-EM-111212-8	0.0016			Air
-------------------	--------	--	---	-----

\*All air samples results were below the benchmark of  $\leq 0.0020$  f/cc






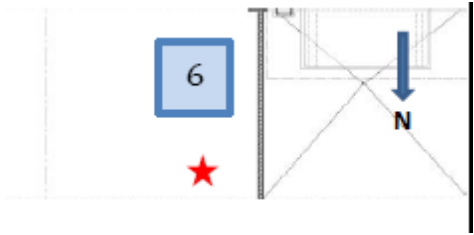
**SECOND CLEANUP SEQUENCE**  
**LEVELS 17 TO 9**








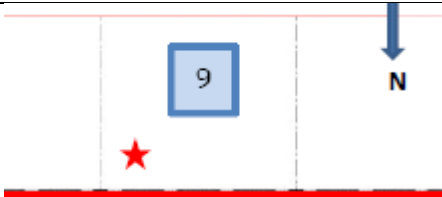
**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-17-121212-1	3,100 (3 Chrysotile)			Random Area #1 (Big files area to southwest) Cabinet
PBA-W-17-121212-2	<1,000 (non detected)			Random Area #2 (Private office to north) Desk
PBA-W-17-121212-3	<1,000 (non detected)			Random Area #3 (East machine room) Electrical Box




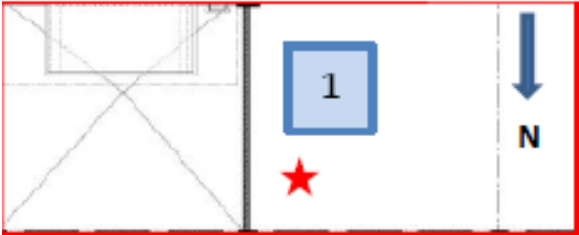



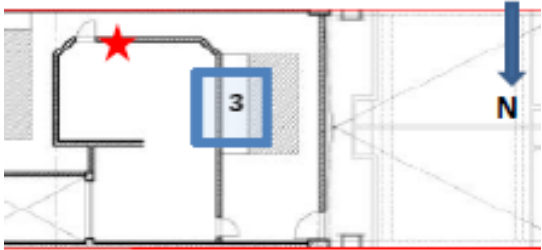
PBA-W-17-121212-4	<1,000 (non detected)			Random Area #4 (West machine room) Machine base
PBA-W-17-121212-5	<1,000 (non detected)			Random Area #5 (Men restroom to center) Floor
PBA-W-17-121212-6	2,100 (2 Chrysotile)			Random Area #6 (Big files area to southeast) Shelf


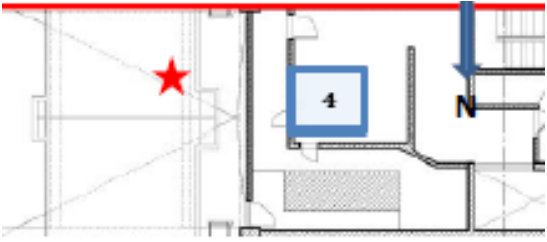



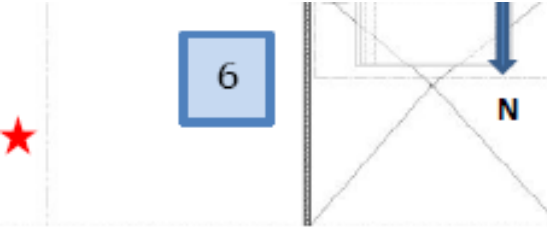





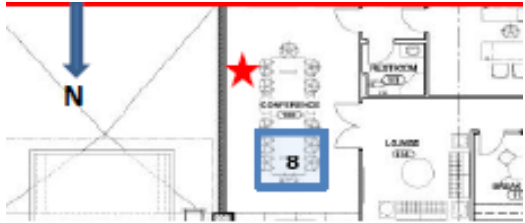
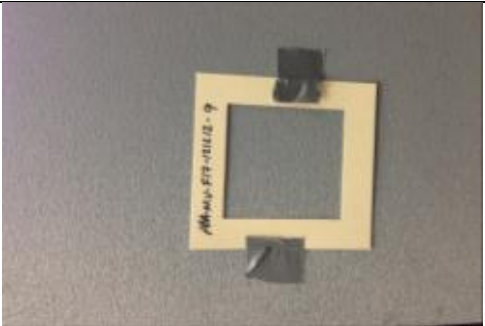

PBA-W-17-121212-7	1,000 (1 Chrysotile)			Random Area #7 (File room to northeast) Cabinet
PBA-W-17-121212-8	< 1,000 (non detected)			Random Area #8 (Private office to northwest) Shelf
PBA-W-17-121212-9	4,100 (4 Chrysotile)			Random Area #9 (Open office to south) Floor

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Porous Surfaces Microvac Wipe Dust Samples Data\*







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-17-121212-1	3,100 (3 Chrysotile)			Random Area #1 (Big files area to southwest) Box
PBA-MV-17-121212-2	<1,000 (non detected)			Random Area #2 (Private office to north) Partition
PBA-MV-17-121212-3	<1,000 (non detected)			Random Area #3 (East machine room) Porous wall

PBA-MV-17-121212-4	<1,000 (non detected)			Random Area #4 (West machine room) Wood floor
PBA-MV-17-121212-5	<1,000 (non detected)			Random Area #5 (Near to east machine room entrance) Porous wall
PBA-MV-17-121212-6	2,100 (2 Chrysotile)			Random Area #6 (Private office to southeast) Partition

PBA-MV-17-121212-7	1,000 (1 Chrysotile)			Random Area #7 (Private office to northeast) Carpet
PBA-MV-17-121212-8	< 1,000 (non detected)			Random Area #8 (Conference room to northwest) Chair
PBA-MV-17-121212-9	4,100 (4 Chrysotile)			Random Area #9 (Open office to south) Partition


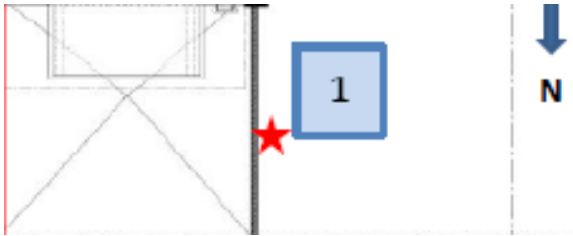



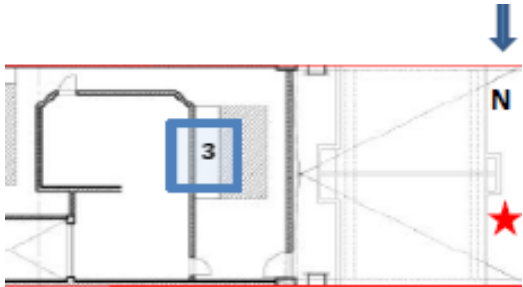
\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

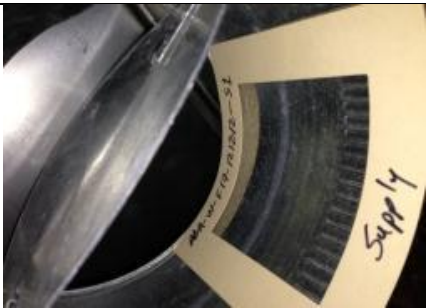Air Conditioning (A/C) Returns and Supply Wipe Dust Samples







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-17-121212-R1	< 1,000 (non detected)			A/C return (Common office to north)
PBA-W-17-121212-R2	< 1,000 (non detected)			A/C return (Private office to northeast)
PBA-W-17-121212-S1	1,000 (1 Chrysotile)			A/C supply (Open office to northeast)







\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

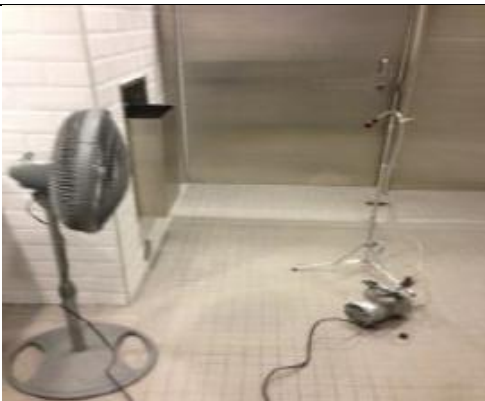Air Samples Data\*

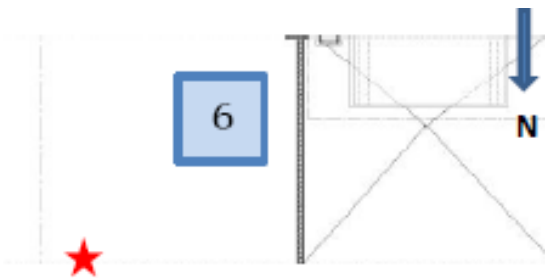Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-17-121212-1	0.00075			Random Area #1 (Big files area to southwest)
PBA-A-17-121212-2	<0.00094			Random Area #2 (Private office to north)
PBA-A-17-121212-3	<0.00075			Random Area #3 (East machine room)

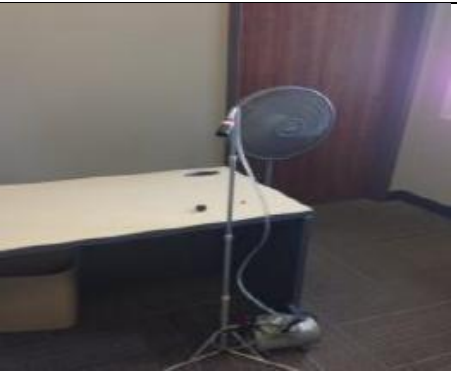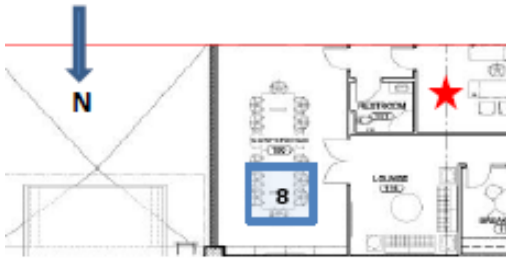

PBA-A-17-121212-4	<0.00075			Random Area #4 (West machine room)
PBA-A-17-121212-5	0.0025 (NIOSH 7400) and <0.00042 (NOISH 7402)			Random Area #5 (Men restroom to center)
PBA-A-17-121212-6	<0.00075			Random Area #6 (Big file area to southeast)






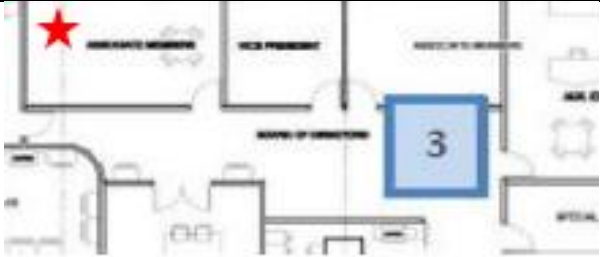
PBA-A-17-121212-7	0.0016			Random Area #7 (Storage room to northeast)
PBA-A-17-121212-8	<0.00072			Random Area #8 (Private office to northwest)
PBA-A-17-121212-9	0.000926			Random Area #9 (Open office to south)


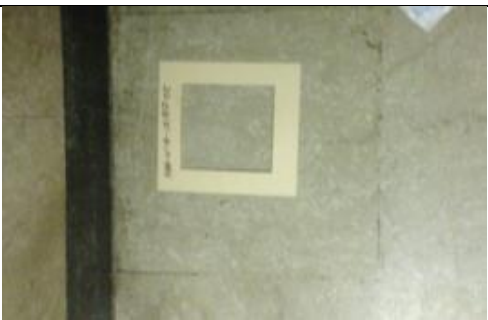

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc


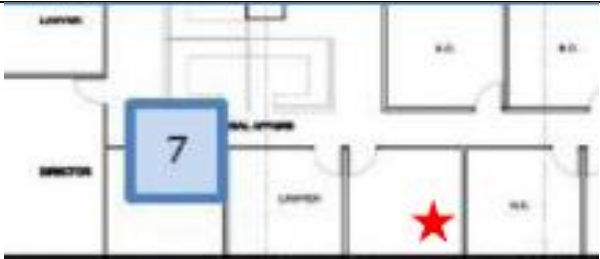




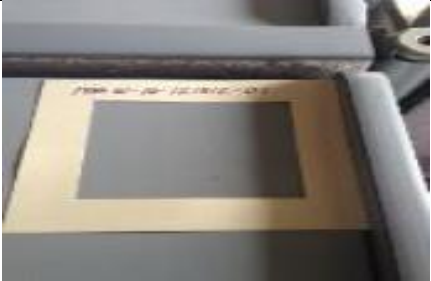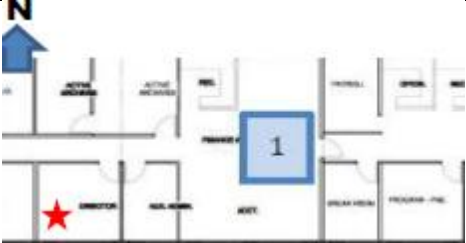

[illegible]

Non-porous Surfaces Wipe Dust Samples Data \*


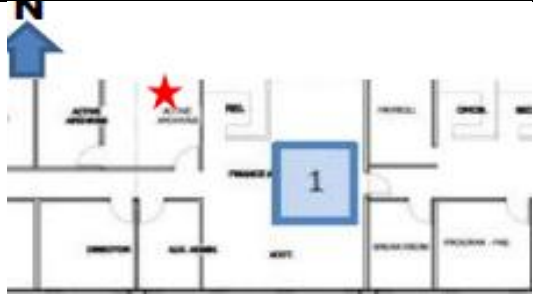




Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-16-121812-1	<1,000 (non detected)			Random Area #1 (Cubicle office to south) Elevated cabinet
PBA-W-16-121812-2	<1,000 (non detected)			Random Area #2 (Open office to west) Elevated cabinet
PBA-W-16-121812-3	<1,000 (non detected)			Random Area #3 (Private office to northeast) Floor

PBA-W-16-121812-4	<1,000 (non detected)			Random Area #4 (Conference room to northwest) Small table
PBA-W-16-121812-5	1,000 (1 Chrysotile)			Random Area #5 (Center next to drinking water fountain) Floor
PBA-W-16-121812-6	<1,000 (non detected)			Random Area #6 (Private office to east) Desk







PBA-W-16-121812-7	<1,000 (non detected)			Random Area #7 (Private office to southwest) Floor
PBA-W-16-121812-8	< 1,000 (non detected)			Random Area #8 (Private office with conference room to north) Shelf
PBA-W-16-121812-9	<1,000 (non detected)			Random Area #9 (Private office to east) Shelf







\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

**Porous Surfaces Microvac Wipe Dust Samples Data\***

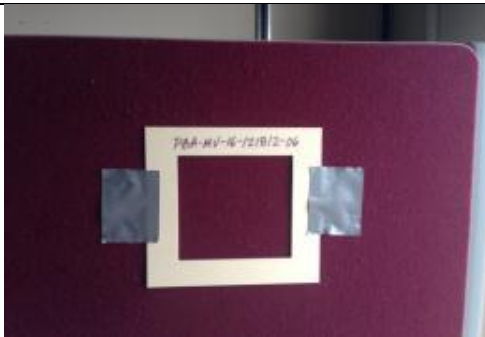Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-16-121812-1	<1,000 (non detected)			Random Area #1 (Cubicle office to south) Box
PBA-MV-16-121812-2	<1,000 (non detected)			Random Area #2 (Cubicle office to west) Partition
PBA-MV-16-121812-3	<1,000 (non detected)			Random Area #3 (Private office to northeast) Chair

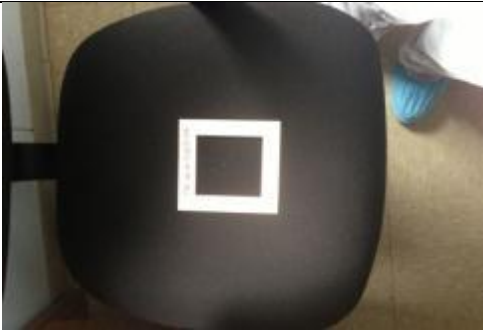
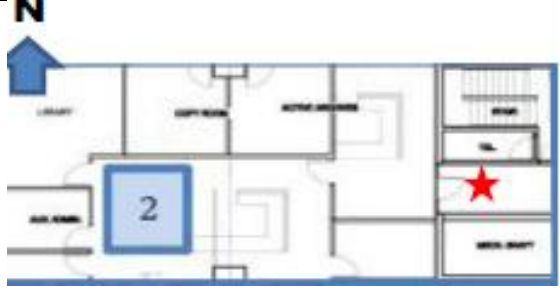



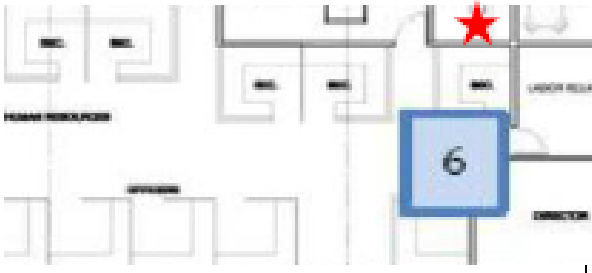


PBA-MV-16-121812-4	<1,000 (non detected)			Random Area #4 (Cubicle office to northwest) Partition
PBA-MV-16-121812-5	1,000 (1 Chrysotile)			Random Area #5 (Center near to south) Chair
PBA-MV-16-121812-6	<1,000 (non detected)			Random Area #6 (Cubicle office to southeast) Elevated cabinet door



PBA-MV-16-121812--7	<1,000 (non detected)			Random Area #7 (Private office to southwest) Chair
PBA-MV-16-121812-8	< 1,000 (non detected)			Random Area #8 (Open office to north) Box
PBA-MV-16-121812-9	<1,000 (non detected)			Random Area #9 (Private office to east) Chair

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

### Air Conditioning (A/C) Returns and Supply Wipe Dust Samples





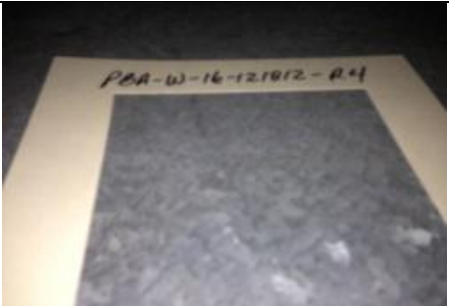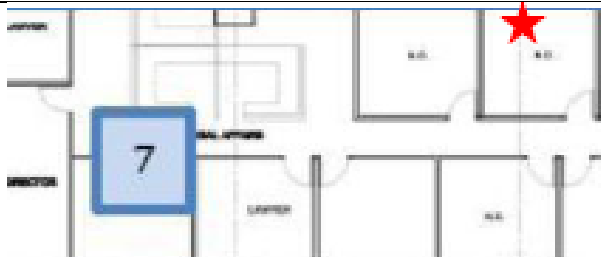

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-16-121812-R1	< 1,000 (non detected)			A/C return (Lobby to west)
PBA-W-16-121812-R2	< 1,000 (non detected)			A/C return (Lobby to east)
PBA-W-16-121812-R3	< 1,000 (non detected)			A/C return (Offices to east)



PBA-W-16-121812-R4	< 1,000 (non detected)			A/C return (Offices to west)
--------------------	---------------------------	--	---	---------------------------------

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-16-121812-1	0.00017			Random Area #1 (Private office to south)
PBA-A-16-121812-2	0.00081			Random Area #2 (Private office to west)
PBA-A-16-121812-3	0.0014			Random Area #3 (Private office with conference room to northeast)


PBA-A-16-12812-4	0.0025 (NIOSH 7400) and <0.0013 (NOISH 7402)			Random Area #4 (Private office to northwest)
PBA-A-16-121812-5	0.0019			Random Area #5 (Women restroom to center)
PBA-A-16-121812-6	0.00081			Random Area #6 (Private office to southeast)

PBA-A-16-121812-7	0.00095			Random Area #7 (Private office to southwest)
PBA-A-16-121812-8	< 0.00074			Random Area #8 (Reception to north)
PBA-A-16-121812-9	< 0.00074			Random Area #9 (Public office to east)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc





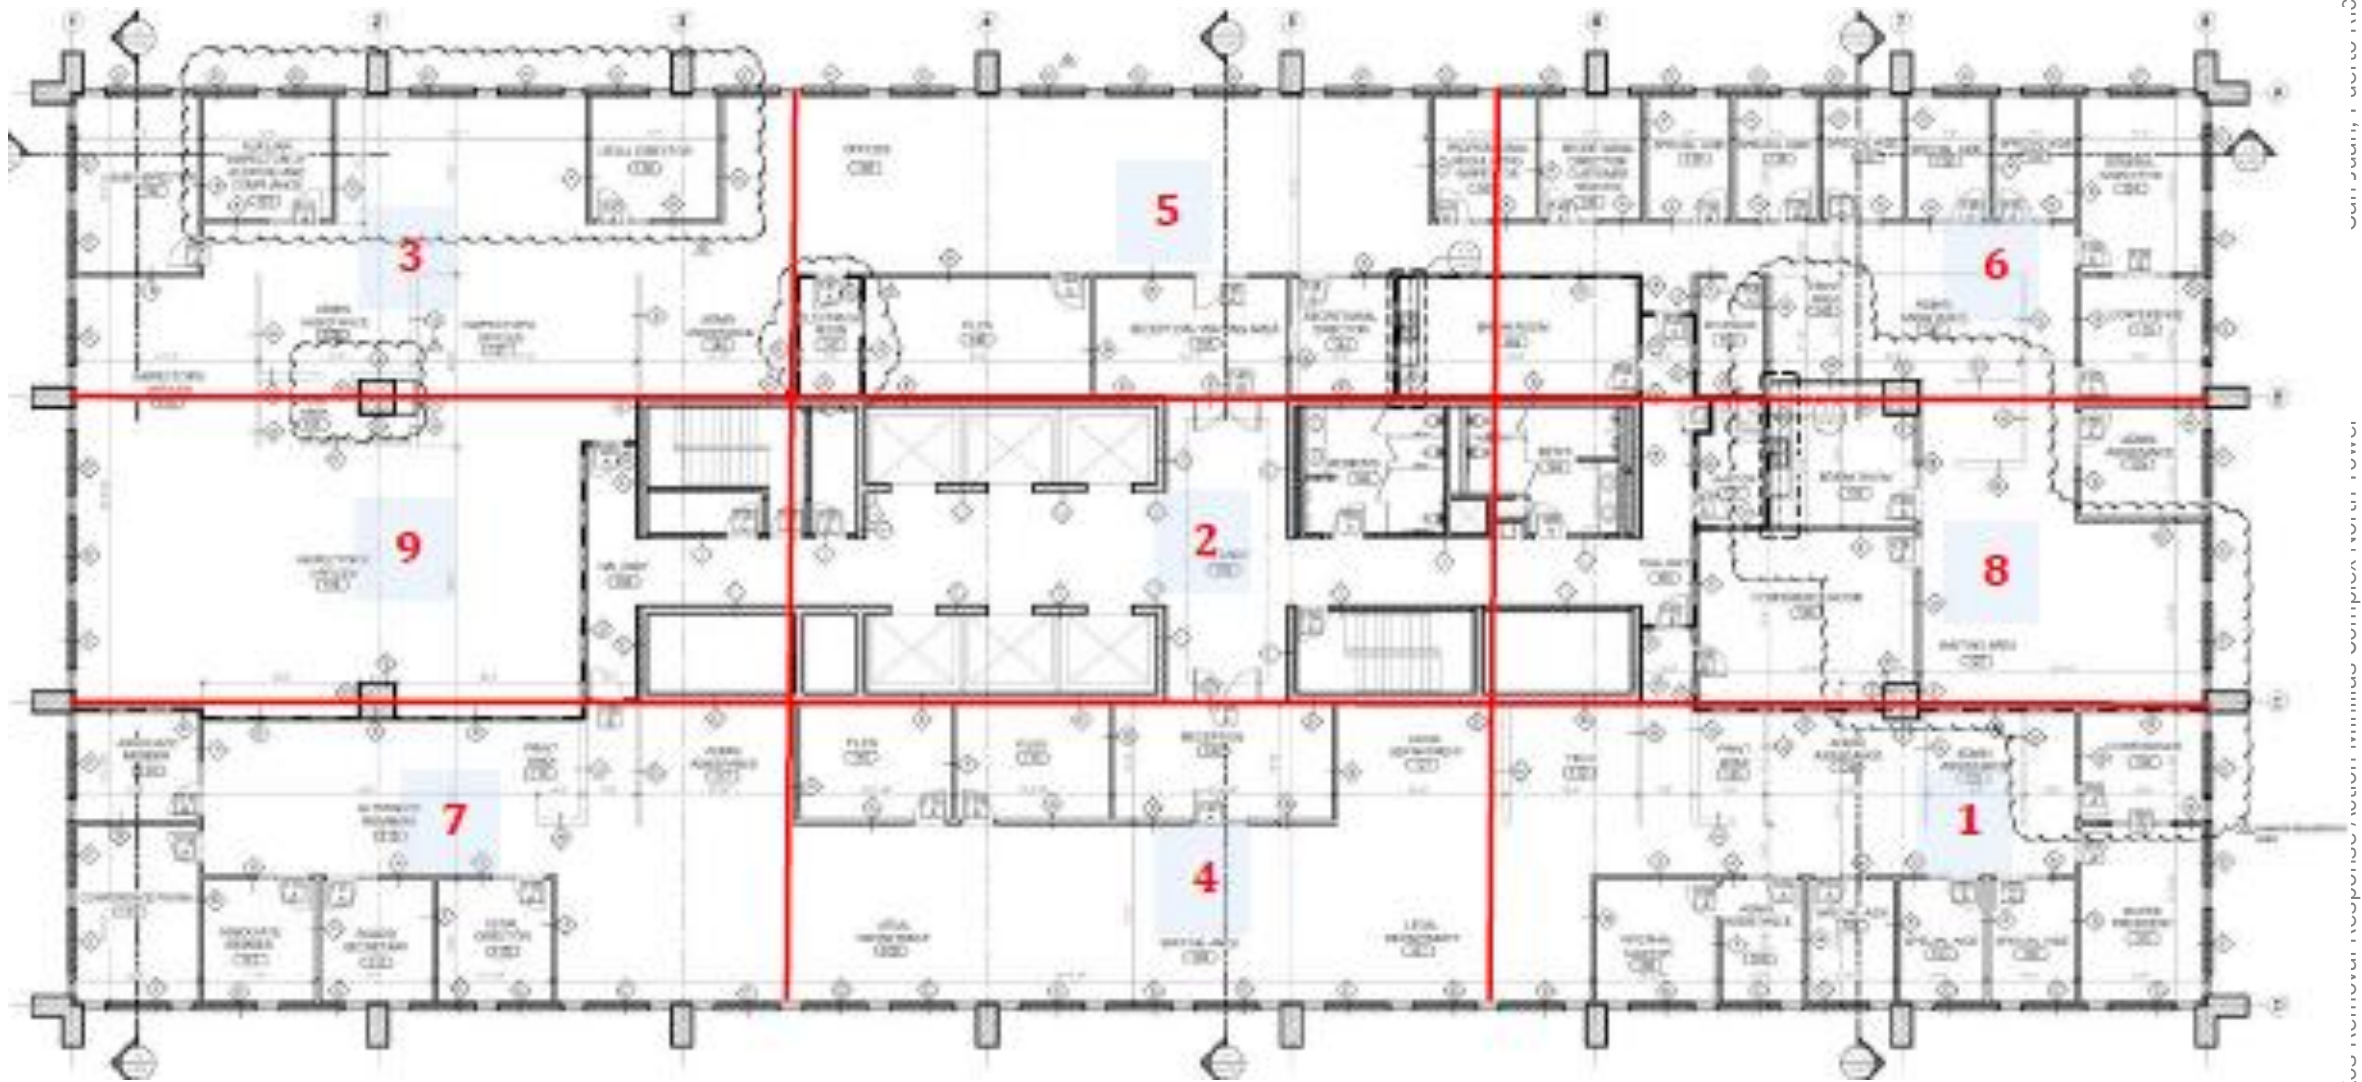



## Area: Level 15<sup>th</sup>









Non-porous Surfaces Wipe Dust Samples Data \*

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-15-122812-1	<1,000 (non detected)			Random Area #1 (Open office to east) Copier
PBA-W-15-122812-2	<1,000 (non detected)			Random Area #2 (Lobby to center) Floor
PBA-W-15-122812-3	<1,000 (non detected)			Random Area #3 (Open office to northwest) Non-porous partition


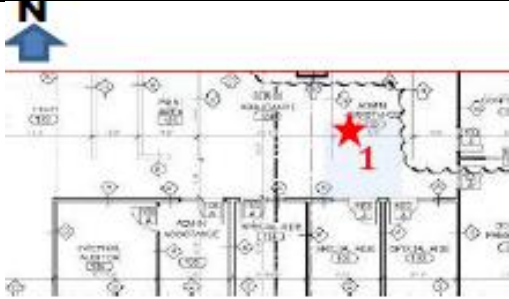



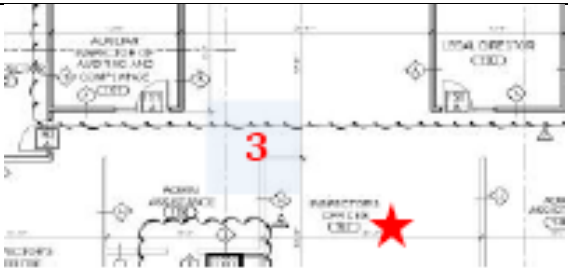
PBA-W-15-122812-4	<1,000 (non detected)			Random Area #4 (Private office to south) Cabinet
PBA-W-15-122812-5	<1,000 (non detected)			Random Area #5 (Private office to north) CPU tower
PBA-W-15-122812-6	<1,000 (non detected)			Random Area #6 (Open office to northeast) Non-porous partition















PBA-W-15-122812-7	<1,000 (non detected)			Random Area #7 (Printer room to southwest)  Printer
PBA-W-15-122812-8	< 1,000 (non detected)			Random Area #8 (Conference room to east)  Cabinet
PBA-W-15-122812-9	<1,000 (non detected)			Random Area #9 (Cubicle office to northwest)  Desk

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

**Porous Surfaces Microvac Wipe Dust Samples Data\***







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-15-122812-1	<1,000 (non detected)			Random Area #1 (Open office to south)  Chair
PBA-MV-15-122812-2	<1,000 (non detected)			Random Area #2 (Reception area to north)*  Chair  <i>* No porous surfaces were identified in RA 2.</i>
PBA-MV-15-122812-3	<1,000 (non detected)			Random Area #3 (Open office to northwest)  Porous partition

PBA-MV-15-122812-4	<1,000 (non detected)			Random Area #4 (Waiting area to south) Carpet
PBA-MV-15-122812-5	<1,000 (non detected)			Random Area #5 (Private office to north) Chair
PBA-MV-15-122812-6	<1,000 (non detected)			Random Area #6 (Storage to northeast) Carpet





PBA-MV-15-122812-7	<1,000 (non detected)			Random Area #7 (Private office to southwest) Carpet
PBA-MV-15-122812-8	< 1,000 (non detected)			Random Area #8 (Private office to east) Chair
PBA-MV-15-122812-9	<1,000 (non detected)			Random Area #9 (Open office to west) Carpet

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Conditioning (A/C) Returns and Supply Wipe Dust Samples







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-15-122812-R1	< 1,000 (non detected)			A/C return (Conference room to east)
PBA-W-15-122812-R2	< 1,000 (non detected)			A/C return (Office to southeast)
PBA-W-15-122812-R3	< 1,000 (non detected)			A/C return (Offices to southwest)







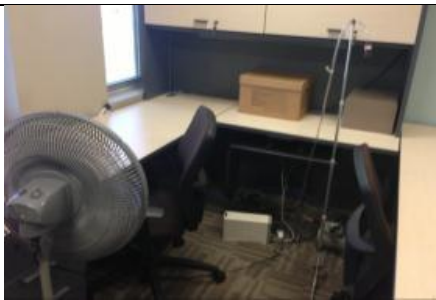

PBA-W-15-122812-R4	< 1,000 (non detected)			A/C return (Lobby to west)
PBA-W-15-122812-S1	< 1,000 (non detected)			A/C supply (Hallway to south)

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-15-122812-1	0.00081			Random Area #1 (Private office to south)
PBA-A-15-122812-2	0.0012			Random Area #2 (Private office to west)
PBA-A-15-122812-3	0.0014			Random Area #3 (Private office with conference room to northeast)




PBA-A-15-122812-4	<0.00073			Random Area #4 (Private office to northwest)
PBA-A-15-122812-5	0.0012			Random Area #5 (Women restroom to center)
PBA-A-15-122812-6	0.00075			Random Area #6 (Private office to southeast)





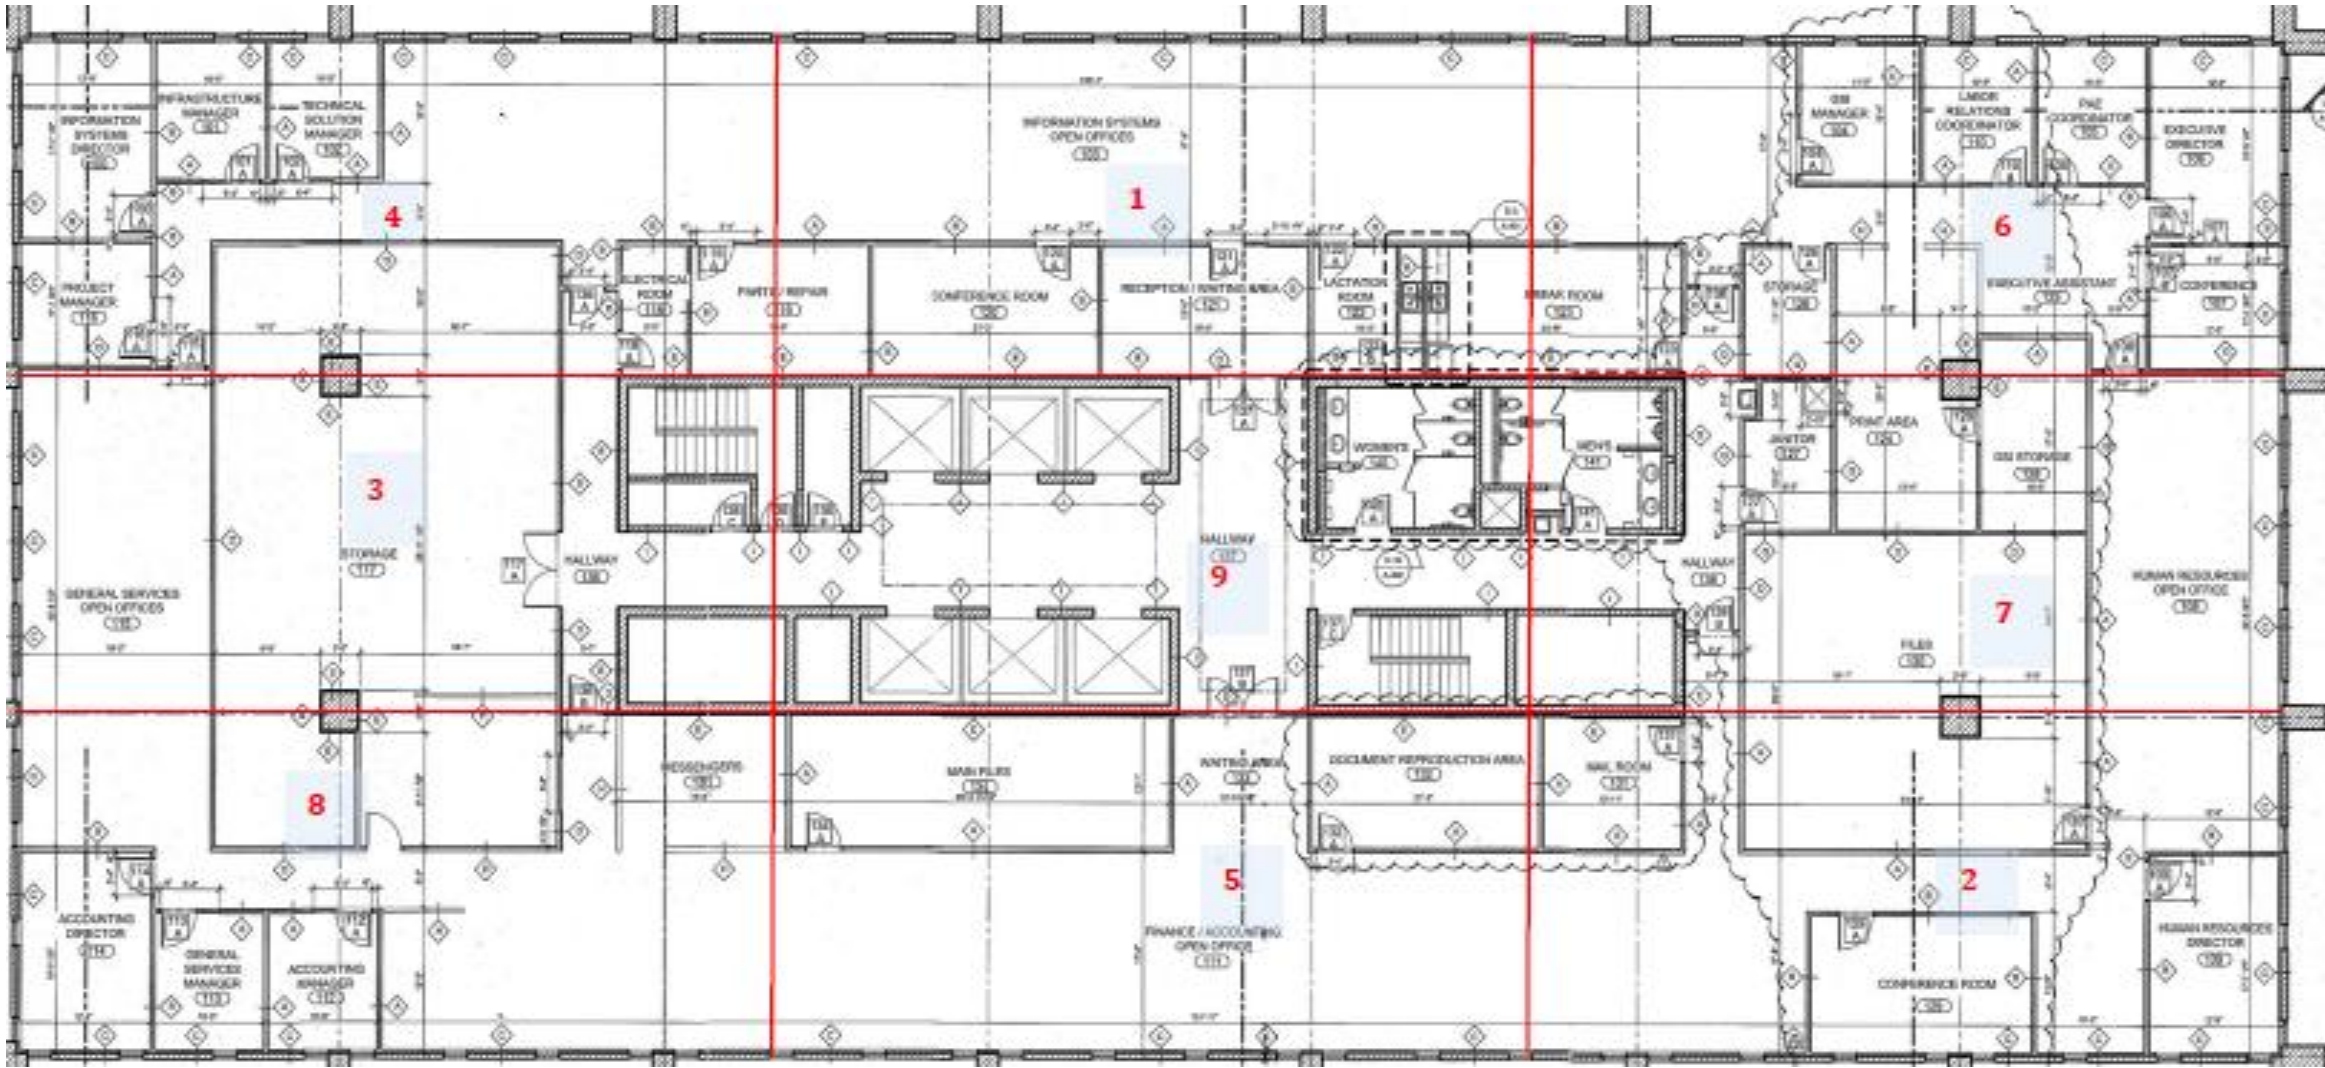

PBA-A-15-122812-7	<0.00073			Random Area #7 (Private office to southwest)
PBA-A-15-122812-8	<0.00073			Random Area #8 (Reception to north)
PBA-A-15-122812-9	< 0.00074			Random Area #9 (Public office to east)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc


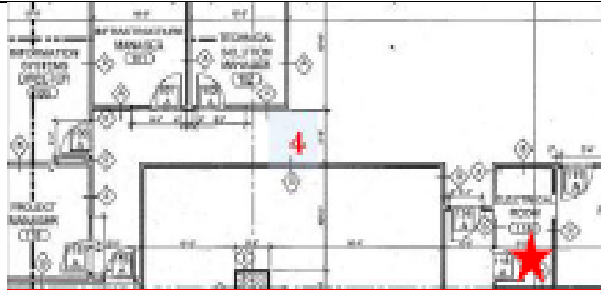

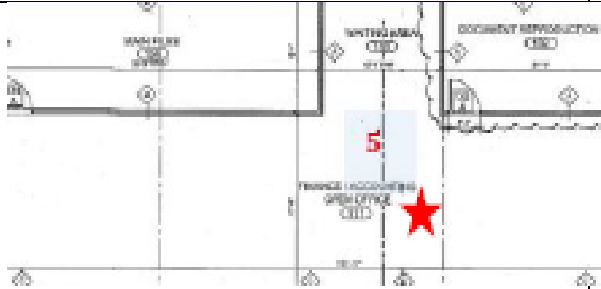

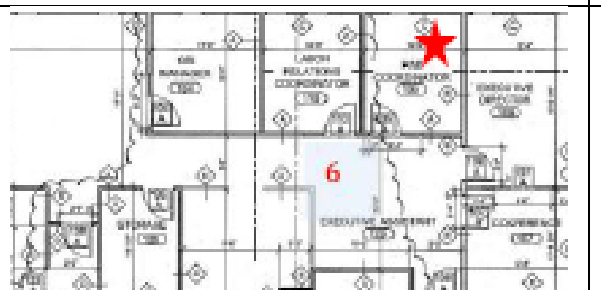
Area: Level 14<sup>th</sup>


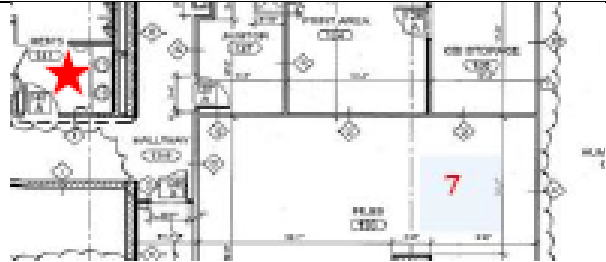



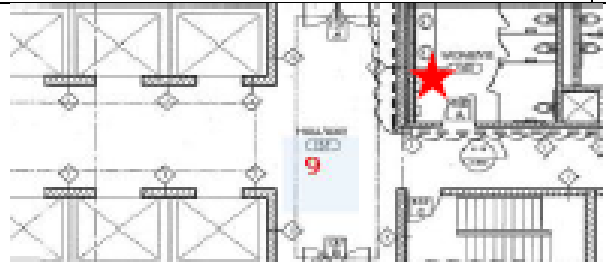


Non-porous Surfaces Wipe Dust Samples Data \*

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-14-010413-1	<1,000 (non detected)			Random Area #1 (Cubicle office to north)  Desk
PBA-W-14-010413-2	2,100 (2 Chrysotile)			Random Area #2 (Mailroom to southeast)  Copier
PBA-W-14-010413-3	<1,000 (non detected)			Random Area #3 (Cubicle office to west)  Non-porous partition


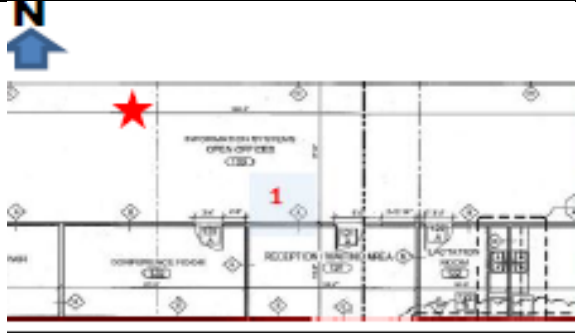
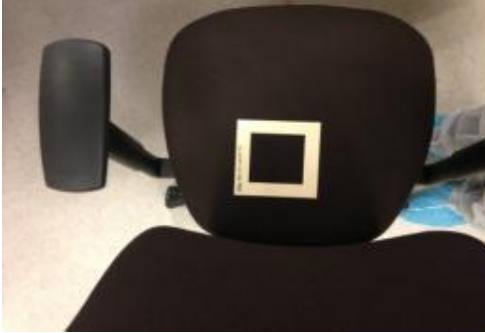





PBA-W-14-010413-4	<1,000 (non detected)			Random Area #4 (Electrical room to northwest) Floor
PBA-W-14-010413-5	<1,000 (non detected)			Random Area #5 (Open office to south) Desk
PBA-W-14-010413-6	<1,000 (non detected)			Random Area #6 (Private office to northeast) Keyboard base







PBA-W-14-010413-7	2,100 (2 Chrysotile)			Random Area #7 (Men restroom to east) Floor
PBA-W-14-010413-8	< 1,000 (non detected)			Random Area #8 (Private office to southwest) Cabinet
PBA-W-14-010413-9	1,000 (1 Chrysotile)			Random Area #9 (Women restroom to center) Vanity top







\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

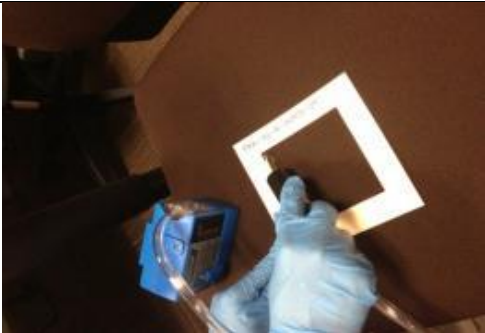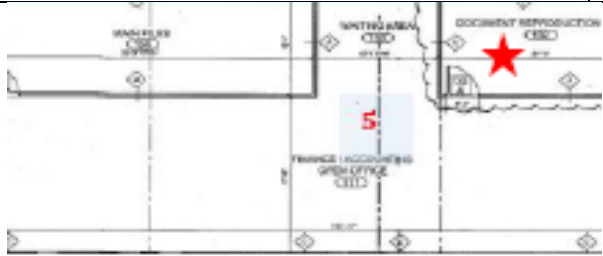**Porous Surfaces Microvac Wipe Dust Samples Data\***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-14-010413-1	<1,000 (non detected)			Random Area #1 (Open cubicle to north) Carpet
PBA-MV-14-010413-2	<1,000 (non detected)			Random Area #2 (Files room to southeast) Chair
PBA-MV-14-010413-3	<1,000 (non detected)			Random Area #3 (Open cubicle to west) Chair

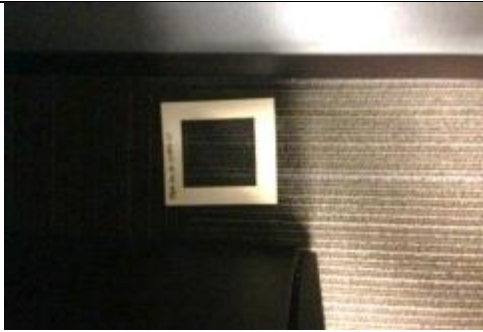


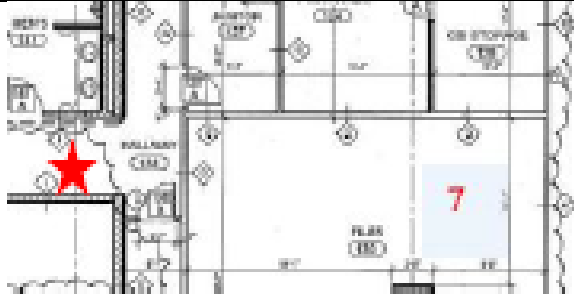


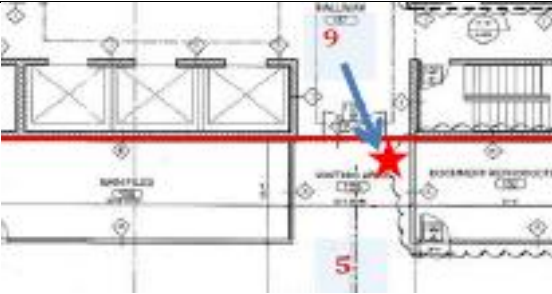


PBA-MV-14-010413-4	<1,000 (non detected)			Random Area #4 (Open cubicle to northwest) Partition
PBA-MV-14-010413-5	<1,000 (non detected)			Random Area #5 (Conference room to south) Chair
PBA-MV-14-010413-6	<1,000 (non detected)			Random Area #6 (Private office to northeast) Chair

PBA-MV-14-010413-7	<1,000 (non detected)			Random Area #7 (Open cubicle to east) Partition
PBA-MV-14-010413-8	< 1,000 (non detected)			Random Area #8 (Open cubicle to east) Partition
PBA-MV-14-010413-9	<1,000 (non detected)			Random Area #9 (Reception to south) Carpet: no porous surfaces were identified in RA 9

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$


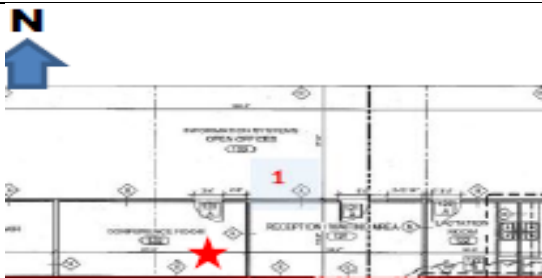
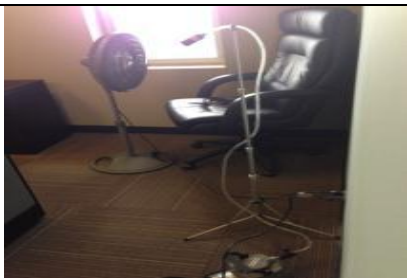



Air Conditioning (A/C) Returns and Supply Wipe Dust Samples

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-14-010413-R1	2,100 (2 Chrysotile)			A/C return (Lobby to west)
PBA-W-14-010413-R2	< 1,000 (non detected)			A/C return (Lobby to east)
PBA-W-14-010413-R3	< 1,000 (non detected)			A/C return (Offices to east)

PBA-W-14-010413-R4	< 1,000 (non detected)			A/C return (Offices to west)
PBA-W-14-010413-S1	< 1,000 (non detected)			A/C supply (Office to west)

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-14-010413-1	0.0032 by NIOSH 7400  And  <0.00064 by NIOSH 7402 (no asbestos fibers)			Random Area #1 (Conference room to north)
PBA-A-14-010413-2	0.0020 by NIOSH 7400  And  <0.00025 by NIOSH 7402 (no asbestos fibers)			Random Area #2 (Private office to southeast)
PBA-A-14-010413-3	0.00082			Random Area #3 (Storage to west)

PBA-A-14-010413-4	<0.00075			Random Area #4 (Private office to northwest)
PBA-A-14-010413-5	<0.00074			Random Area #5 (Files room to south)
PBA-A-14-010413-6	0.0013			Random Area #6 (Conference to east)




PBA-A-14-010413-7	<0.00073			Random Area #7 (Printing room to east)
PBA-A-14-010413-8	0.0011			Random Area #8 (Private room to southwest)
PBA-A-14-010413-9	0.0015			Random Area #9 (Women restroom to center)





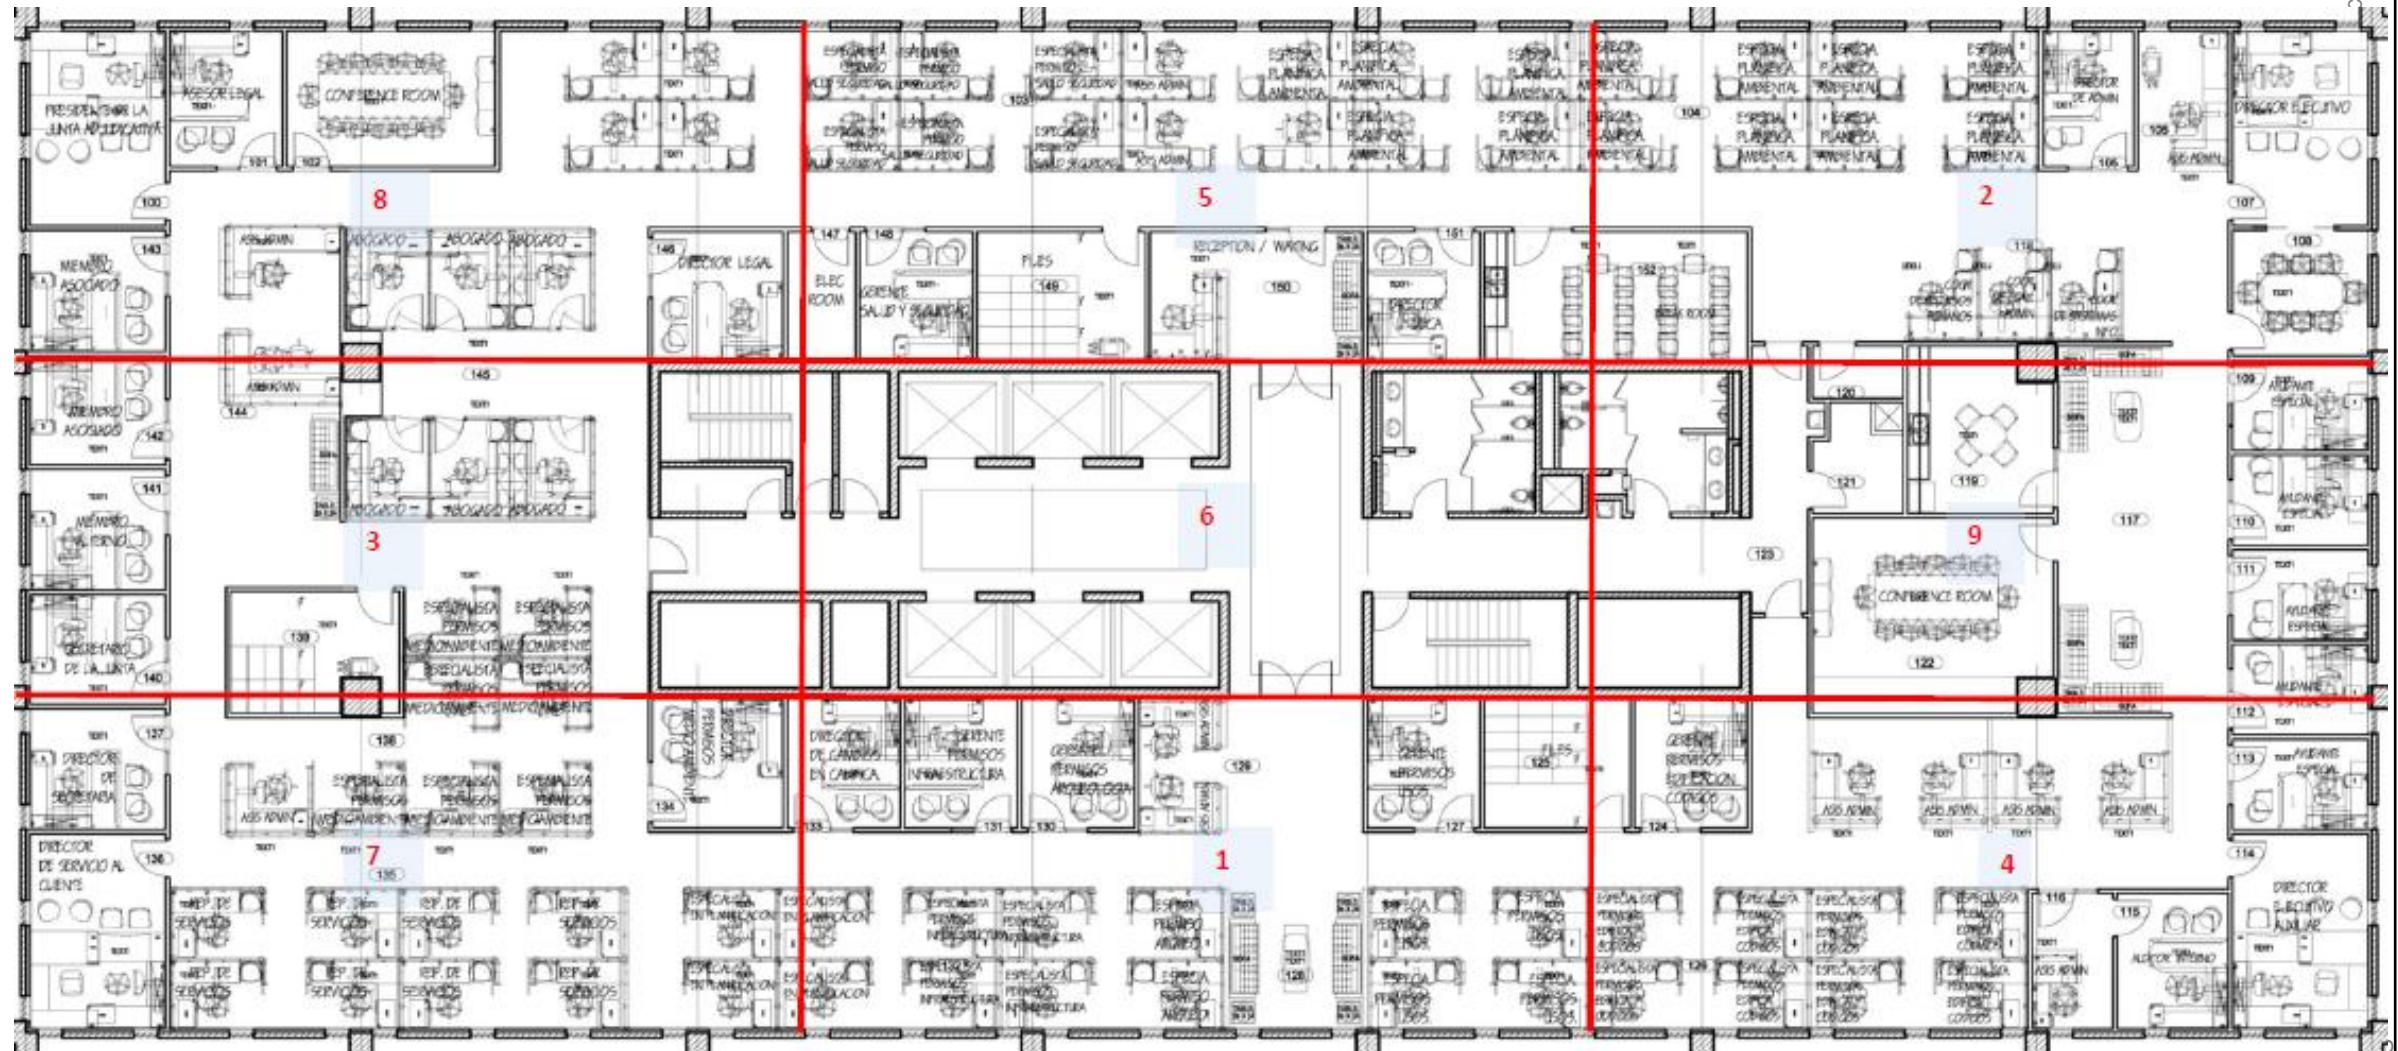

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc






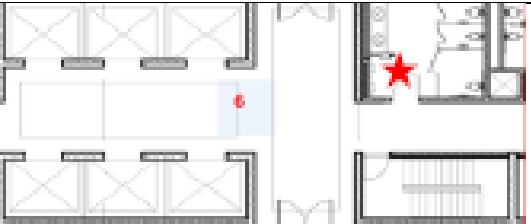



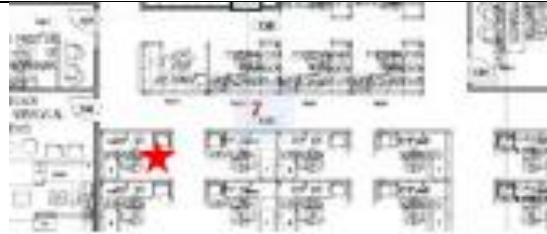

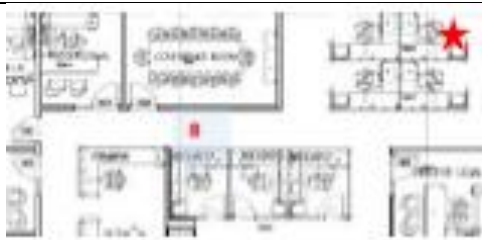


—  
O  
C



Non-porous Surfaces Wipe Dust Samples Data \*

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-13-021413-1	<990 (non detected)			Random Area #1 (Reception to south) Desk
PBA-W-13-021413-2	<990 (non detected)			Random Area #2 (Open cubicles to northeast) Cabinet
PBA-W-13-021413-3	<990 (non detected)			Random Area #3 (Open cubicle office to west) Copier







PBA-W-13-021413-4	<990 (non detected)			Random Area #4 (Private office to southeast) Elevated Cabinet
PBA-W-13-021413-5	<990 (non detected)			Random Area #5 (Open cubicle offices to north) Desk
PBA-W-13-021413-6	990 (1 Chrysotile)			Random Area #6 (Women restroom to center) Floor


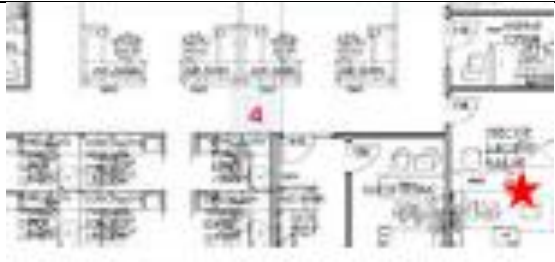




PBA-W-13-021413-7	<990 (non detected)			Random Area #7 (Open cubicle office to southwest) Non-porous chair
PBA-W-13-021413-8	<990 (non detected)			Random Area #8 (Open cubicle to northwest) Keyboard base
PBA-W-13-021413-9	<990 (non detected)			Random Area #9 (Hallway to east) Floor

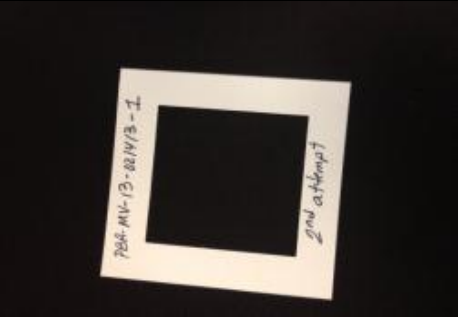\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>





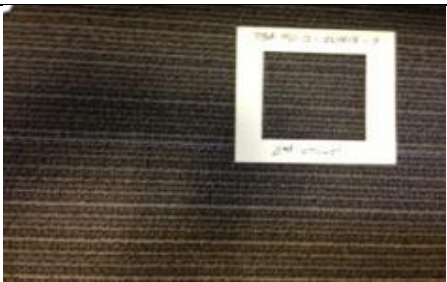
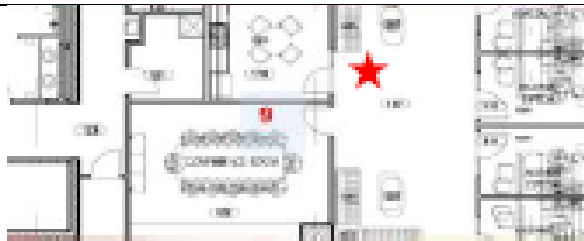


**Porous Surfaces Microvac Wipe Dust Samples Data\***

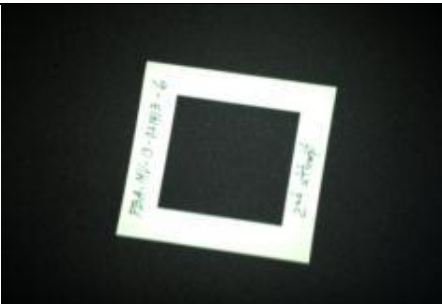Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-13-021413-1	<1,000 (non detected)			Random Area #1 (Private office to south) Chair
PBA-MV-13-021413-2	<1,000 (non detected)			Random Area #2 (Hallway to northeast) Carpet
PBA-MV-13-021413-3	<1,000 (non detected)			Random Area #3 (Waiting area to west) Carpet



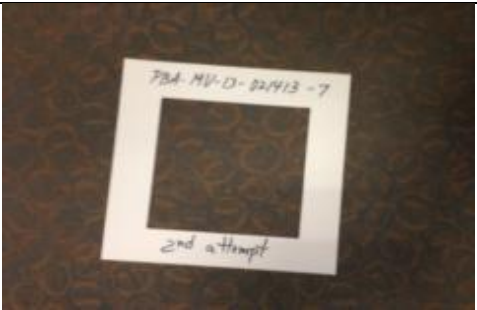



PBA-MV-13-021413-4	<1,000 (non detected)			Random Area #4 (Private office to southeast) Chair
PBA-MV-13-021413-5	<1,000 (non detected)			Random Area #5 (Open office to north) Chair
PBA-MV-13-021413-6	<1,000 (non detected)			Random Area #6 (Reception at RA#5 to north) Chair: no porous area surfaces were identified in RA#6



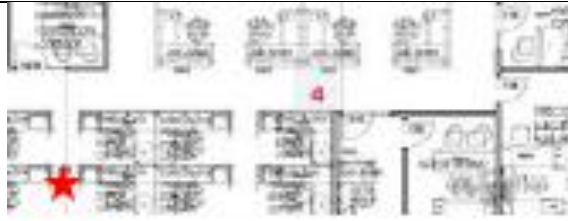


PBA-MV-13-021413-7	<1,000 (non detected)			Random Area #7 (Private office to northwest) Sofa
PBA-MV-13-021413-8	< 1,000 (non detected)			Random Area #8 (Private office to northwest) Carpet
PBA-MV-13-021413-9	<1,000 (non detected)			Random Area #9 (Waiting to east) Carpet

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>





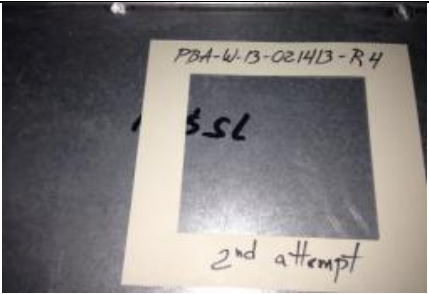

Air Conditioning (A/C) Returns and Supply Wipe Dust Samples

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-13-021413-R1	< 990 (non detected)			A/C return (Lobby to east)
PBA-W-13-021413-R2	< 990 (non detected)			A/C return (Lobby to west)
PBA-W-13-021413-R3	< 990 (non detected)			A/C return (Offices to southeast)

PBA-W-13-021413-R4	< 990 (non detected)			A/C return (Offices to west)
PBA-W-13-021413-S1	< 990 (non detected)			A/C supply (Open cubicle to southeast)




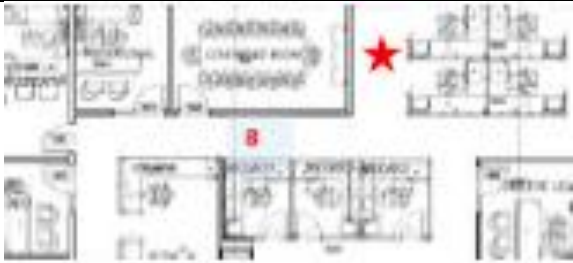

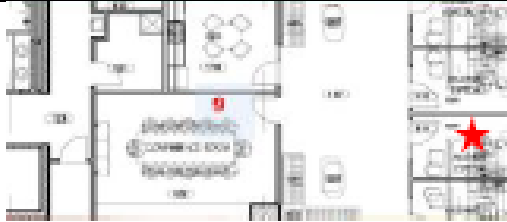
\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-13-021413-1	0.0012			Random Area #1 (Cubicle office to south)
PBA-A-13-021413-2	0.0026 by NIOSH 7400 and <0.0013 by NIOSH 7402			Random Area #2 (Private office to northeast)
PBA-A-13-021413-3	0.0011			Random Area #3 (Private office to west)

PBA-A-13-021413-4	<0.00078			Random Area #4 (Open office to northwest)
PBA-A-13-021413-5	<0.0019			Random Area #5 (Private office to north)
PBA-A-13-021413-6	0.0034 by NIOSH 7400 and <0.00012 by NIOSH 7402			Random Area #6 (Women restroom to center)



PBA-A-13-021413-7	<0.00074			Random Area #7 (Private office to southwest)
PBA-A-13-021413-8	0.0014			Random Area #8 (Open cubicles to northwest)
PBA-A-13-021413-9	0.0015			Random Area #9 (Private office to east)




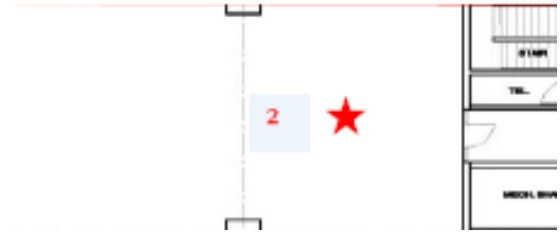
\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc






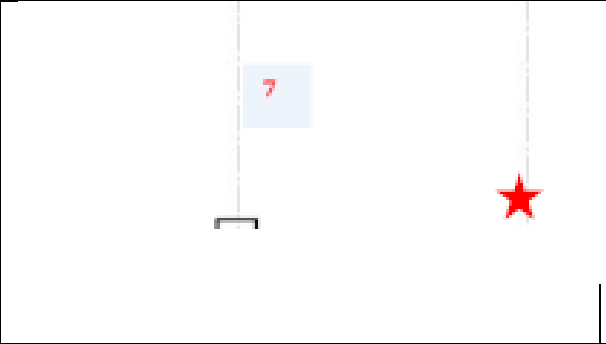

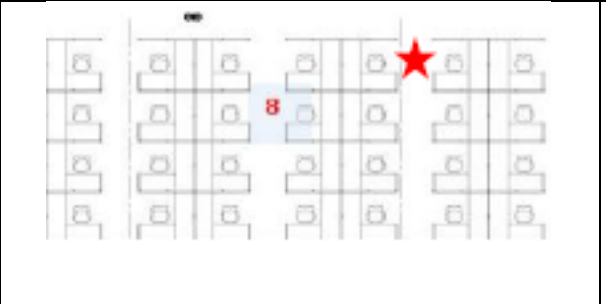
## Area: Level 12<sup>h</sup>





Non-porous Surfaces Wipe Dust Samples Data \*

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-12-021413-1	<990 (non detected)			Random Area #1 (Open cubicle to north) Elevated cabinet
PBA-W-12-021413-2	<990 (non detected)			Random Area #2 (Open office to west) Elevated cabinet

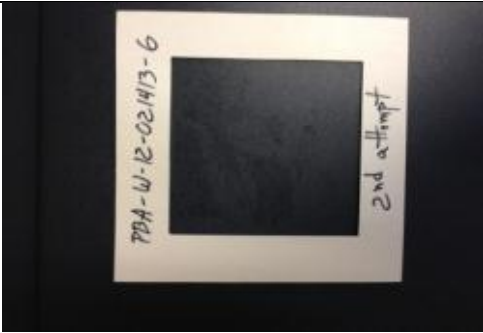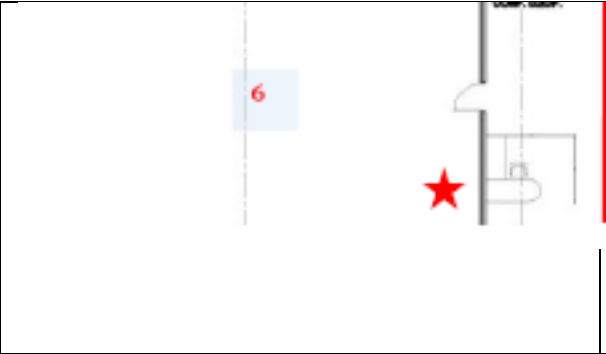


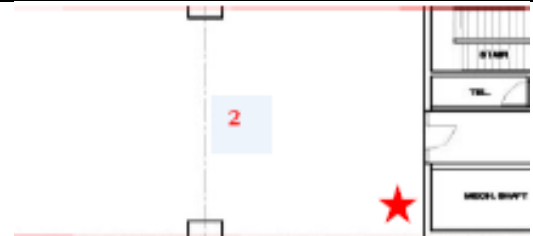
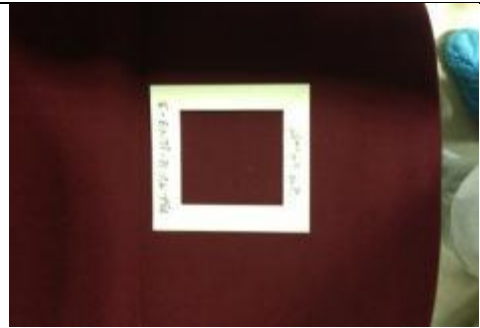

PBA-W-12-021413-3	<990 (non detected)			Random Area #3 (Open office to southeast) Copier
PBA-W-12-021413-4	<990 (non detected)			Random Area #4 (Lobby to center) Floor
PBA-W-12-021413-5	<990 (non detected)			Random Area #5 (Conference to east) Cabinet

PBA-W-12-021413-6	990 (1 Chrysotile)			Random Area #6 (Open areas to southwest) Printer
PBA-W-12-021413-7	990 (1 Chrysotile)			Random Area #7 (Server room to northwest) Floor
PBA-W-12-021413-8	<990 (non detected)			Random Area #8 (Conference to south) Small table


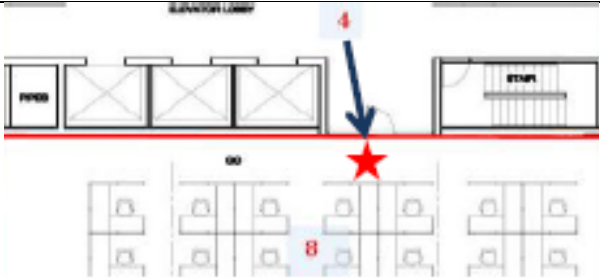
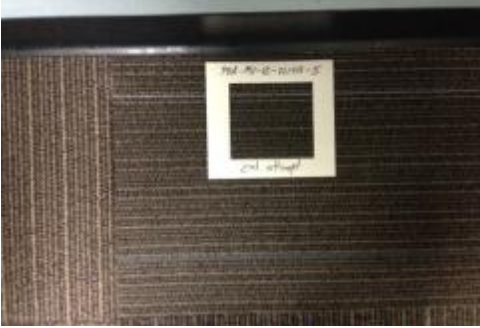



PBA-W-12-021413-9	<990 (non detected)			Random Area #9 (Open cubicle to northeast) Desk
-------------------	------------------------	--	---	---


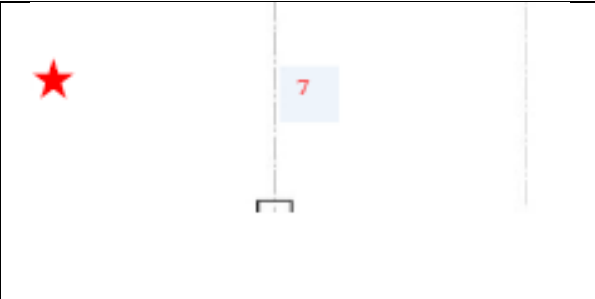

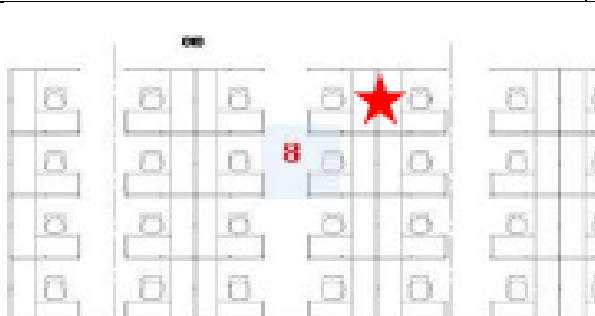
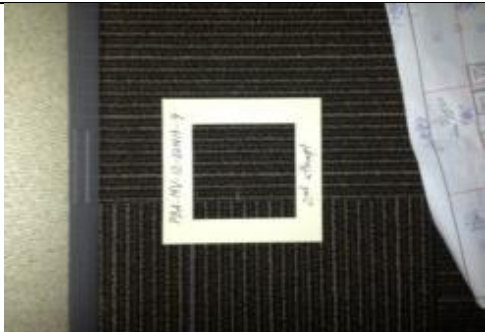
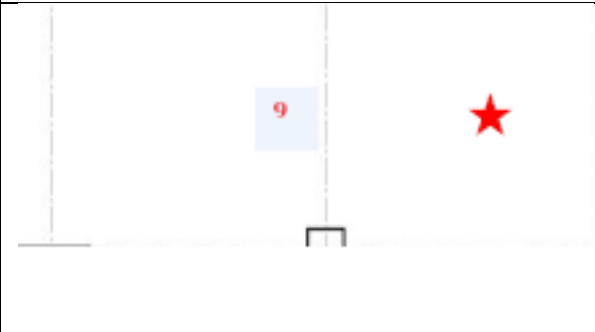
\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

**Porous Surfaces Microvac Wipe Dust Samples Data\***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-12-021513-1	<1,000 (non detected)			Random Area #1 (Open cubicle to north) Partition
PBA-MV-12-021513-2	<1,000 (non detected)			Random Area #2 (Waiting area to west) Chair
PBA-MV-12-021513-3	<1,000 (non detected)			Random Area #3 (Break room to southeast) Chair



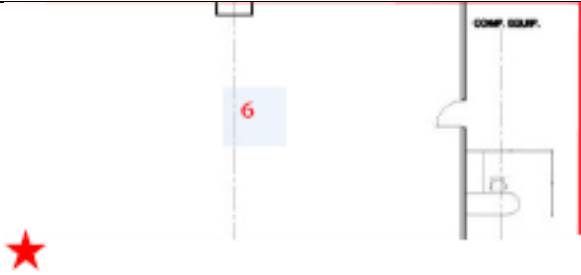


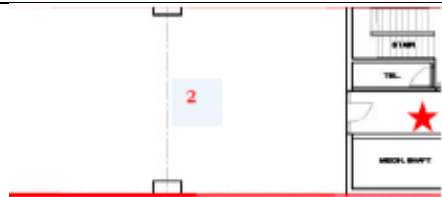



PBA-MV-12-021513-4	<1,000 (non detected)			Random Area #4 (Reception at RA #8 to south)  Sofa: no porous surfaces were identified in RA #4
PBA-MV-12-021513-5	<1,000 (non detected)			Random Area #5 (Private office to west)  Carpet
PBA-MV-12-021513-6	<1,000 (non detected)			Random Area #6 (Private office to southwest)  Chair

PBA-MV-12-021513-7	<1,000 (non detected)			Random Area #7 (Private office to northwest) Chair
PBA-MV-12-021513-8	< 1,000 (non detected)			Random Area #8 (Conference room to south) Carpet
PBA-MV-12-021513-9	<1,000 (non detected)			Random Area #9 (Open cubicle to northeast) Carpet

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$




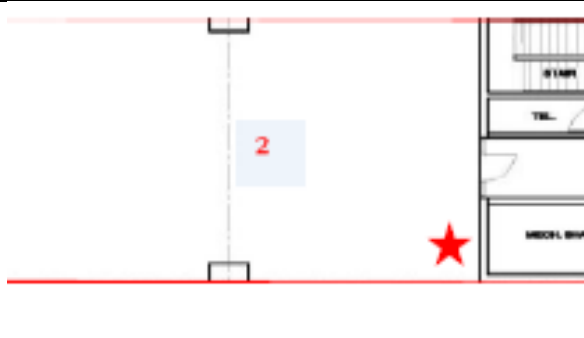

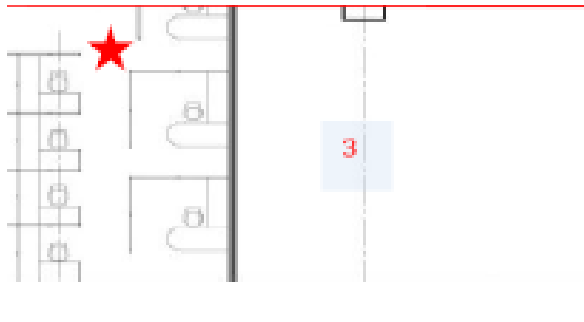
Air Conditioning (A/C) Returns and Supply Wipe Dust Samples




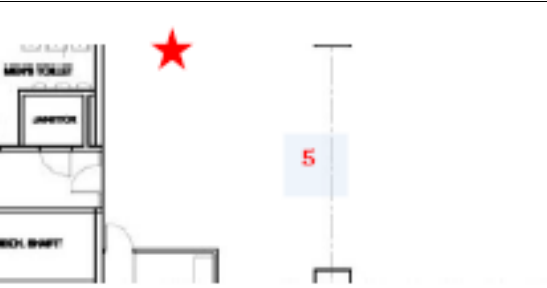

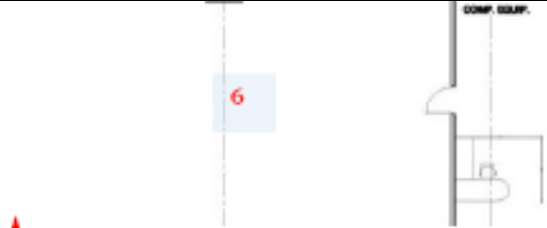
Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-12-021413-R1	< 990 (non detected)			A/C return (Lobby to east)
PBA-W-12-021413-R2	< 990 (non detected)			A/C return (Offices to east)
PBA-W-12-021413-R3	< 990 (non detected)			A/C return (Lobby to west)

PBA-W-12-021413-R4	< 990 (non detected)			A/C return (Offices to west)
PBA-W-12-021413-S1	< 990 (non detected)			A/C supply (Open cubicle to northwest)


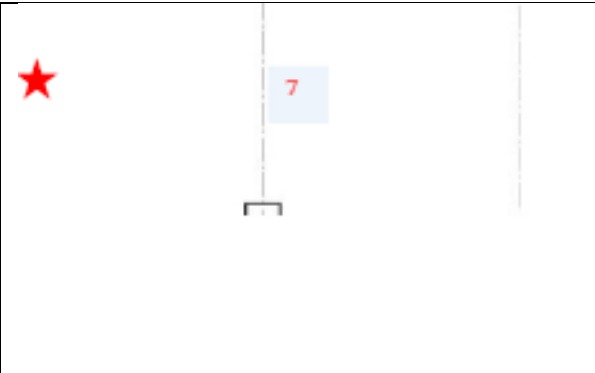

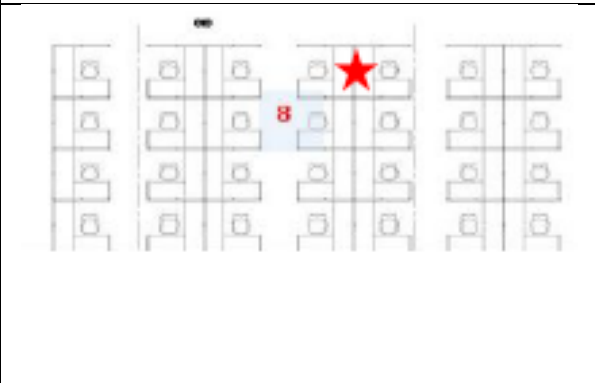

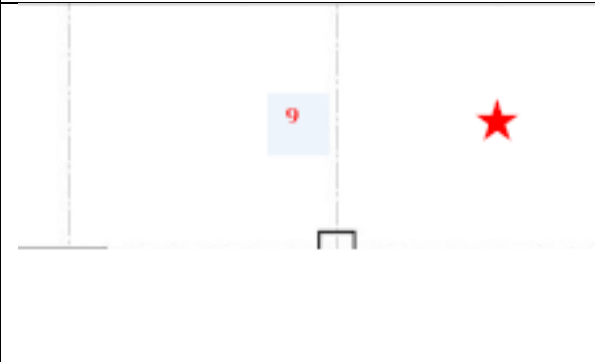
\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-12-021413-1	<0.00065			Random Area #1 (Break room to north)
PBA-A-12-021413-2	<0.00066			Random Area #2 (Waiting area to west)
PBA-A-12-021413-3	<0.000069			Random Area #3 (Storage to southeast)


PBA-A-12-021413-4	0.0017			Random Area #4 (Lobby to center)
PBA-A-12-021413-5	<0.00069			Random Area #5 (Waiting area to east)
PBA-A-12-021413-6	<0.00067			Random Area #6 (Open cubicles to southwest)







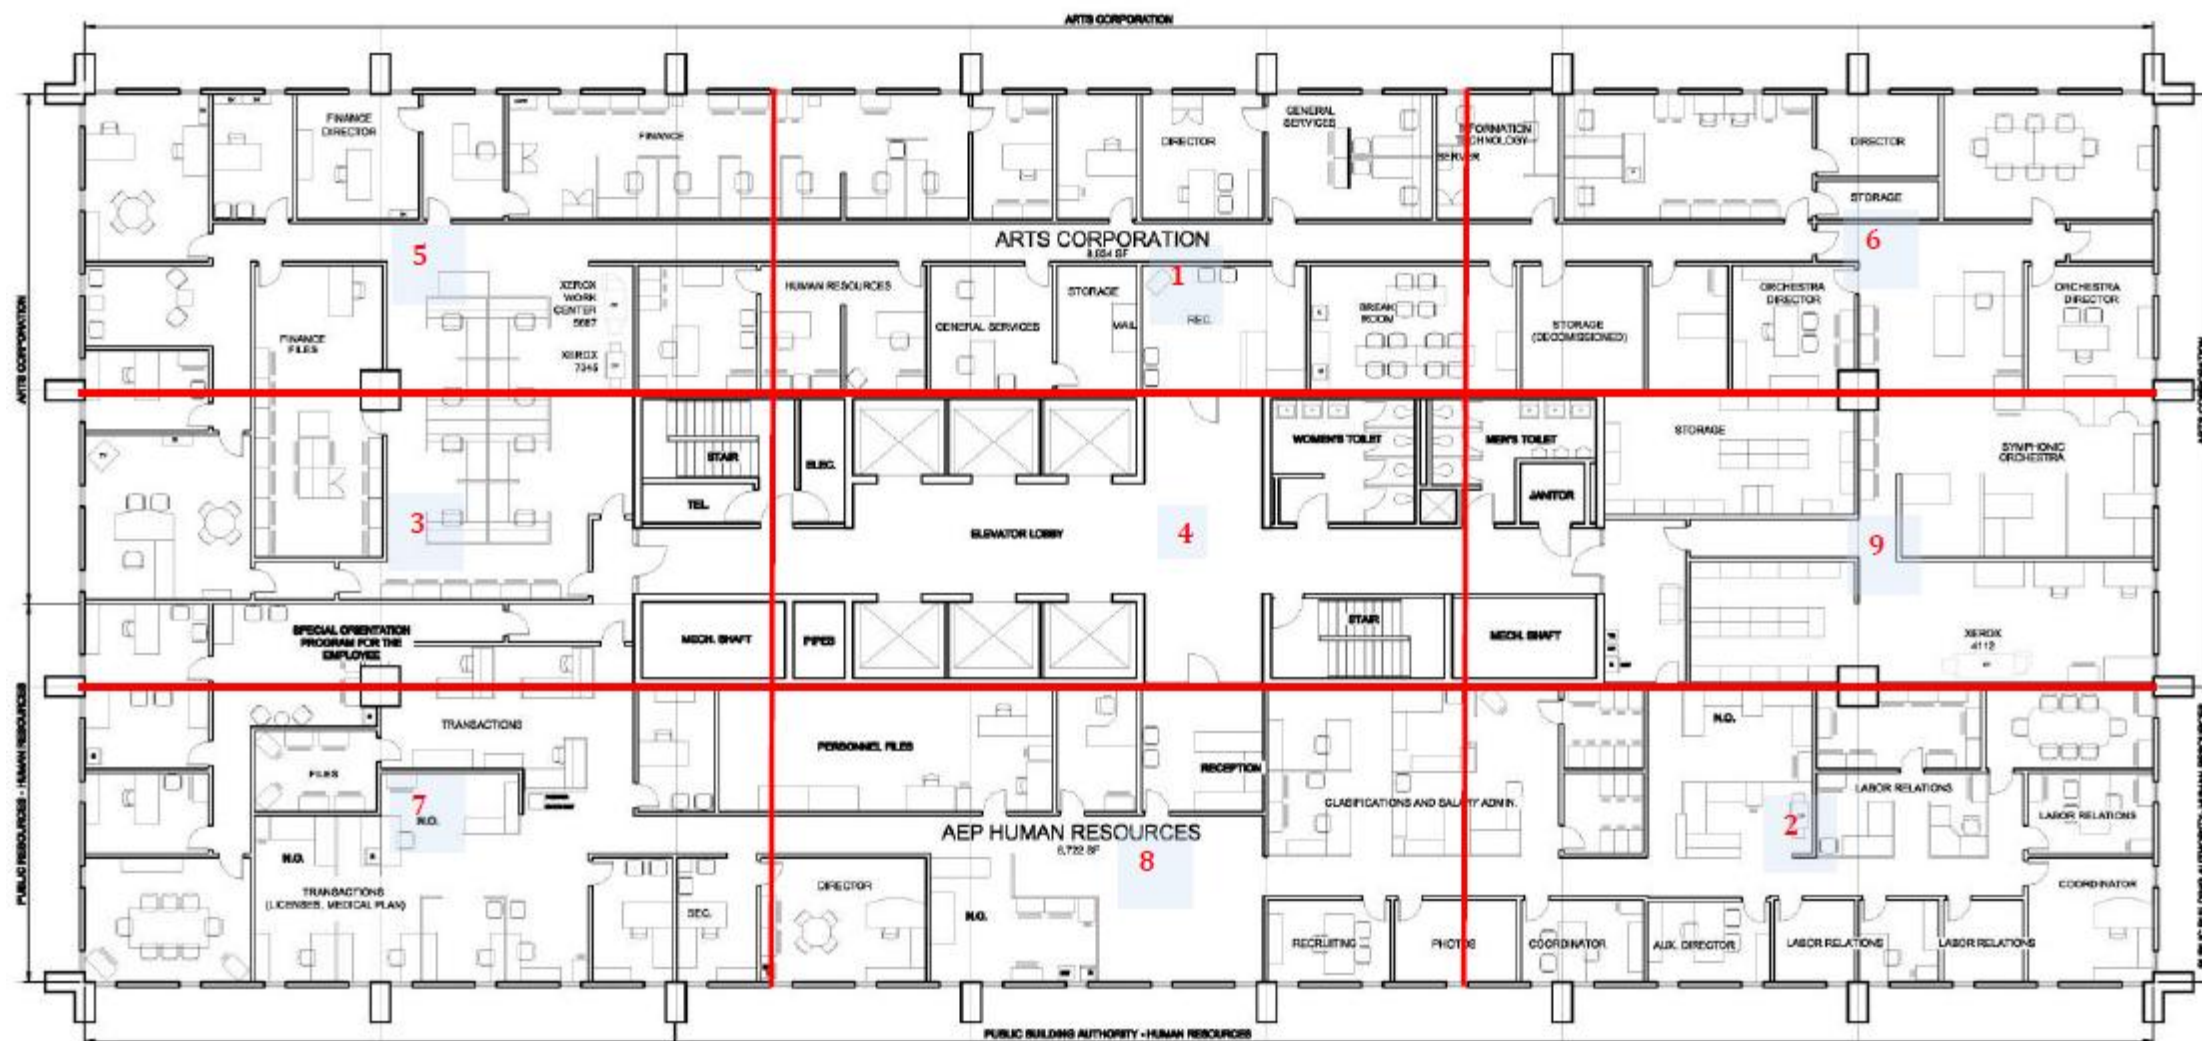

PBA-A-12-021413-7	<0.00065			Random Area #7 (Private office to northwest)
PBA-A-12-021413-8	0.00081			Random Area #8 (Hallway to south)
PBA-A-12-021413-9	0.00069			Random Area #9 (Open cubicle to northeast)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc

# Area: Level 11<sup>th</sup>



**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-11-020113-1	<1,000 (non detected)			Random Area #1 (Private office to north)  Desk
PBA-W-11-020113-2	<1,000 (non detected)			Random Area #2 (Cubicle office to southeast)  Cabinet
PBA-W-11-020113-3	<1,000 (non detected)			Random Area #3 (Private office to west)  Floor







PBA-W-11-020113-4	<1,000 (non detected)			Random Area #4 (Lobby to center) Floor
PBA-W-11-020113-5	<1,000 (non detected)			Random Area #5 (Open office to northwest) Floor
PBA-W-11-020113-6	<1,000 (non detected)			Random Area #6 (Open office to northwest) Floor

PBA-W-11-020113-7	<1,000 (non detected)			Random Area #7 (Open office to southwest) Cabinet
PBA-W-11-020113-8	<1,000 (non detected)			Random Area #8 (Open cubicle to south) Floor
PBA-W-11-020113-9	<1,000 (non detected)			Random Area #9 (Men restroom to east) Sink







\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>









**Porous Surfaces Microvac Wipe Dust Samples Data\***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-11-020113-1	<1,000 (non detected)			Random Area #1 (Reception to north) Chair
PBA-MV-11-020113-2	<1,000 (non detected)			Random Area #2 (Storage to southeast) Chair
PBA-MV-11-020113-3	<1,000 (non detected)			Random Area #3 (Open cubicle to west) Partition




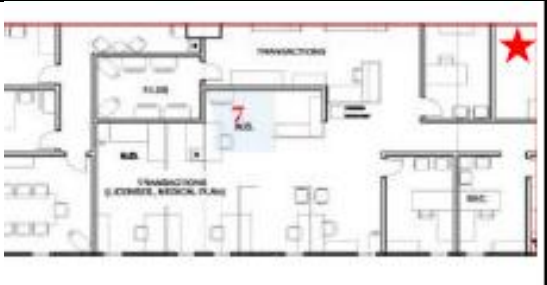






PBA-MV-11-020113-4	<1,000 (non detected)			Random Area #4 (Reception at RA #1 to north) Pillow: no porous surfaces were identified in RA #4
PBA-MV-11-020113-5	<1,000 (non detected)			Random Area #5 (Private office to northwest) Chair
PBA-MV-11-020113-6	<1,000 (non detected)			Random Area #6 (Server room to northeast) Partition

PBA-MV-11-020113-7	<1,000 (non detected)			Random Area #7 (Open office to southwest) Partition
PBA-MV-11-020113-8	< 1,000 (non detected)			Random Area #8 (Private office to south) Chair
PBA-MV-11-020113-9	<1,000 (non detected)			Random Area #9 (Open cubicle to east) Chair

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>







Air Conditioning (A/C) Returns and Supply Wipe Dust Samples

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-11-020113-R1	<1,000 (non detected)			A/C return (Offices to east)
PBA-W-11-020113-R2	<1,000 (non detected)			A/C return (Offices to west)
PBA-W-11-020113-R3	<1,000 (non detected)			A/C return (Lobby to west)

PBA-W-11-020113-R4	<1,000 (non detected)			A/C return (Lobby to east)
--------------------	--------------------------	--	---	-------------------------------

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-11-020113-1	<0.00074			Random Area #1 (Private office to north)
PBA-A-11-020113-2	<0.00074			Random Area #2 (Storage to southeast)
PBA-A-11-020113-3	<0.00075			Random Area #3 (Hallway to west)

PBA-A-11-020113-4	0.00075			Random Area #4 (Lobby to center)
PBA-A-11-020113-5	<0.00074			Random Area #5 (Private office to northwest)
PBA-A-11-020113-6	<0.00074			Random Area #6 (Storage to northeast)









PBA-A-11-020113-7	<0.00088	<div>NOT AVAILABLE</div>		<p>Random Area #7 (Private office to southwest)</p>
PBA-A-11-020113-8	<0.00075			<p>Random Area #8 (Open cubicle to south)</p>
PBA-A-11-020113-9	<0.00074			<p>Random Area #9 (Open storage to east)</p>

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc

## Area: Level 10<sup>th</sup>






**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-10-021113-1	<1,000 (non detected)			Random Area #1 (Lobby to center) Floor
PBA-W-10-021113-2	<1,000 (non detected)			Random Area #2 (Movable files room to southwest) Cabinet
PBA-W-10-021113-3	<1,000 (non detected)			Random Area #3 (Data entry room to northeast) Elevated cabinet


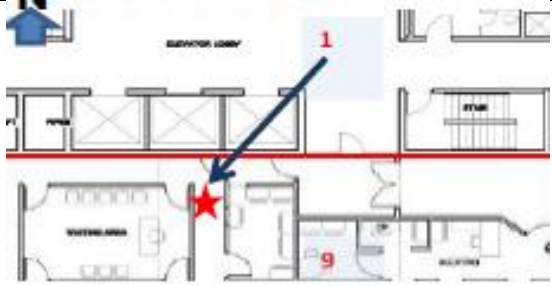


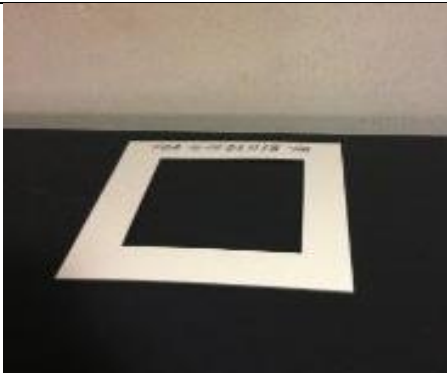

PBA-W-10-021113-4	<1,000 (non detected)			Random Area #4 (Private office to southeast) Cabinet
PBA-W-10-021113-5	<1,000 (non detected)			Random Area #5 (Storage to northwest) Safe box
PBA-W-10-021113-6	<1,000 (non detected)			Random Area #6 (Closet to east) Floor









PBA-W-10-021113-7	<1,000 (non detected)			Random Area #7 (Open office to north) Copier
PBA-W-10-021113-8	<1,000 (non detected)			Random Area #8 (Waiting area to west) Floor
PBA-W-10-021113-9	1,000 (1 Chrysotile)			Random Area #9 (Hallway to south) Floor





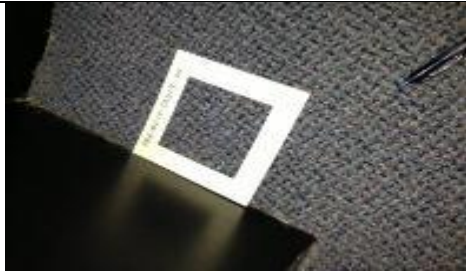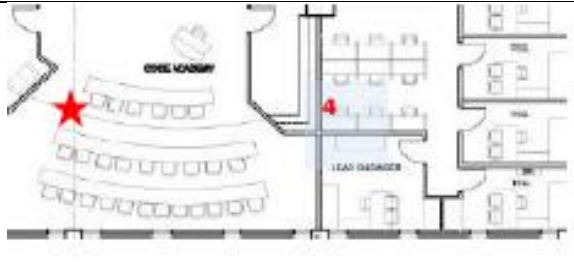

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

**Porous Surfaces Microvac Wipe Dust Samples Data\***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-10-021113-1	<1,000 (non detected)			Random Area #1 (Open office at RA #9 to south) Partition: no porous surfaces were identified in RA #1
PBA-MV-10-021113-2	<1,000 (non detected)			Random Area #2 (Open area to southwest) Chair
PBA-MV-10-021113-3	<1,000 (non detected)			Random Area #3 (Data entry room to northeast) Partition


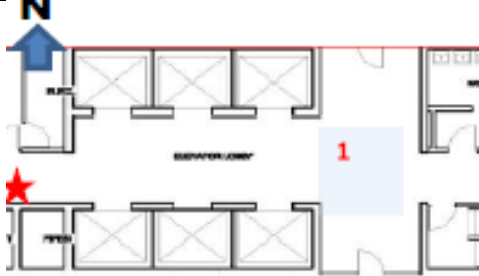








PBA-MV-10-021113-4	<1,000 (non detected)			Random Area #4 (Code academy to southeast) Carpet
PBA-MV-10-021113-5	<1,000 (non detected)			Random Area #5 (Reception area to northwest) Chair
PBA-MV-10-021113-6	<1,000 (non detected)			Random Area #6 (Private office to east) Chair

PBA-MV-10-021113-7	<1,000 (non detected)			Random Area #7 (Open cubicle to north) Chair
PBA-MV-10-021113-8	< 1,000 (non detected)			Random Area #8 (Archive room to the west) Cardboard box
PBA-MV-10-021113-9	<1,000 (non detected)			Random Area #9 (Open office to south) Partition

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>


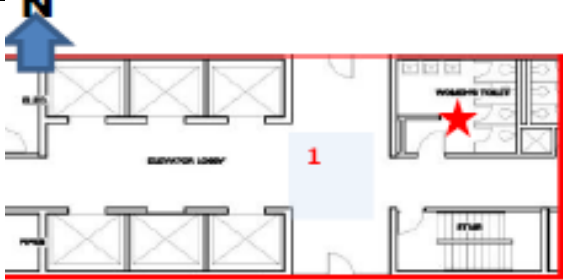




Air Conditioning (A/C) Returns and Supply Wipe Dust Samples

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-10-021113-R1	<1,000 (non detected)			A/C return (Lobby to west)
PBA-W-10-021113-R2	<1,000 (non detected)			A/C return (Lobby to east)
PBA-W-10-021113-R3	<1,000 (non detected)			A/C return (Offices to east)

PBA-W-10-021113-R4	<1,000 (non detected)			A/C return (Offices to west)
--------------------	--------------------------	--	---	---------------------------------

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>


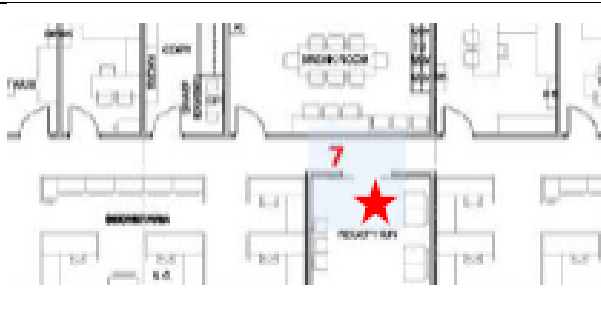




Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-10-021113-1	<0.00074			Random Area #1 (Women restroom to center)
PBA-A-10-021113-2	<0.00074			Random Area #2 (Movable files area to southwest)
PBA-A-10-021113-3	<0.00075			Random Area #3 (Private office to northeast)




PBA-A-10-021113-4	0.00075			Random Area #4 (Code academy to southeast)
PBA-A-10-021113-5	<0.00074			Random Area #5 (Break room to northwest)
PBA-A-10-021113-6	<0.00074			Random Area #6 (Private office to east)




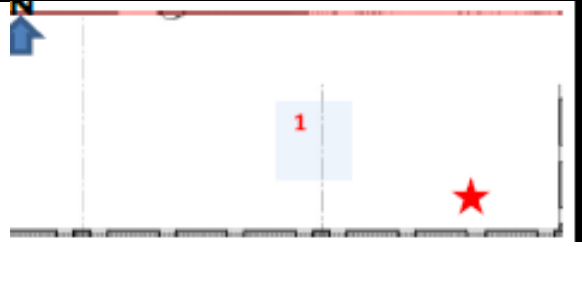




PBA-A-10-021113-7	<0.00088			Random Area #7 (Reception area to north)
PBA-A-10-021113-8	<0.00075			Random Area #8 (Drawing archive area to west)
PBA-A-10-021113-9	<0.00074			Random Area #9 (Private office to south)

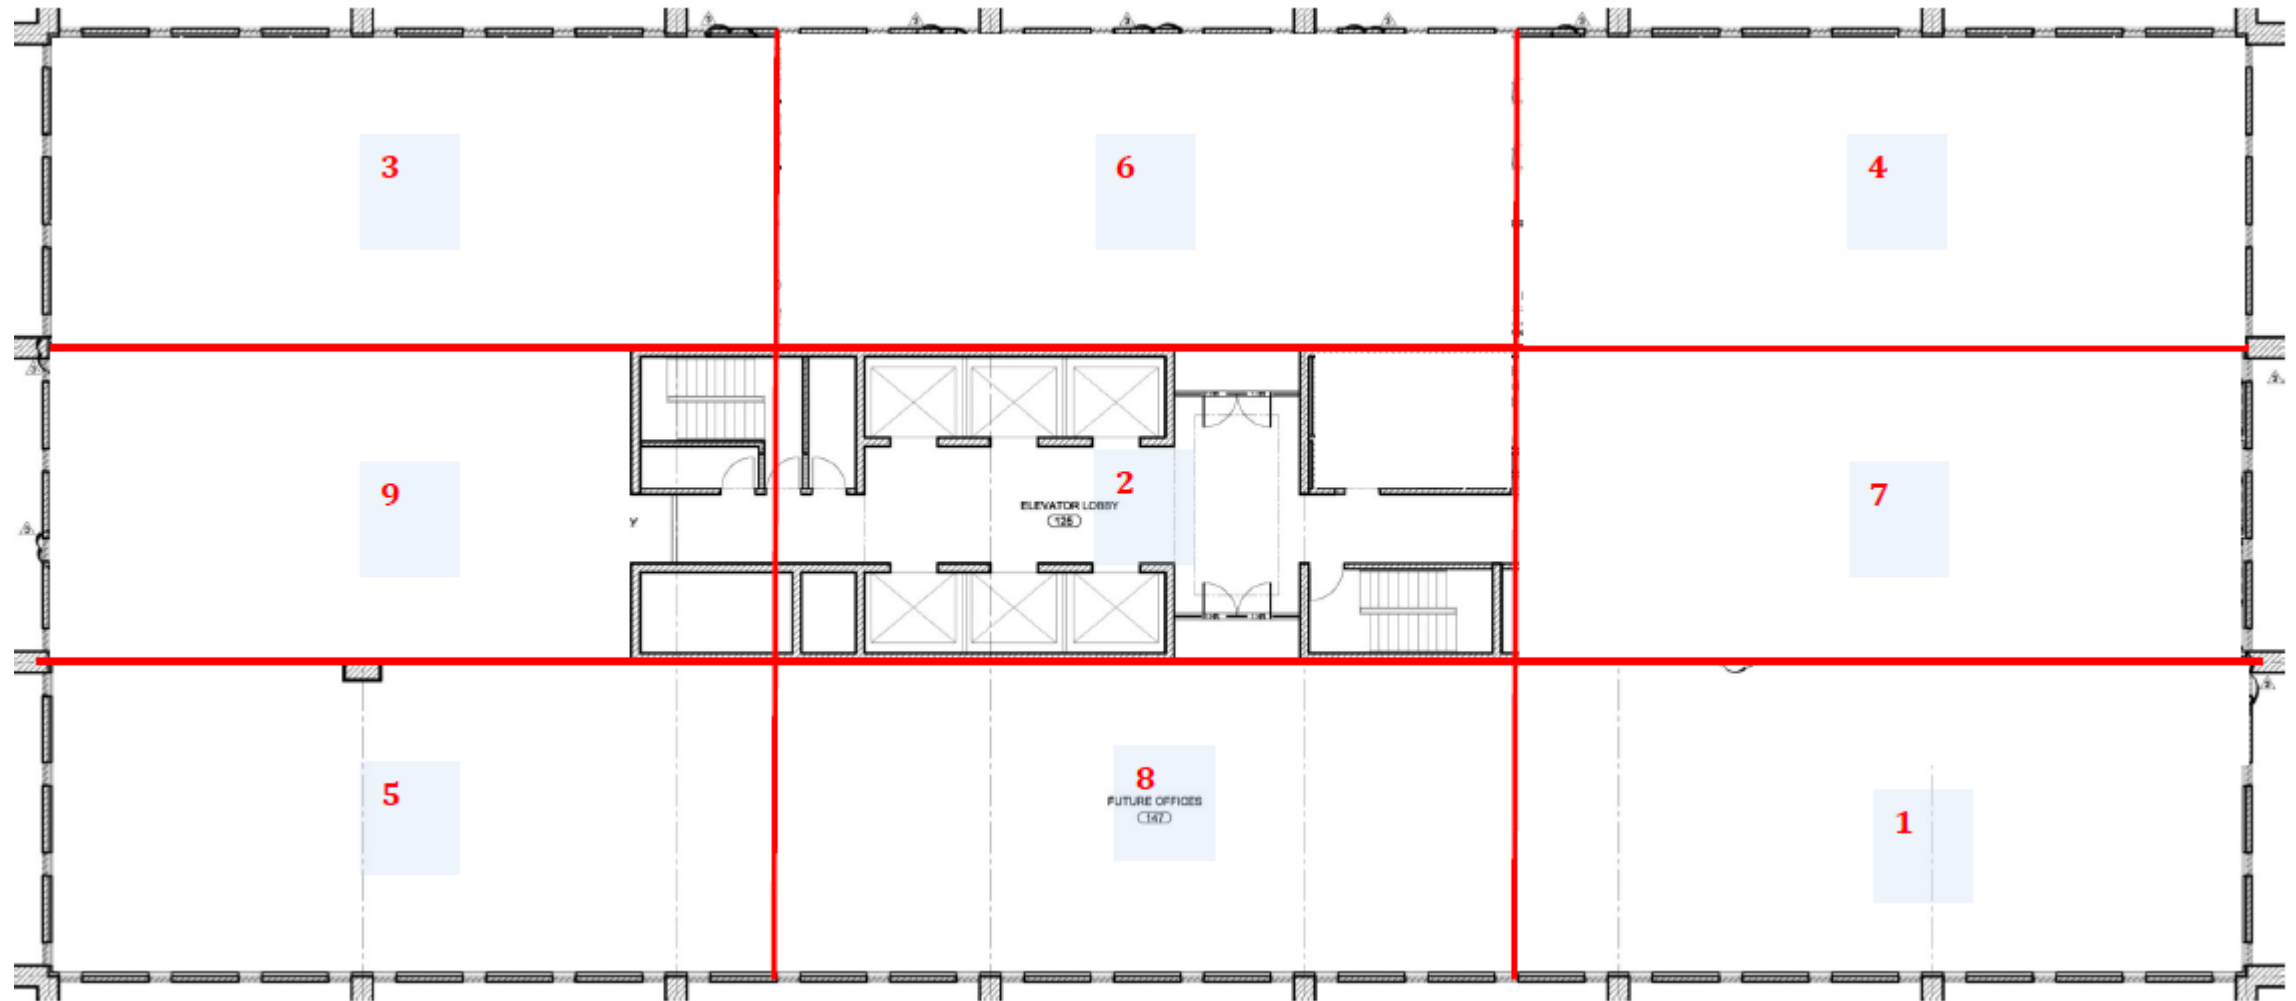





\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc






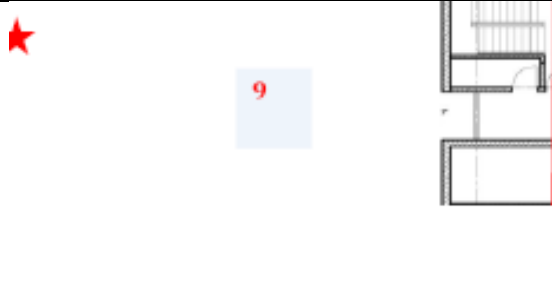
Area: Level 9<sup>th</sup>



**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-9-021613-1	<1,000 (non detected)			Random Area #1 (Open space to southeast) Floor
PBA-W-9-021613-2	<1,000 (non detected)			Random Area #2 (Lobby to center) Floor
PBA-W-9-021613-3	1,000 (1 Chrysotile)			Random Area #3 (Open space to northwest) Floor

PBA-W-9-021613-4	<1,000 (non detected)			Random Area #4 (Open space to northeast) Floor
PBA-W-9-021613-5	<1,000 (non detected)			Random Area #5 (Open space to southwest) Floor
PBA-W-9-021613-6	<1,000 (non detected)			Random Area #6 (Open space to north) Floor

PBA-W-9-021613-7	<1,000 (non detected)			Random Area #7 (Open space to east) Copier
PBA-W-9-021613-8	<1,000 (non detected)			Random Area #8 (Open space to south) Floor
PBA-W-9-021613-9	<1,000 (non detected)			Random Area #9 (Open space to west) Floor



\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>



### **Porous Surfaces Microvac Wipe Dust Samples Data**

**There were no porous surfaces in the Level 9<sup>th</sup> since the area was totally empty. Therefore, no samples were taken.**




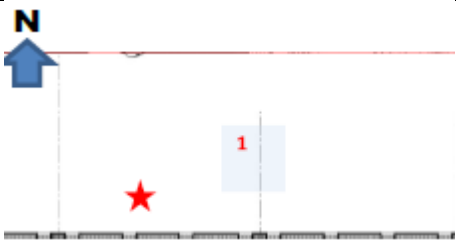




Air Conditioning (A/C) Returns and Supply Wipe Dust Samples

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-9-021163-R1	<1,000 (non detected)			A/C return (Lobby to east)
PBA-W-9-021613-R2	<1,000 (non detected)			A/C return (Open space southeast)
PBA-W-9-021613-R3	<1,000 (non detected)			A/C return (Open space southwest)

PBA-W-9-021613-R4	<1,000 (non detected)			A/C return (Lobby to west)
-------------------	--------------------------	--	---	-------------------------------

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A-9-021613-1	<0.00075			Random Area #1 (Open space to southeast)
PBA-A-9-021613-2	<0.00075			Random Area #2 (Lobby to center)
PBA-A-9-021613-3	<0.00074			Random Area #3 (Private office to northwest)

PBA-A-9-021613-4	<0.00075			Random Area #4 (Open space to northeast)
PBA-A-9-021613-5	<0.00074			Random Area #5 (Open space to southwest)
PBA-A-9-021613-6	<0.00092			Random Area #6 (Open space to north)

PBA-A-9-021613-7	<0.00074			Random Area #7 (Open space to east)
PBA-A-9-021613-8	<0.00075			Random Area #8 (Open space to south)
PBA-A-9-021613-9	<0.0017			Random Area #9 (Open space to west)


\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc

# **THIRD CLEANUP SEQUENCE**





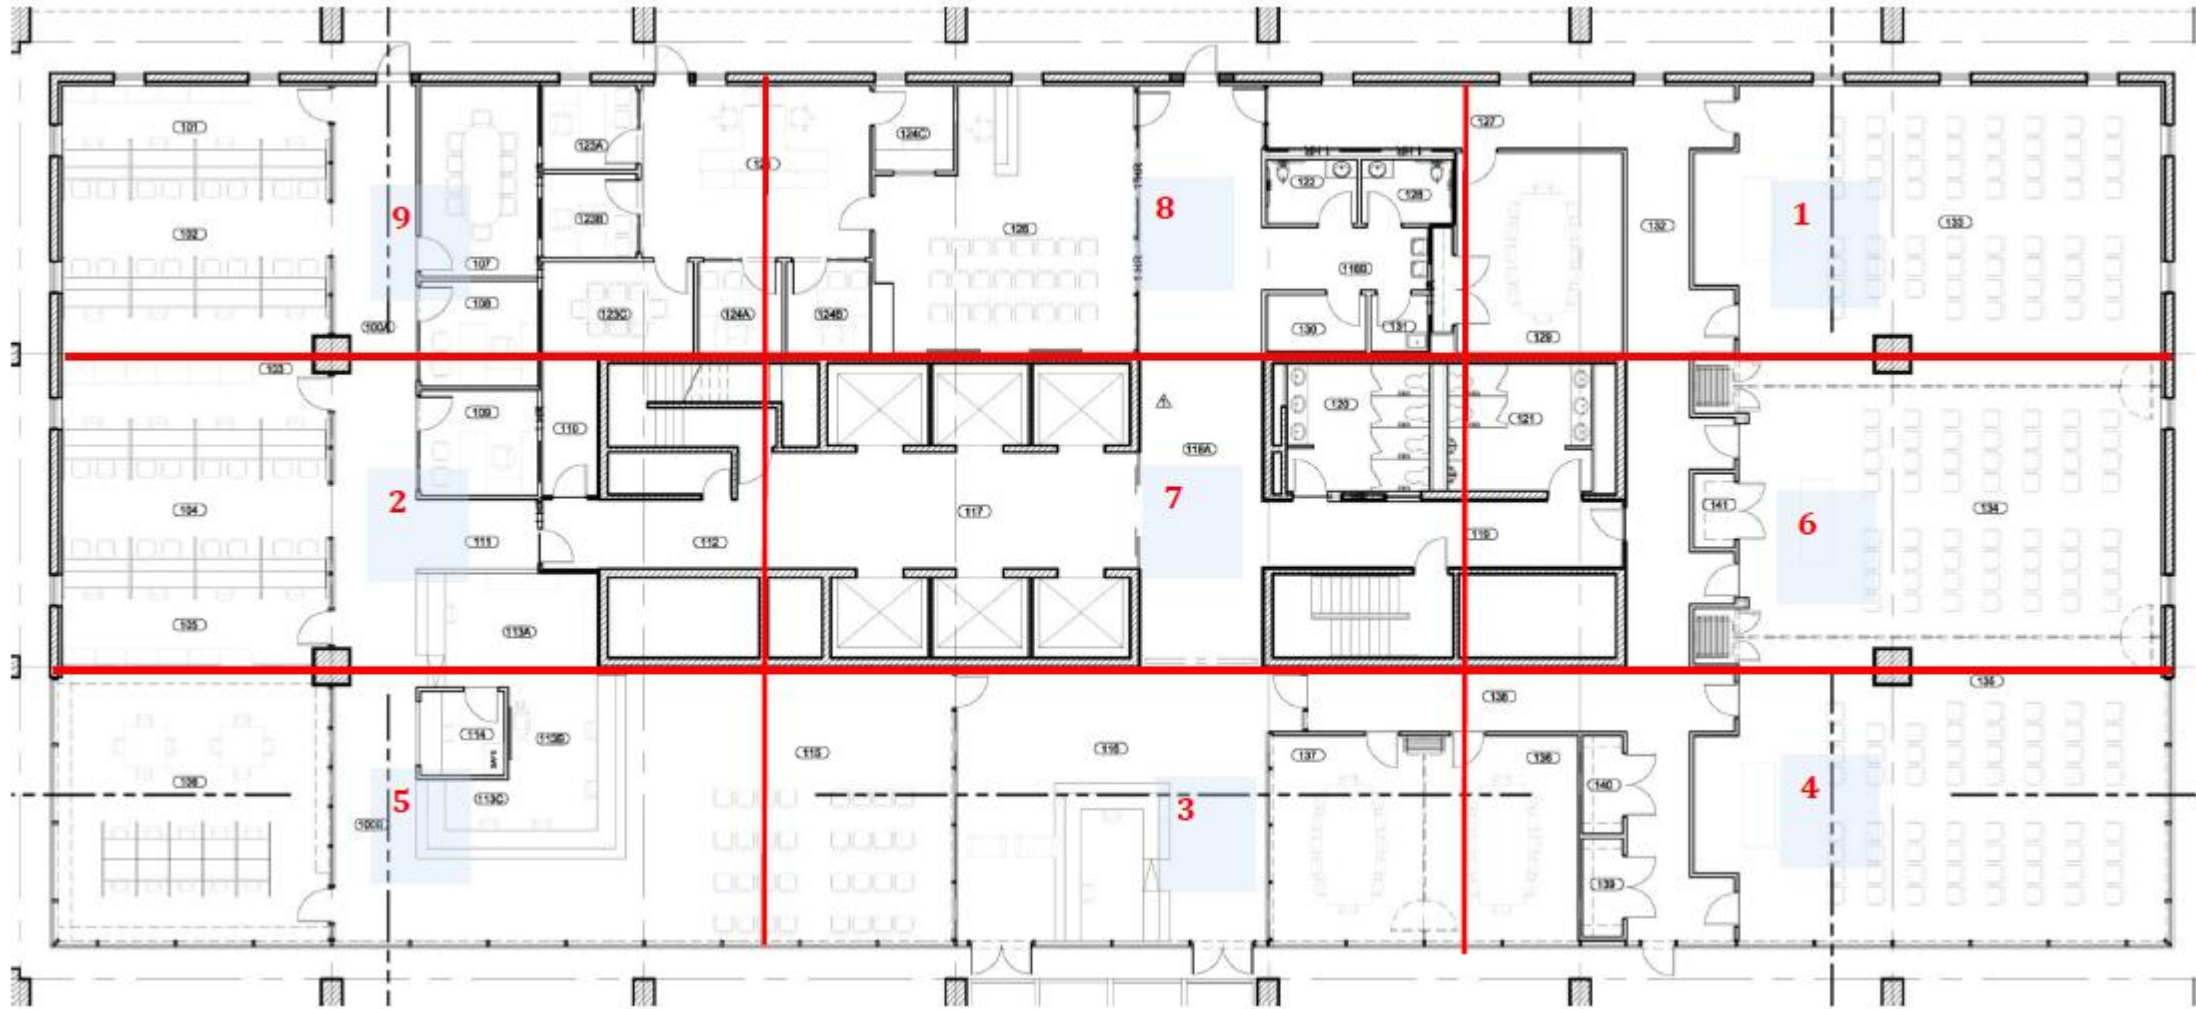

## **LEVELS P TO 8<sup>th</sup>**




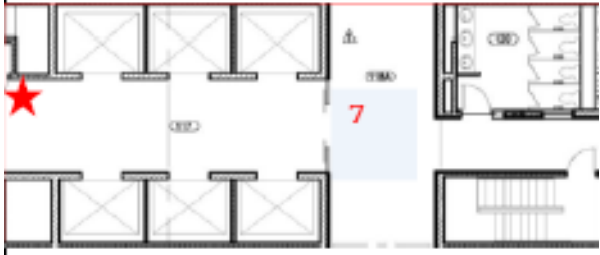

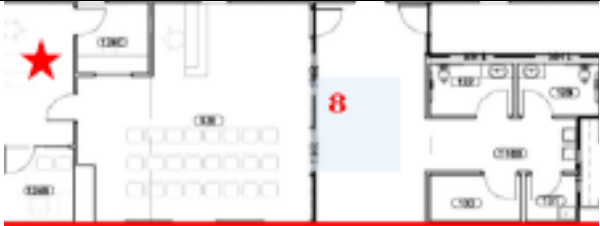


## Area: Level P



**Non-porous Surfaces Wipe Dust Samples Data \***


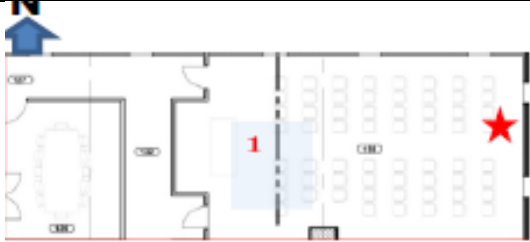




Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-P-021913-1	<990 (non detected)			Random Area #1 (Conference room to northeast) Table
PBA-W-P-021913-2	990 (1 Chrysotile)			Random Area #2 (Hallway to west) Floor
PBA-W-P-021913-3	<990 (non detected)			Random Area #3 (Conference room to south) Speaker phone

PBA-W-P-021913-4	<990 (non detected)			Random Area #4 (Closet to southeast) Shelf
PBA-W-P-021913-5	<990 (non detected)			Random Area #5 (Private office to southwest) Cabinet
PBA-W-P-021913-6	<990 (non detected)			Random Area #6 (Men restroom to east) Vanity

PBA-W-P-021913-7	990 (1 Chrysotile)			Random Area #7 (Lobby to center) Floor
PBA-W-P-021913-8	2,000 (2 Chrysotile)			Random Area #8 (Open office to north) Floor
PBA-W-P-021913-9	<990 (non detected)			Random Area #9 (Open cubicle to northwest) Window sill

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

**Porous Surfaces Microvac Wipe Dust Samples Data\***

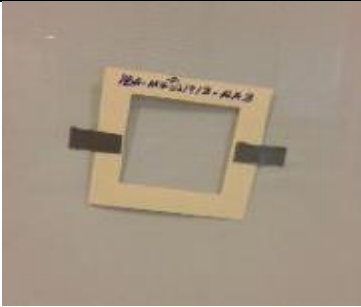Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-P-021913-1	<990 (non detected)			Random Area #1 (Hearing room "A" to northeast)  Carpet
PBA-MV- P-021913-2	<990 (non detected)			Random Area #2 (Private office to west)  Carpet
PBA-MV- P-021913-3	<990 (non detected)			Random Area #3 (Waiting area to south)  Curtain









PBA-MV- P-021913-4	<990 (non detected)	NOT AVAILABLE		Random Area #4 (Hearing room “C” to southeast) Carpet
PBA-MV- P-021913-5	<990 (non detected)			Random Area #5 (Reception area to southwest) Carpet
PBA-MV- P-021913-6	<990 (non detected)			Random Area #6 (Storage area to northeast) Carpet



PBA-MV- P-021913-7	<990 (non detected)			Random Area #7 (Hallway to east (RA#6))  Carpet  No porous surfaces were indentified in RA#7.
PBA-MV- P-021913-8	<990 (non detected)			Random Area #8 (Hallway to north)  Carpet
PBA-MV- P-021913-9	<990 (non detected)			Random Area #9 (Cubicle office to northwest)  Chair







\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$







Air Conditioning (A/C) Returns and Supply Wipe Dust Samples







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W- P-021913-R1	<990 (non detected)			A/C return (Lobby to east)
PBA-W- P-021913-R2	<990 (non detected)			A/C return (Lobby to west)
PBA-W- P-021913-S1	<990 (non detected)			A/C Supply (Hallway to east)

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- P-021913-1	0.0013			Random Area #1 (Hearing room “A” to northeast)
PBA-A- P-021913-2	0.0014			Random Area #2 (Cubicle offices to west)
PBA-A- P-021913-3	0.0027 by NIOSH 7400 <0.00011 by NIOSH 7402			Random Area #3 (Reception areas to south)

PBA-A- P-021913-4	<0.00072			Random Area #4 (Hearing room “C” to southeast)
PBA-A- P-021913-5	0.0039 by NIOSH 7400 <0.00013 by NIOSH 7402			Random Area #5 (Waiting area to southwest)
PBA-A- P-021913-6	0.0016			Random Area #6 (Hallway to east)

PBA-A- P-021913-7	0.0028 by NIOSH 7400 <0.0014 by NIOSH 7402			Random Area #7 (Hallway to center)
PBA-A- P-021913-8	0.0095 by NIOSH 7400 <0.0019 by NIOSH 7402			Random Area #8 (DACO reception areas to north)
PBA-A- P-021913-9	0.0058 by NIOSH 7400 <0.00073 by NIOSH 7402			Random Area #9 (Conference room to northwest)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc




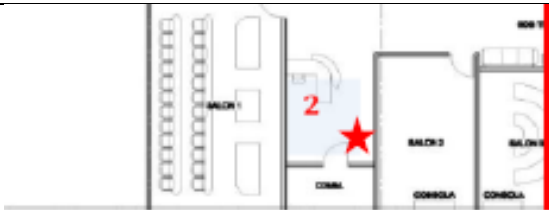









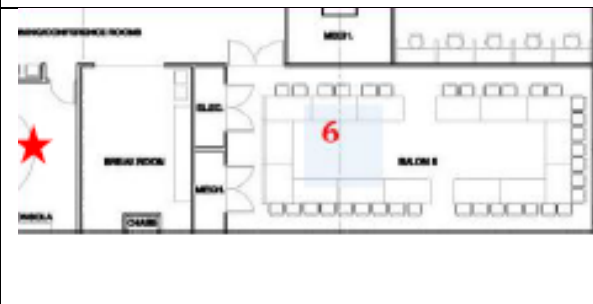
## Area: Level 2











**Non-porous Surfaces Wipe Dust Samples Data \***







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-2-022713-1	<990 (non detected)			Random Area #1 (Computer room to northeast) Cabinet
PBA-W-2-022713-2	<990 (non detected)			Random Area #2 (Reception to south) Floor
PBA-W-2-022713-3	990 (1 Chrysotile)			Random Area #3 (Hallway to west) Floor




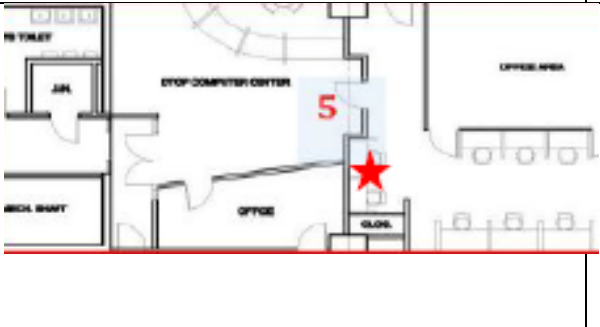
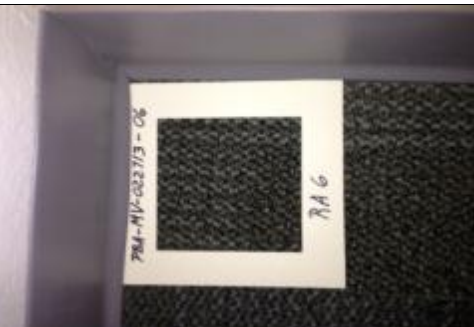

PBA-W-2-022713-4	<990 (non detected)			Random Area #4 (Data center to southwest) Floor
PBA-W-2-022713-5	<990 (non detected)			Random Area #5 (Hallway to east) Above of a small refrigerator
PBA-W-2-022713-6	<990 (non detected)			Random Area #6 (Training room to southeast) Counter


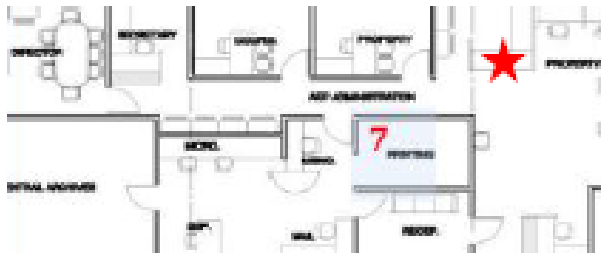
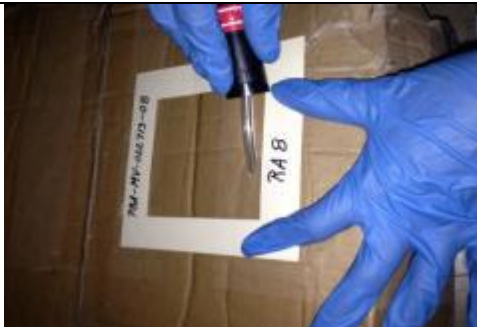


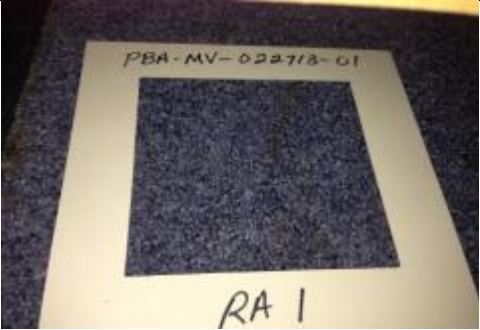
PBA-W-2-022713-7	990 (1 Chrysotile)			Random Area #7 (Reception to north) Desk
PBA-W-2-022713-8	2,000 (2 Chrysotile)			Random Area #8 (Area under construction to the northwest used as storage) Stocked hard ceiling tiles
PBA-W-2-022713-9	4,900 (5 Chrysotile)			Random Area #9 (Lobby to center) Floor

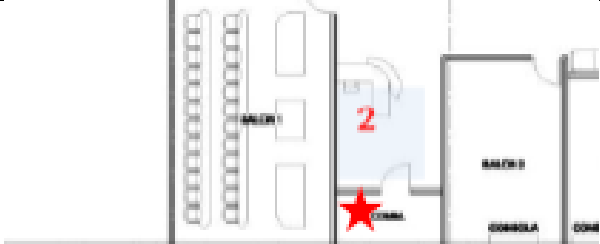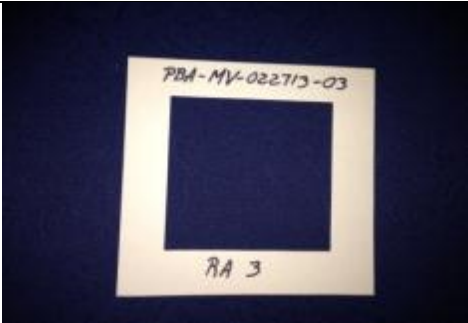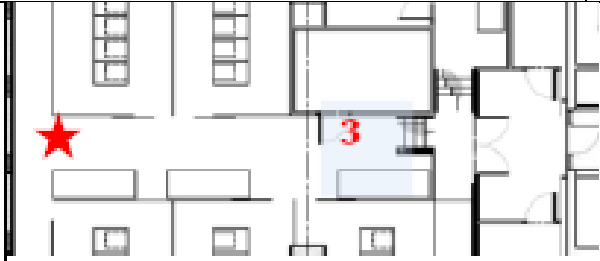\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Porous Surfaces Microvac Wipe Dust Samples Data\*

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-2-022713-1	<990 (non detected)			Random Area #1 (Storage to northeast) Carpet
PBA-MV- 2-022713-2	<990 (non detected)			Random Area #2 (Storage to south) Carpet
PBA-MV- 2-022713-3	<990 (non detected)			Random Area #3 (Data center to east) Chair


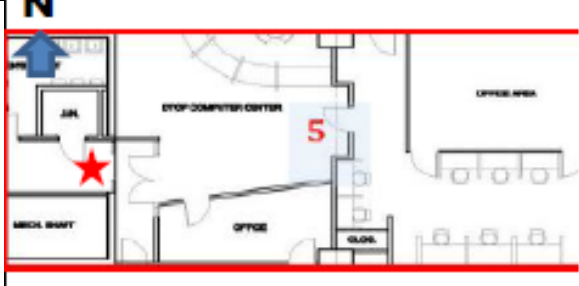




PBA-MV- 2-022713-4	<990 (non detected)			Random Area #4 (Area under construction to southwest) Partition
PBA-MV- 2-022713-5	<990 (non detected)			Random Area #5 (Cubicle office to east) Partition
PBA-MV- 2-022713-6	<990 (non detected)			Random Area #6 (Training room #5 to southeast) Carpet





PBA-MV- 2-022713-7	<990 (non detected)			Random Area #7 (Open office to north) Partition
PBA-MV- 2-022713-8	<990 (non detected)			Random Area #8 (Area under construction to the northwest used as storage) Cardboard box cover
PBA-MV- 2-022713-9	<990 (non detected)			Random Area #9 (Conference room at RA #7 to north) Chair No porous surfaces were identified in RA #9

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$









**Air Conditioning (A/C) Returns and Supply Wipe Dust Samples**


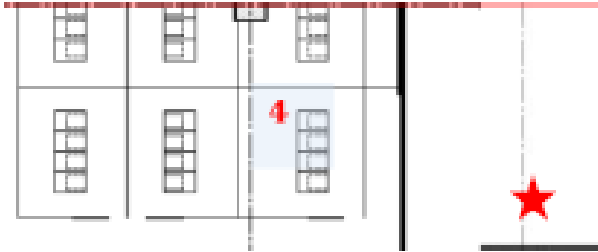



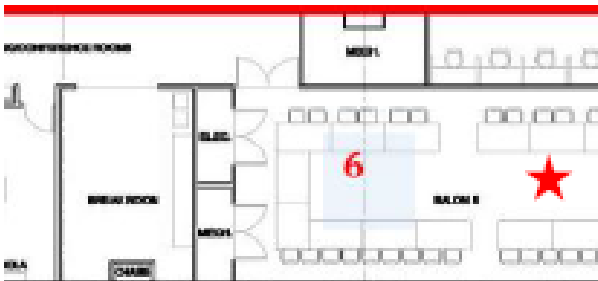
Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W- 2-022713-R1	<990 (non detected)			A/C return (Lobby to east)
PBA-W- 2-022713-R2	<990 (non detected)			A/C return (Lobby to west)
PBA-W- 2-022713-R3	<990 (non detected)			A/C Return (Area under construction to the northwest used as storage)






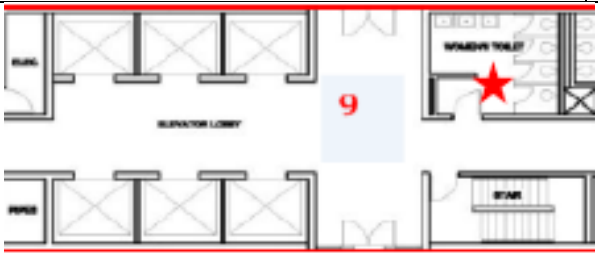
PBA-W- 2-022713-R4	<990 (non detected)			A/C return (Offices to southeast)
PBA-W- 2-022713-S1	<990 (non detected)			A/C supply (Breakroom to southeast)

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- 2-022713-1	0.0011			Random Area #1 (Open office to northeast)
PBA-A- 2-022713-2	0.0014			Random Area #2 (Training room #1 to south)
PBA-A- 2-022713-3	<0.00074			Random Area #3 (Data center to west)


PBA-A- 2-022713-4	0.0023 by NIOSH 7400  <0.00018 by NIOSH 7402			Random Area #4 (Storage area under construction to southwest)
PBA-A- 2-022713-5	<0.0007			Random Area #5 (Storage to east)
PBA-A- 2-022713-6	<0.0007			Random Area #6 (Training room # 5 to southeast)

PBA-A- 2-022713-7	0.0011			Random Area #7 (Open office to north)
PBA-A- 2-022713-8	<0.00072			Random Area #8 (Data center to northwest)
PBA-A- 2-022713-9	0.0046 by NIOSH 7400  <0.001 by NIOSH 7402  (2 asbestos - tremolite fibers)			Random Area #9 (Women restroom to center)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc





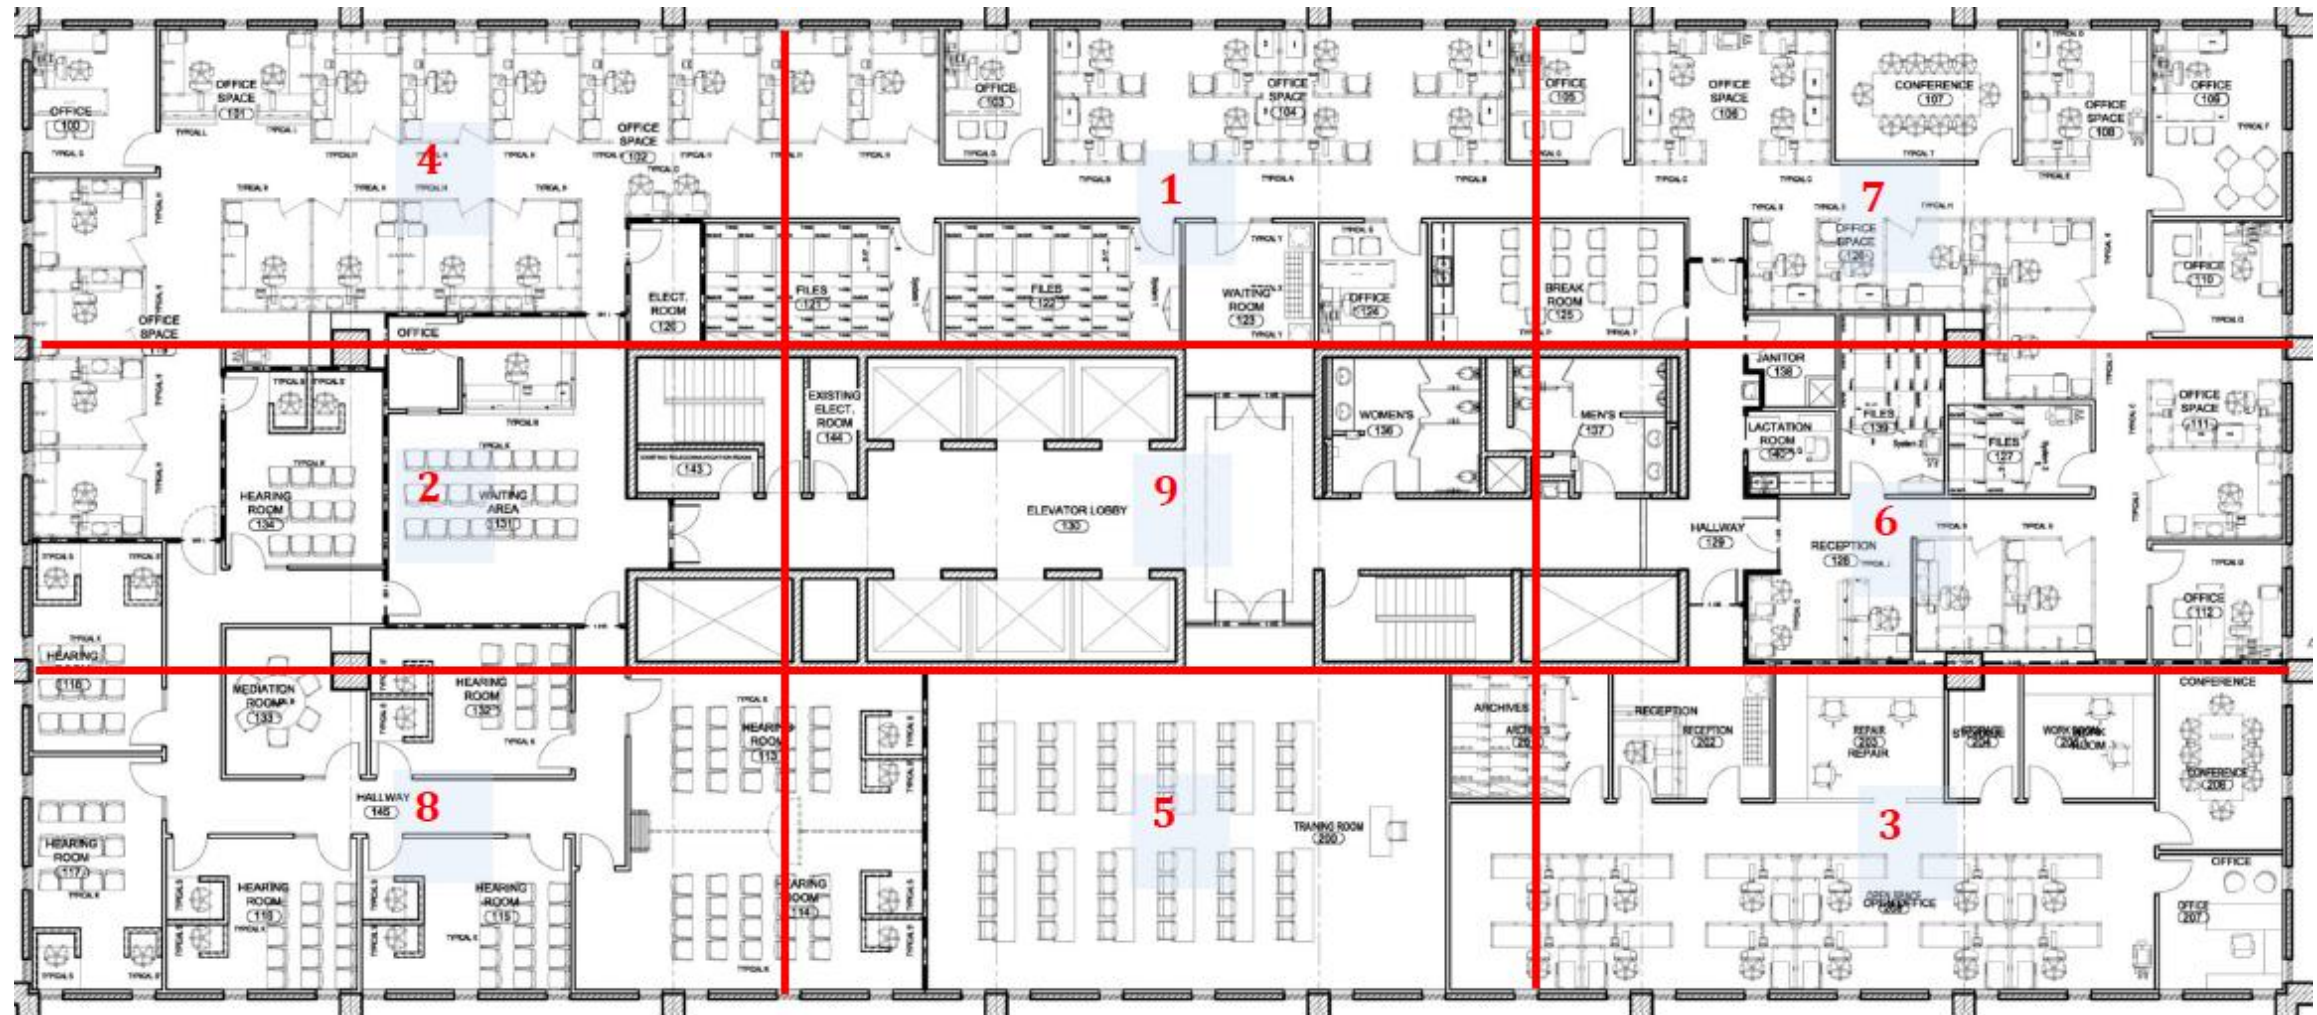





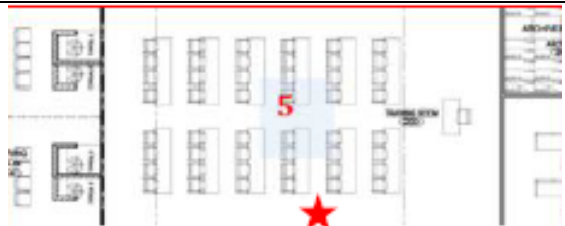

## Area: Level 3



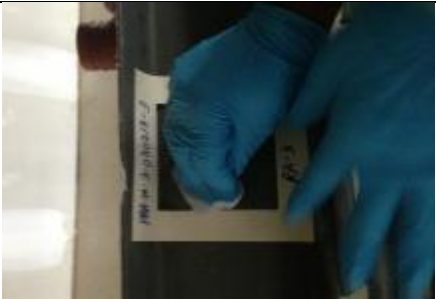

**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-3-030213-1	<990 (non detected)			Random Area #1 (Closed space to north) Plastic covered cardboard boxes
PBA-W-3-030213-2	<990 (non detected)			Random Area #2 (Closed space to east) Window frame
PBA-W-3-030213-3	990 (1 Chrysotile)			Random Area #3 (Open area to southeast) Material in stock

PBA-W-3-030213-4	<990 (non detected)			Random Area #4 (Open area to northwest) Floor
PBA-W-3-030213-5	<990 (non detected)			Random Area #5 (Open area to south) Window frame
PBA-W-3-030213-6	<990 (non detected)			Random Area #6 (Open area to east) Floor







PBA-W-3-030213-7	990 (1 Chrysotile)			Random Area #7 (Closed space to southwest) Floor
PBA-W-3-030213-8	2,000 (2 Chrysotile)			Random Area #8 (Closed space to northeast) Floor
PBA-W-3-030213-9	4,900 (5 Chrysotile)			Random Area #9 (Women restroom to center) Floor





\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

### **Porous Surfaces Microvac Wipe Dust Samples Data**

**There were no porous surfaces in the Level 3<sup>rd</sup> since the area was totally empty. Therefore, no samples were taken.**

Air Conditioning (A/C) Returns and Supply Wipe Dust Samples







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W3-030213-R1	<990 (non detected)			A/C return (Lobby to west)
PBA-W- 3-030213-R2	<990 (non detected)			A/C return (Office to southwest)
PBA-W- 3-030213-R3	<990 (non detected)			A/C Return (Lobby to east)

PBA-W- 3-030213-R4	<990 (non detected)			A/C return (Offices to southeast)
PBA-W- 3-030213-S1	<990 (non detected)			A/C supply (Open area to east)




\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$



Air Samples Data\*


Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- 3-030213-1	0.0084 by NIOSH 7400  <0.00076 by NIOSH 7402  (No asbestos fibers)			Random Area #1  (Open area to north)
PBA-A- 3-030213-2	0.0012			Random Area #2  (Open area to west)
PBA-A- 3-030213-3	0.0033 by NIOSH 7400  <0.0033 by NIOSH 7402  (no asbestos fibers)			Random Area #3  (Open area to southeast)

PBA-A- 3-030213-4	<p>0.0039 by NIOSH 7400</p> <p>&lt;0.002 by NIOSH 7402</p> <p>(no asbestos fibers)</p>			<p>Random Area #4</p> <p>(Open area to northwest)</p>
PBA-A- 3-030213-5	<p>0.0016</p>			<p>Random Area #5</p> <p>(Open area to south)</p>
PBA-A- 3-030213-6	<p>0.0056 by NIOSH 7400</p> <p>&lt;0.00096 by NIOSH 7402</p> <p>(no asbestos fibers)</p>			<p>Random Area #6</p> <p>(Open area to east)</p>

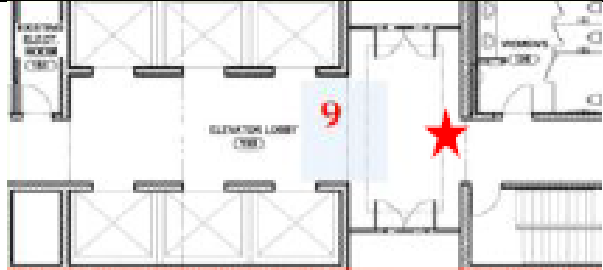PBA-A- 3-030213-7	0.0035 by NIOSH 7400 <0.0018 by NIOSH 7402 (no asbestos fibers)			Random Area #7 (Closed space to northeast)
PBA-A- 3-030213-8	<0.00072			Random Area #8 (Hallway to southwest)
PBA-A-3-030213-9	0.0012 by NIOSH 7400 <0.003 by NIOSH 7402 (no asbestos fibers)			Random Area #9 (Lobby to center)





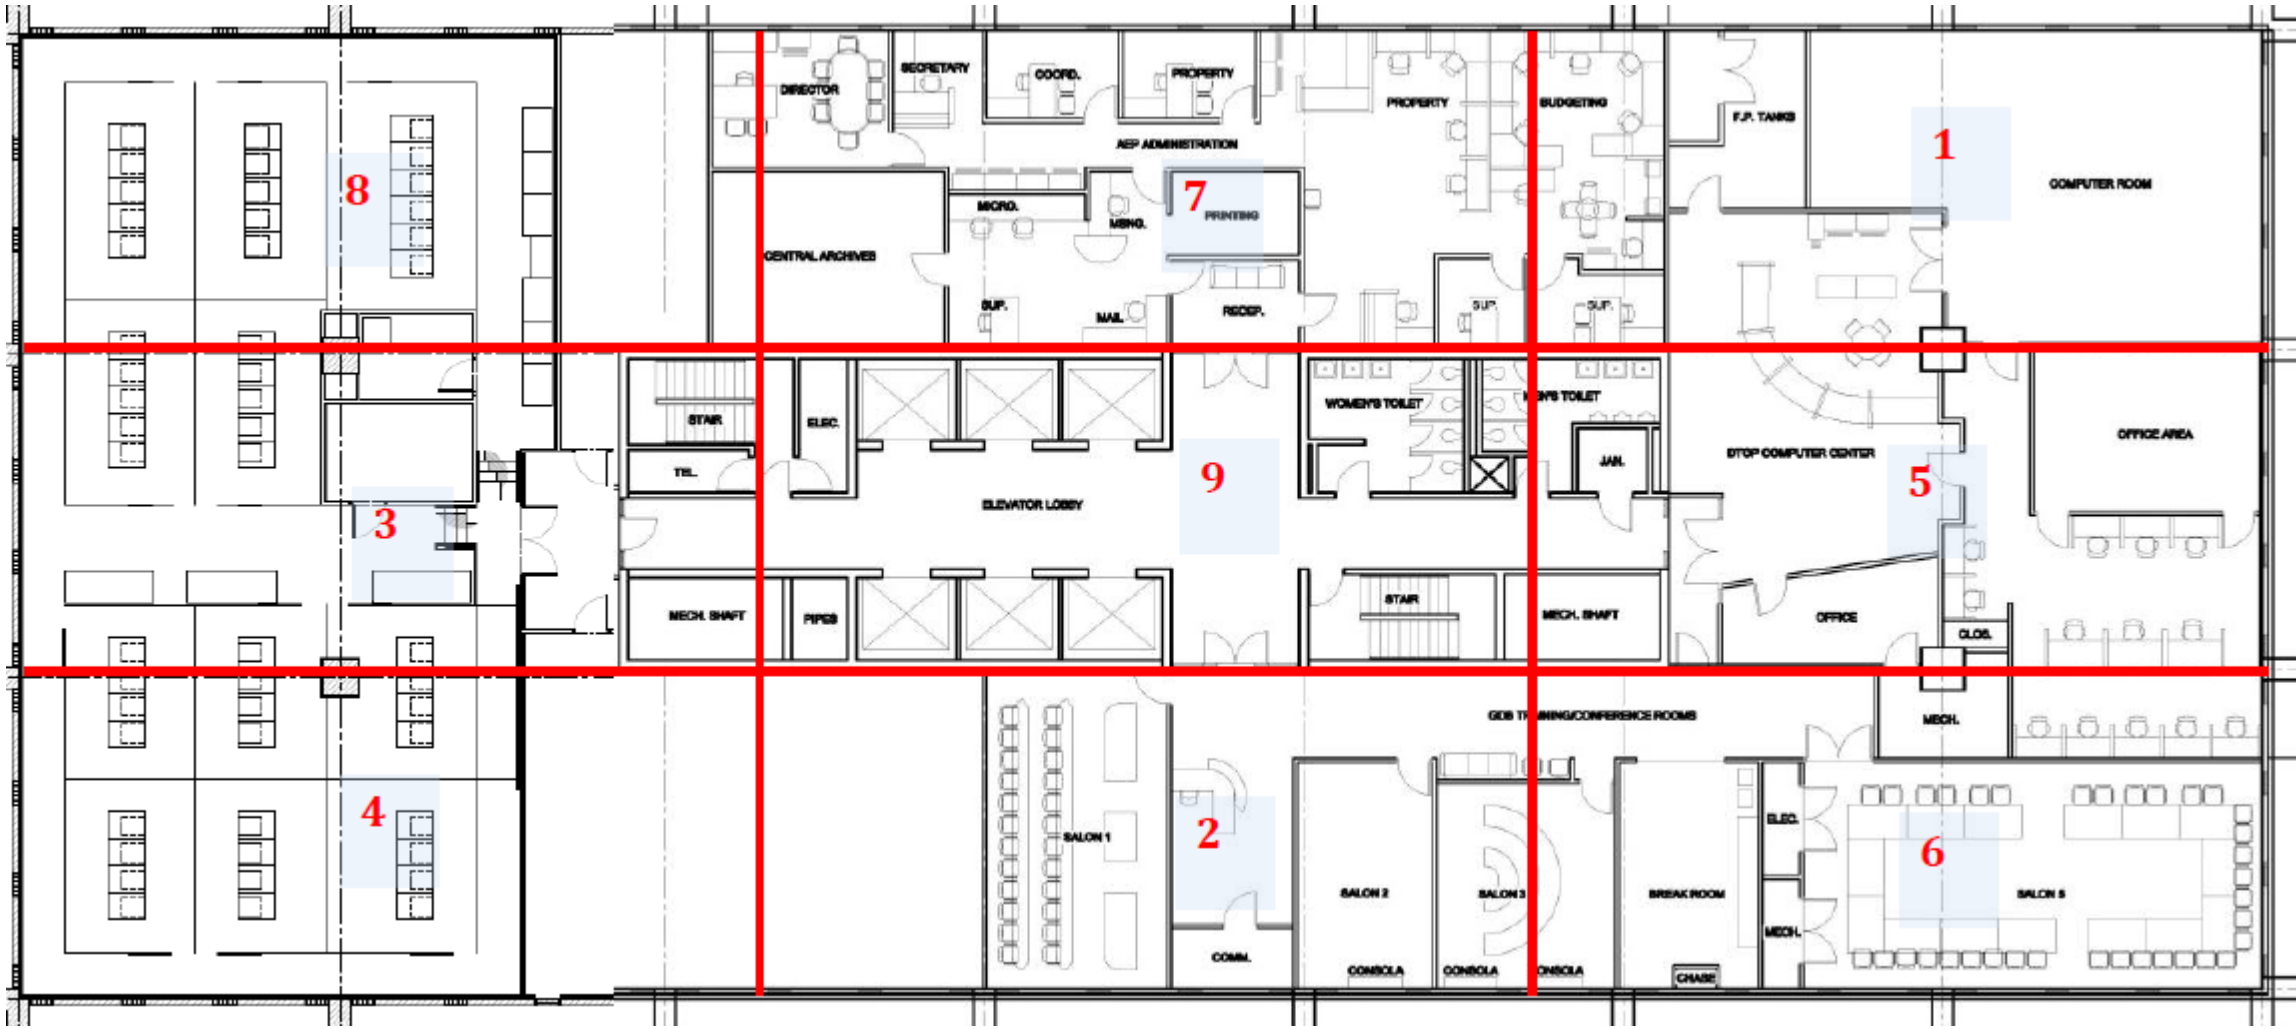

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc



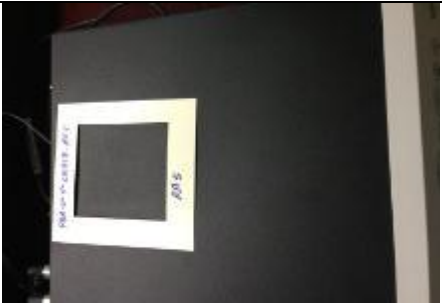

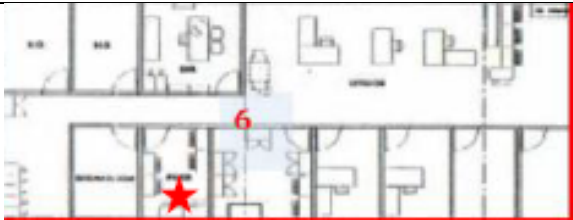
Area: Level 4





**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-4-031313-1	<990 (non detected)			Random Area #1 (Private office to north) Cabinet
PBA-W-4-031313-2	<990 (non detected)			Random Area #2 (Private office to southwest) Printer Machine
PBA-W-4-031313-3	<990 (non detected)			Random Area #3 (Private office to east) Keyboard Base


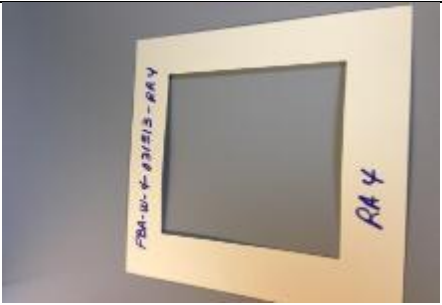

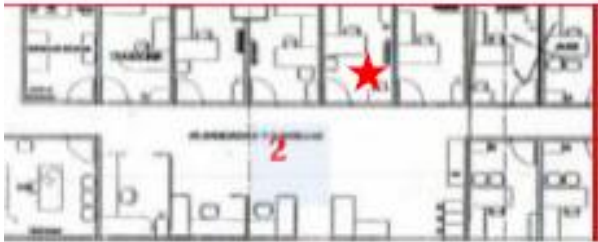


PBA-W-4-031313-4	990 (1 Chrysotile)			Random Area #4 (Files room southeast) Cabinet
PBA-W-4-031313-5	<990 (non detected)			Random Area #5 (Salon C to west) Console
PBA-W-4-031313-6	<990 (non detected)			Random Area #6 (Files room northwest) Cabinet







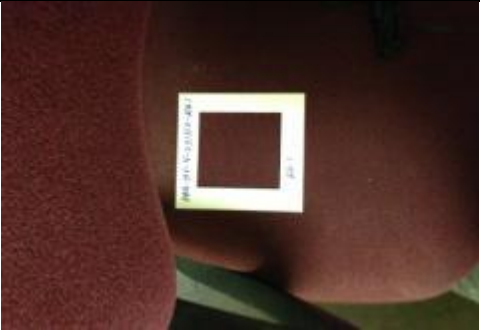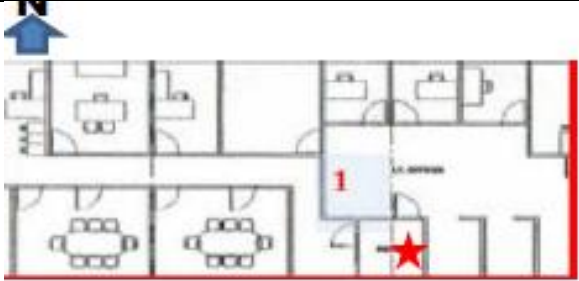


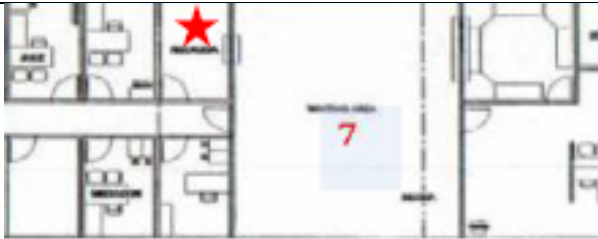

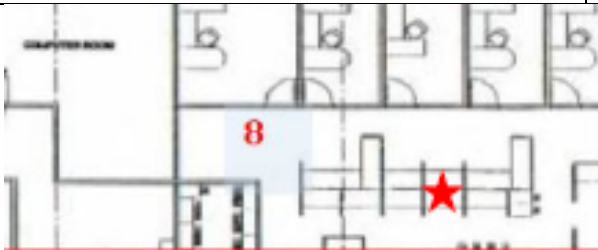


PBA-W-4-031313-7	<990 (non detected)			Random Area #7 (Private office to south) Floor
PBA-W-4-031313-8	<990 (non detected)			Random Area #8 (Computer room to northeast) CPU Tower
PBA-W-4-031313-9	<990 (non detected)			Random Area #9 (Women's restroom to center) Floor

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

**Porous Surfaces Microvac Wipe Dust Samples Data\***





Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-4-031313-1	<990 (non detected)			Random Area #1 (Reception to north) Chair
PBA-MV- 4-031313-2	<990 (non detected)			Random Area #2 (Private office to southwest) Chair
PBA-MV- 4-031313-3	<990 (non detected)			Random Area #3 (Open cubicles to east) Partition

PBA-MV- 4-031313-4	<990 (non detected)			Random Area #4 (Open cubicles to southeast) Partition
PBA-MV- 4-031313-5	990 (1 Chrysotile)			Random Area #5 (Salon A to west) Carpet
PBA-MV- 4-031313-6	<990 (non detected)			Random Area #6 (Break room to northwest) Carpet

PBA-MV- 4-031313-7	990 (1 Chrysotile)			Random Area #7 (Private office to south) Chair
PBA-MV- 4-031313-8	<990 (non detected)			Random Area #8 (Open cubicles to northeast) Partition
PBA-MV- 4-031313-9	<990 (non detected)			Random Area #9 (Open cubicles at RA #2 to southwest) Chair No porous surfaces were identified in RA #9

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Conditioning (A/C) Returns and Supply Wipe Dust Samples

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W- 4-031313-R1	<990 (non detected)			A/C return (Lobby to west)
PBA-W- 4-031313-R2	<990 (non detected)			A/C return (Lobby to east)









PBA-W- 4-031313-R3	<990 (non detected)			A/C Return (Storage to south)
PBA-W- 4-031313-R4	<990 (non detected)			A/C return (Offices to southwest)


\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$



Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- 4-031313-1	0.0032 by NOISH 7400  <0.001 by NOISH 7402  (no asbestos fibers)			Random Area #1 (Private office to north)
PBA-A- 4-031313-2	0.0013			Random Area #2 (Break room to southwest)
PBA-A- 4-031313-3	0.00074			Random Area #3 (Files room to east)

PBA-A- 4-031313-4	<0.0007			Random Area #4 (Private office to southeast)
PBA-A- 4-031313-5	0.0012			Random Area #5 (Salon A to west)
PBA-A- 4-031313-6	0.0014			Random Area #6 (Private office to northwest)

PBA-A- 4-031313-7	<0.00062			Random Area #7 (Private office to south)
PBA-A- 4-031313-8	<0.00067			Random Area #8 (Private office to northeast)
PBA-A- 4-031313-9	0.0034 by NIOSH 7400  0.002 by NIOSH 7402  (6 asbestos - amosite fibers)			Random Area #9 (Lobby to center)







\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc







Area: Level 5





Non-porous Surfaces Wipe Dust Samples Data \*

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-5-031513-1	990 (1 Chrysotile)			Random Area #1 (Private office to west) Desk
PBA-W-5-031513-2	<990 (non detected)			Random Area #2 (Open office to south) Floor
PBA-W-5-031513-3	4,990 (5 Chrysotile)			Random Area #3 (Open office to south) Floor







PBA-W-5-031513-4	990 (1 Chrysotile)			Random Area #4 (Library to north) Cabinet
PBA-W-5-031513-5	<990 (non detected)			Random Area #5 (Women restroom to center) Mirror frame
PBA-W-5-031513-6	<990 (non detected)			Random Area #6 (Files room to northwest) Cabinet









PBA-W-5-031513-7	<990 (non detected)			Random Area #7 (Private office to southeast) Vinyl Sofa
PBA-W-5-031513-8	<990 (non detected)			Random Area #8 (Private office to east) Credenza
PBA-W-5-031513-9	<990 (non detected)			Random Area #9 (Files room to southwest) Floor

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

**Porous Surfaces Microvac Wipe Dust Samples Data\***







Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-5-031513-1	<990 (non detected)			Random Area #1 (Private office to west) Chair
PBA-MV- 5-031513-2	2,000 (2 Chrysotile)			Random Area #2 (Open area to south) Chair
PBA-MV- 5-031513-3	<990 (non detected)			Random Area #3 (Cubicle office to northeast) Chair

PBA-MV- 5-031513-4	<990 (non detected)			Random Area #4 (Cubicle office to north) Partition
PBA-MV- 5-031513-5	<990 (non detected)			Random Area #5 (Open office at RA #7 to southeast) Cardboard box No porous surfaces were identified in RA #5
PBA-MV- 5-031513-6	<990 (non detected)			Random Area #6 (Private office to northwest) Chair



PBA-MV- 5-031513-7	<990 (non detected)			Random Area #7 (Break room to southeast) Chair
PBA-MV- 5-031513-8	<990 (non detected)			Random Area #8 (Cubicle office to east) Chair
PBA-MV- 5-031513-9	<990 (non detected)			Random Area #9 (Cubicle office to southwest) Chair

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>

Air Conditioning (A/C) Returns and Supply Wipe Dust Samples




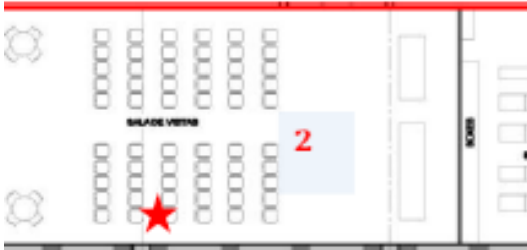


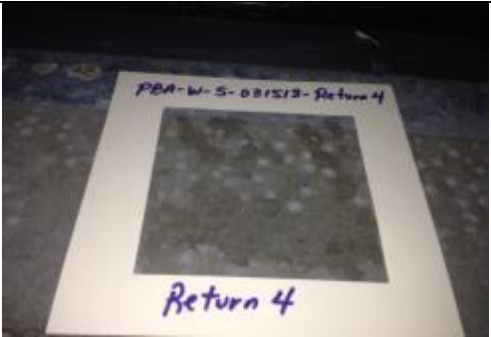Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W- 5-031513-R1	<990 (non detected)			A/C return (Lobby to west)
PBA-W- 5-031513-R2	<990 (non detected)			A/C return (Lobby to east)
PBA-W- 5-031513-R3	<990 (non detected)			A/C Return (Offices to southeast)








PBA-W- 5-031513-R4	<990 (non detected)			A/C return (Offices to south)
--------------------	------------------------	--	---	----------------------------------

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- 5-031513-1	0.0063 by NOISH 7400  <0.0009 by NOISH 7402  (no asbestos fibers)			Random Area #1 (Private office to west)
PBA-A- 5-031513-2	0.0016			Random Area #2 (Hearing room to south)
PBA-A- 5-031513-3	0.0026 by NOISH 7400  <0.001 by NOISH 7402  (1 amosite asbestos fiber)			Random Area #3 (Private office to northeast)

PBA-A- 5-031513-4	<p>0.0042 by NOISH 7400</p> <p>&lt;0.001 by NOISH 7402</p> <p>(3 amosite asbestos fiber)</p>			<p>Random Area #4</p> <p>(Server room to southeast)</p>
PBA-A- 5-031513-5	<p>0.0034 by NOISH 7400</p> <p>&lt;0.00057 by NOISH 7402</p> <p>(no asbestos fiber)</p>			<p>Random Area #5</p> <p>(Lobby to center)</p>
PBA-A- 5-031513-6	<p>0.0014</p>			<p>Random Area #6</p> <p>(Secretary office to northeast)</p>

PBA-A- 5-031513-7	<0.00071			Random Area #7 (Private office to southeast)
PBA-A- 5-031513-8	<0.0007			Random Area #8 (Open offices to southeast)
PBA-A- 5-031513-9	0.0047 by NIOSH 7400  0.001 by NIOSH 7402  (2 armosite asbestos fibers)			Random Area #9 (Copy room to southwest)






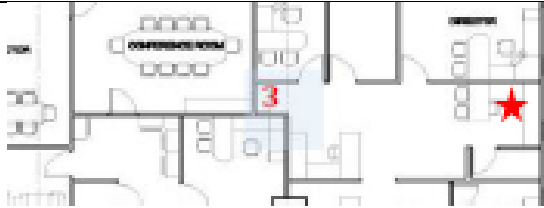
\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc


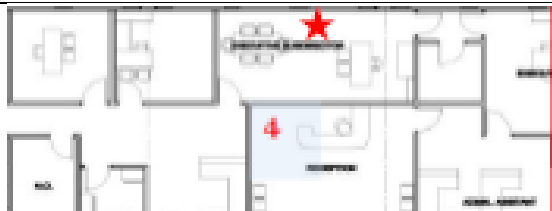

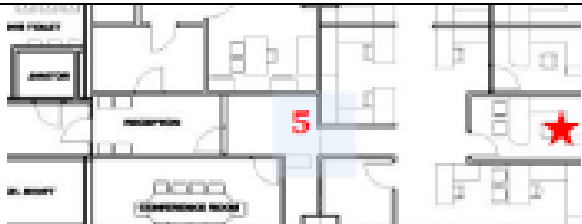



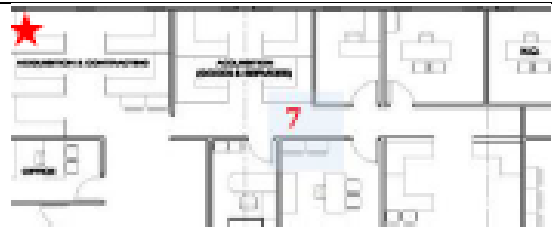
**Area: Level 6**


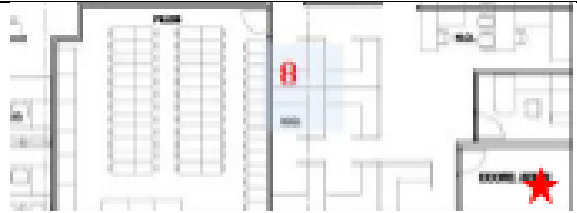






**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-6-032313-1	<990 (non detected)			Random Area #1 (Water fountain to center) Top
PBA-W-6-032313-2	<990 (non detected)			Random Area #2 (Open space to southwest) Floor
PBA-W-6-032313-3	<990 (non detected)			Random Area #3 (Hallway to northeast) Floor

PBA-W-6-032313-4	<990 (non detected)			Random Area #4 (Private office to north) Window glass
PBA-W-6-032313-5	<990 (non detected)			Random Area #5 (Storage to east) Cabinet
PBA-W-6-032313-6	<990 (non detected)			Random Area #6 (Open space to west) Floor
PBA-W-6-032313-7	<990 (non detected)			Random Area #7 (Open space to northwest) Desk






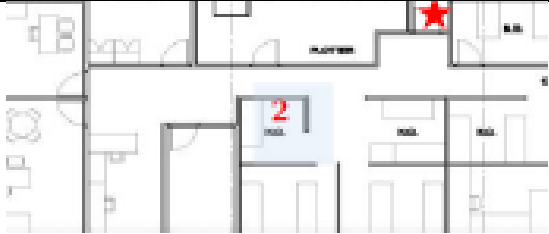
PBA-W-6-032313-8	<990 (non detected)			Random Area #8 (Private office to southeast) Desk
PBA-W-6-032313-9	<990 (non detected)			Random Area #9 (Files room to south) Cabinet

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$


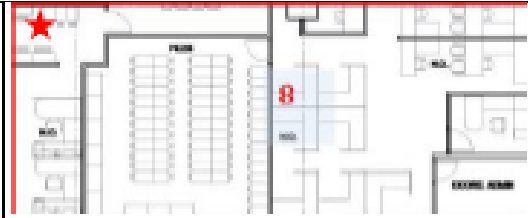
### **Porous Surfaces Microvac Wipe Dust Samples Data**

**There were no porous surfaces in the Level 6<sup>th</sup> since the area was totally empty. Therefore, no samples were taken.**

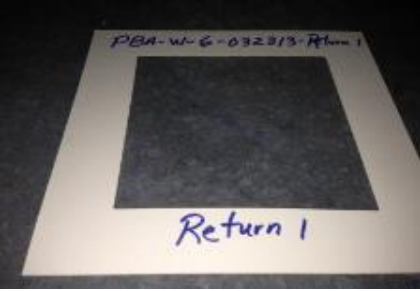**Air Conditioning (A/C) Returns and Supply Wipe Dust Samples**

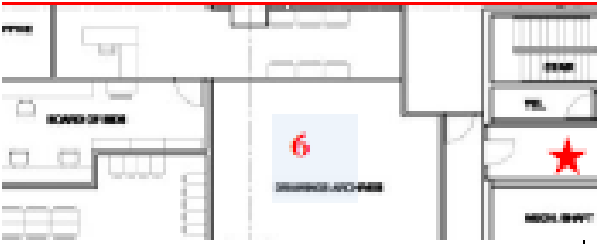


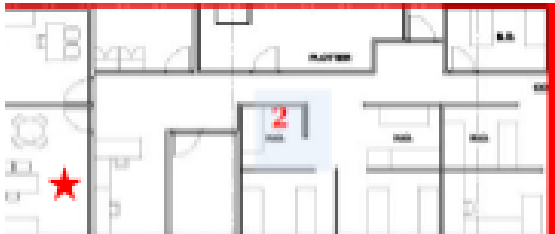

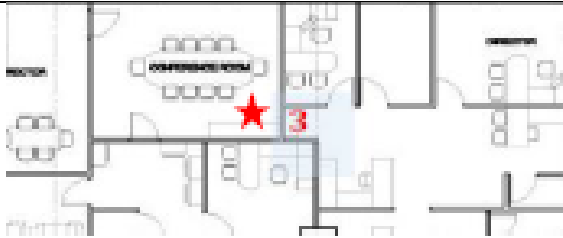
Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W- 6-032313-R1	<990 (non detected)			A/C return (Lobby to east)
PBA-W- 6-032313-R2	<990 (non detected)			A/C return (Lobby to west)
PBA-W- 6-032313-R3	<990 (non detected)			A/C Return (Offices to southwest)



PBA-W- 6-032313-R4	<990 (non detected)			A/C return (Files room to southeast)
--------------------	------------------------	--	---	---

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*


Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- 6-032313-1	0.0011			Random Area #1 (Women restroom to center)
PBA-A- 6-032313-2	<0.00072			Random Area #2 (Private office to southwest)
PBA-A- 6-032313-3	<0.00074			Random Area #3 (Private office to northeast)

PBA-A- 6-032313-4	<0.00074			Random Area #4 (Reception to north)
PBA-A- 6-032313-5	0.0012			Random Area #5 (Hallway to east)
PBA-A- 6-032313-6	<0.00073			Random Area #6 (Hallway to west)





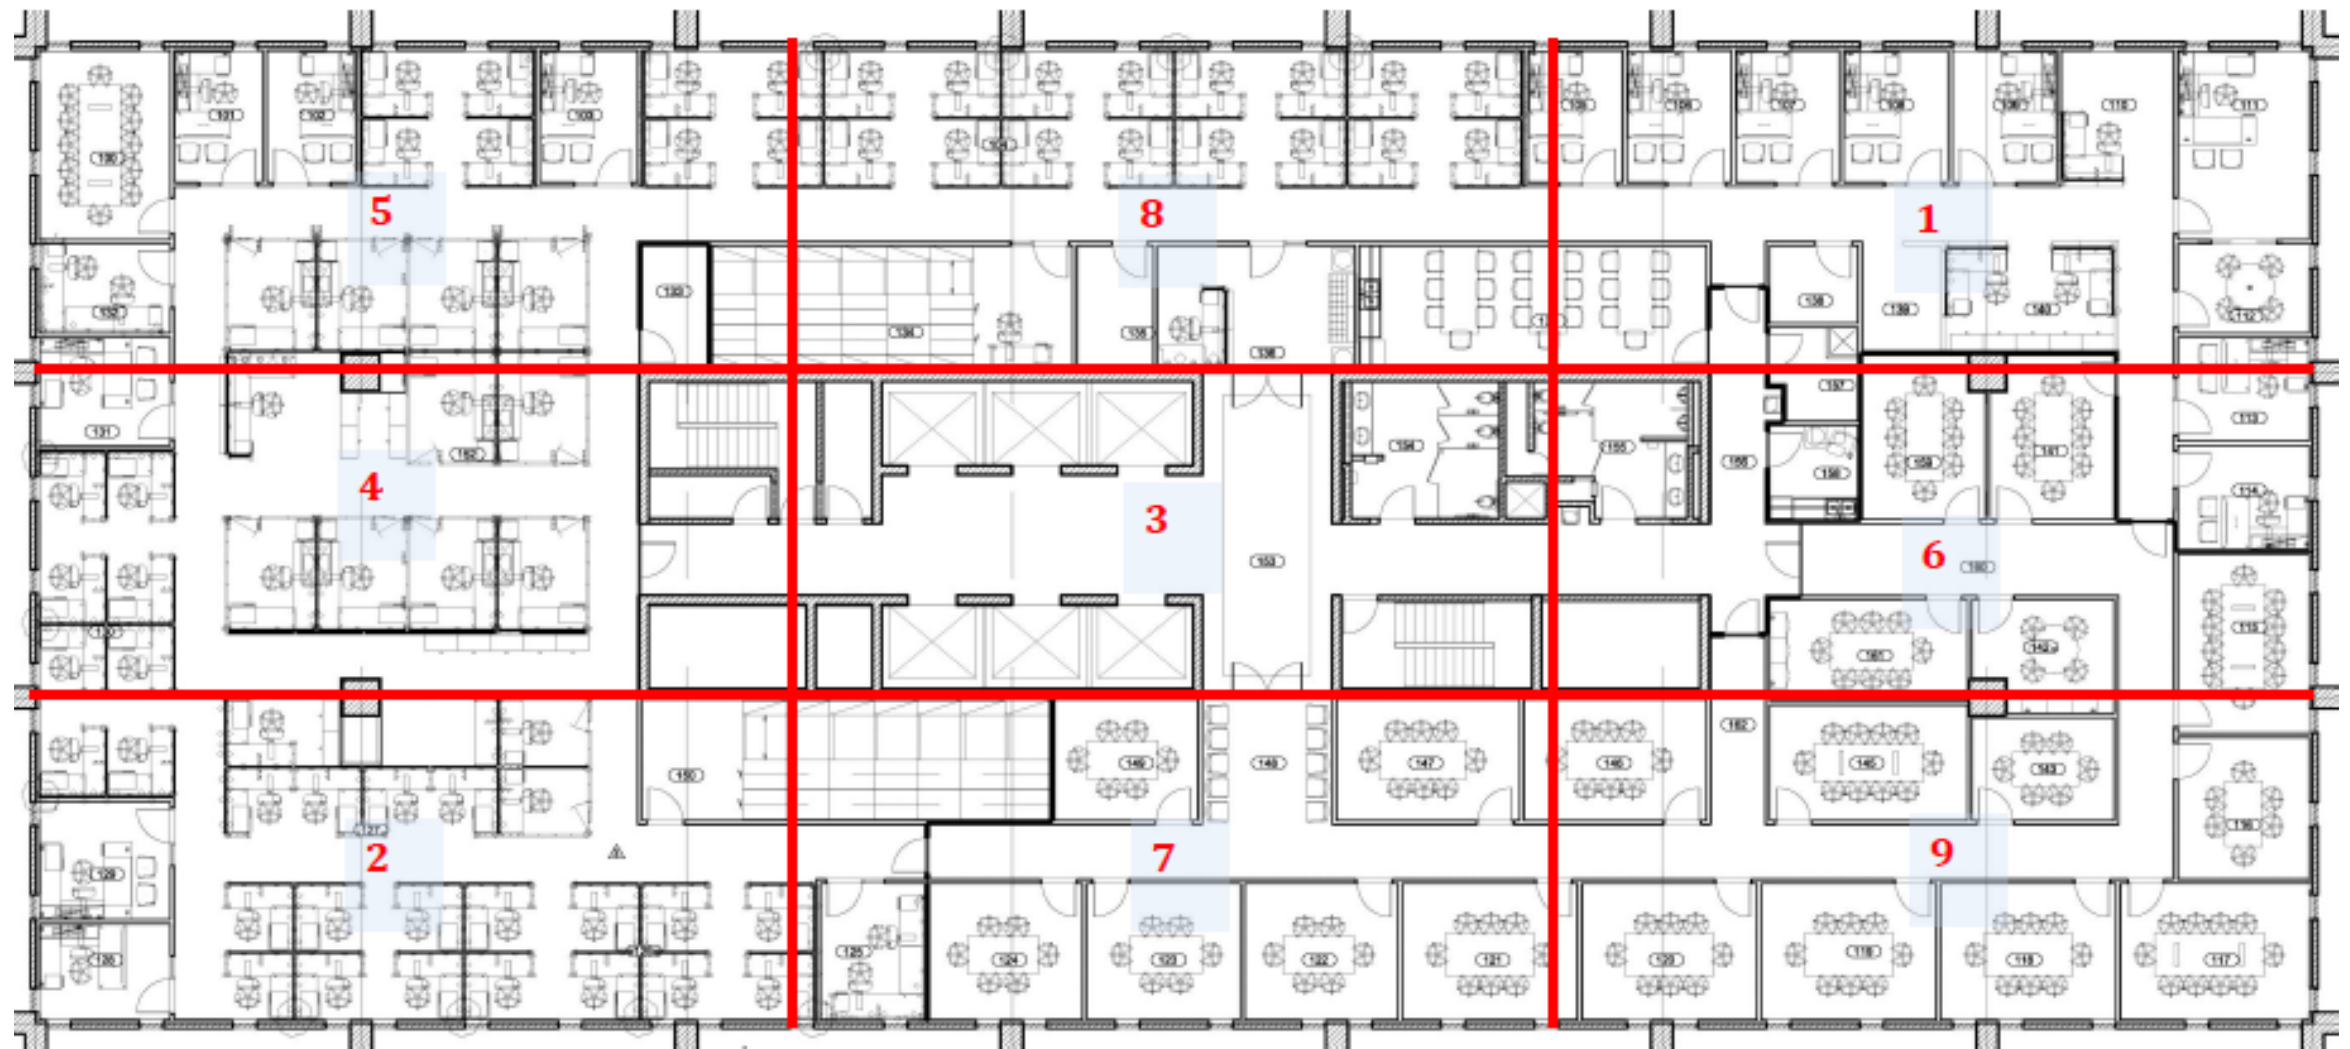

PBA-A- 6-032313-7	<0.00074			Random Area #7 (Private office to northwest)
PBA-A- 6-032313-8	<0.00075			Random Area #8 (Files room to southeast)
PBA-A- 6-032313-9	<0.0007			Random Area #9 (Former conference room to south)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc







Area: Level 7









**Non-porous Surfaces Wipe Dust Samples Data \***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W-7-032513-1	2,000 (2 Chrysotile)			Random Area #1 (Private office to northeast) Desk
PBA-W-7-032513-2	<990 (non detected)			Random Area #2 (Cubicle office to southwest) Table
PBA-W-7-032513-3	990 (1 Chrysotile)			Random Area #3 (Hallway to center) Floor

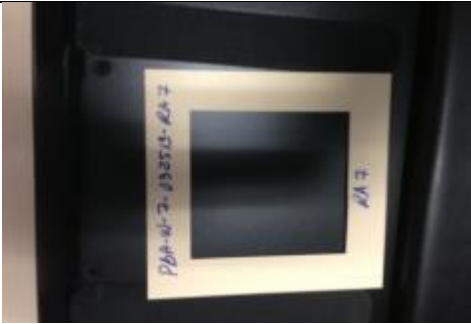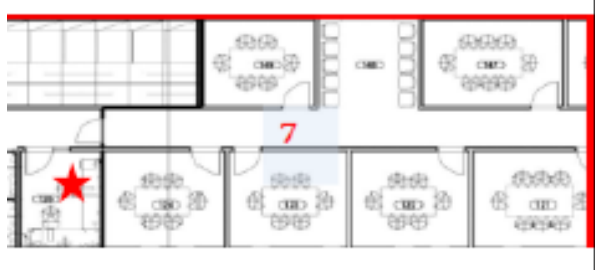

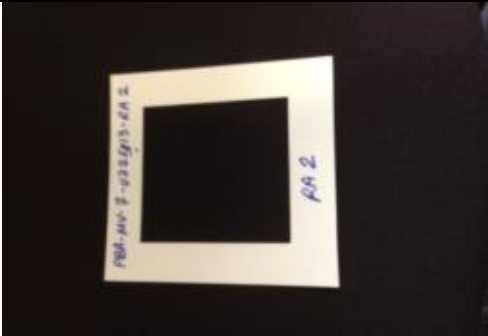

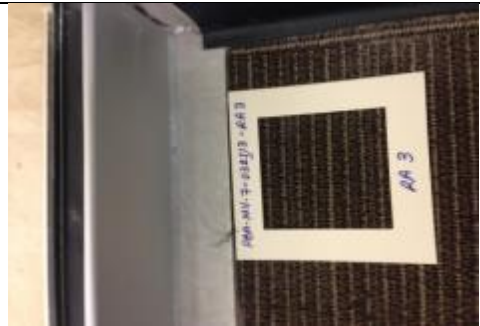
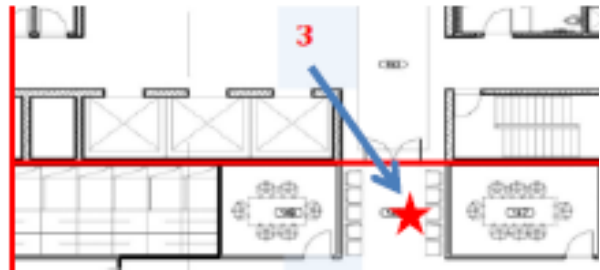








PBA-W-7-032513-4	<990 (non detected)			Random Area #4 (Fire extinguisher box to northwest) Metal top
PBA-W-7-032513-5	<990 (non detected)			Random Area #5 (Private office to northwest) Mirror frame
PBA-W-7-032513-6	<990 (non detected)			Random Area #6 (Private office to east) Elevated cabinet

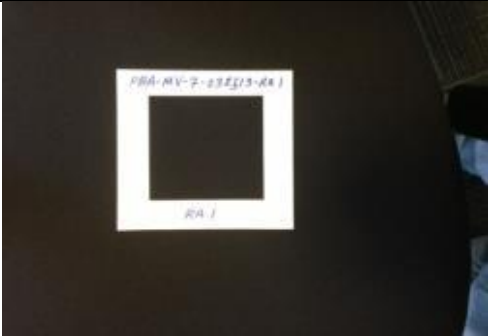





PBA-W-7-032513-7	<990 (non detected)			Random Area #7 (Private office to south) Keyboard base
PBA-W-7-032513-8	<990 (non detected)			Random Area #8 (Reception area to north) Small table
PBA-W-7-032513-9	<990 (non detected)			Random Area #9 (Conference room to southeast) Table

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

**Porous Surfaces Microvac Wipe Dust Samples Data\***

Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-MV-7-032513-1	<990 (non detected)			Random Area #1 (Conference room to northeast) Chair
PBA-MV- 7-032513-2	990 (1 Chrysotile)			Random Area #2 (Private office to southwest) Chair
PBA-MV- 7-032513-3	<990 (non detected)			Random Area #3 (Waiting area at RA #7 to south) Carpet No porous surfaces were identified in RA #3


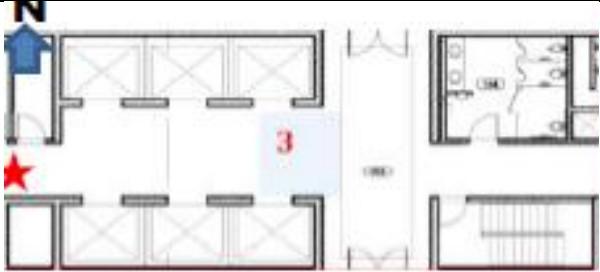




PBA-MV- 7-032513-4	990 (1 Chrysotile)			Random Area #4 (Open area to west) Carpet
PBA-MV- 7-032513-5	<990 (non detected)			Random Area #5 (Private office to northwest) Chair
PBA-MV- 7-032513-6	<990 (non detected)			Random Area #6 (Hallway to east) Carpet

PBA-MV- 7-032513-7	<990 (non detected)			Random Area #7 (Hallway to south) Carpet
PBA-MV- 7-032513-8	<990 (non detected)			Random Area #8 (Hallway to north) Carpet
PBA-MV- 7-032513-9	<990 (non detected)			Random Area #9 (Conference room to southeast) Carpet

\*All wipe dust samples results were below the benchmark of  $\leq 5,000$  s/cm<sup>2</sup>



Air Conditioning (A/C) Returns and Supply Wipe Dust Samples






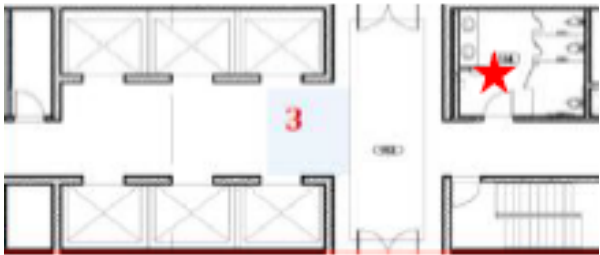
Sample Number	Results (s/cm <sup>2</sup> )	Picture	Sample Location	Component
PBA-W- 7-032513-R1	<990 (non detected)			A/C return (Lobby to west)
PBA-W- 7-032513-R2	990 (1 Chrysotile)			A/C return (Lobby to east)
PBA-W- 7-032513-R3	<990 (non detected)			A/C Return (Conference room to southeast)















PBA-W- 7-032513-R4	<990 (non detected)			A/C return (Storage to southwest)
PBA-W- 7-032513-S1	<990 (non detected)			A/C Supply (Open area to west)

\*All wipe dust samples results were below the benchmark of  $\leq 5,000 \text{ s/cm}^2$

Air Samples Data\*

Sample Number	Results (f/cc)	Picture	Sample Location	Component
PBA-A- 5-7-032513-1	0.00074			Random Area #1 (Private office to northeast)
PBA-A- 7-032513-2	<0.0007			Random Area #2 (Private office to southwest)
PBA-A- 7-032513-3	<0.00067			Random Area #3 (Women restroom to center)


PBA-A- 7-032513-4	<0.00071			Random Area #4 (Private office to northwest)
PBA-A- 7-032513-5	<0.00072			Random Area #5 (Cubicle office to northwest)
PBA-A- 7-032513-6	<0.00069			Random Area #6 (Small conference to east)

PBA-A- 7-032513-7	<0.00066			Random Area #7 (Conference room to south)
PBA-A- 7-032513-8	<0.00073			Random Area #8 (Files room to north)
PBA-A- 7-032513-9	<0.00069			Random Area #9 (Hallway to southeast)

\*All air samples results were below the benchmark of  $\leq 0.002$  f/cc







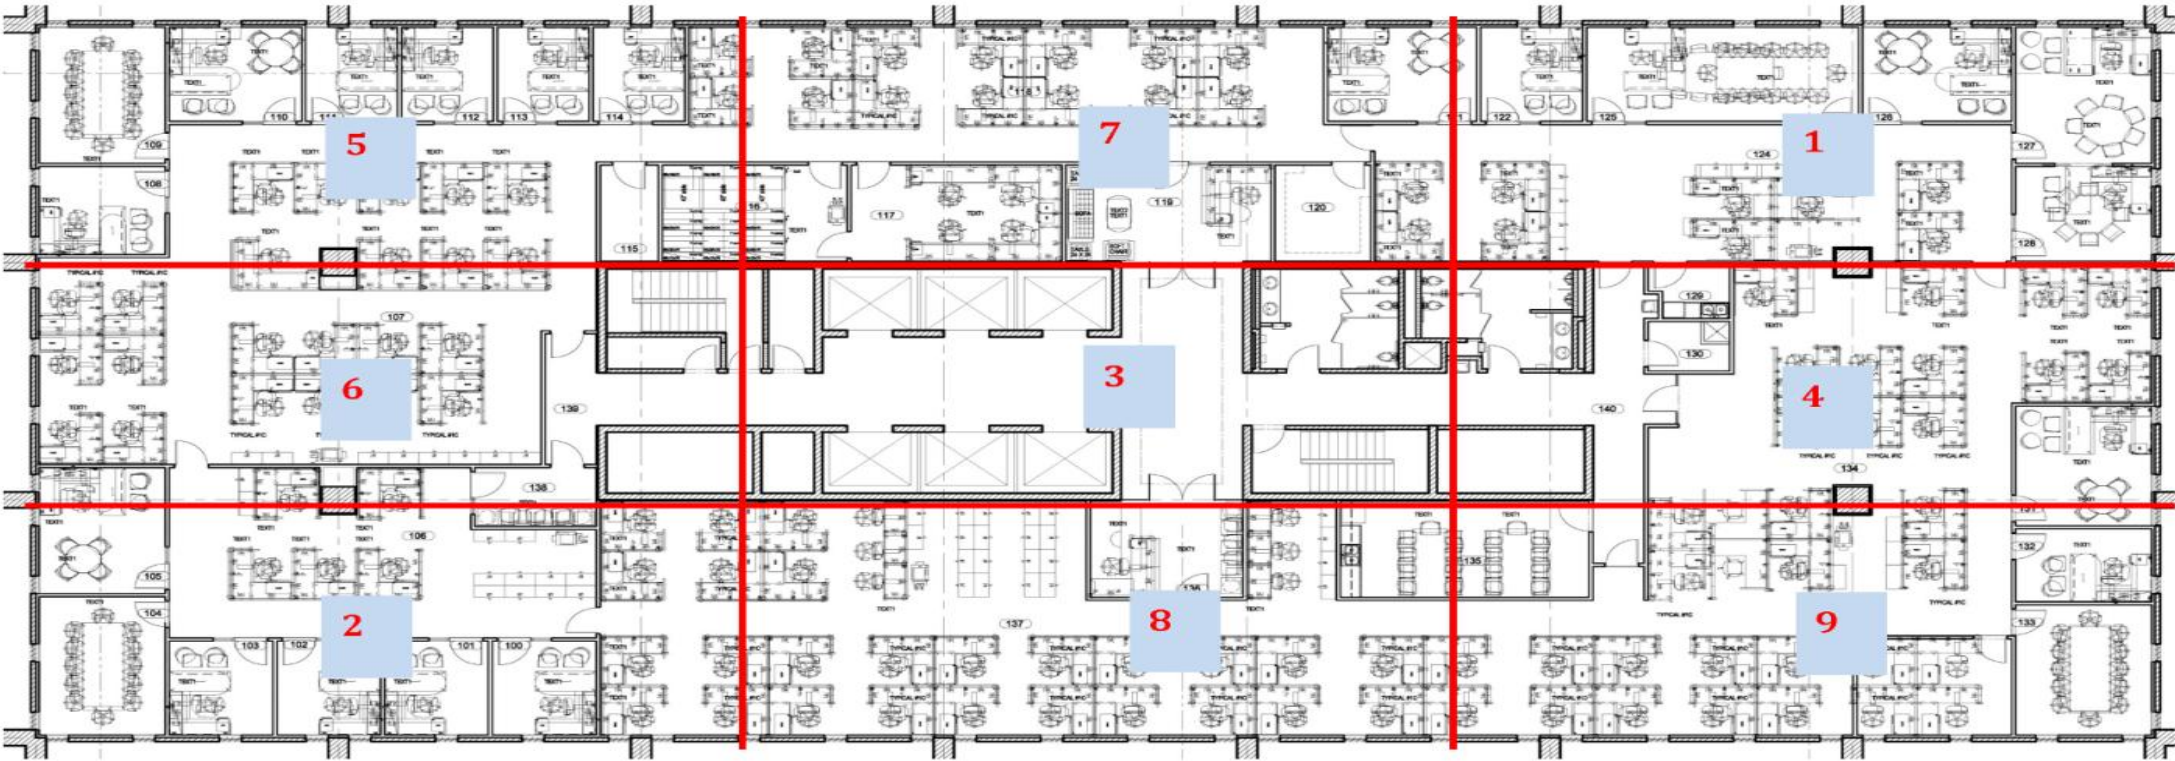

Area: Level 8







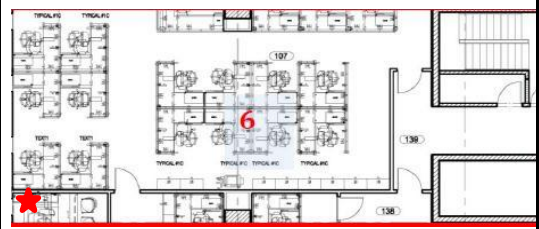
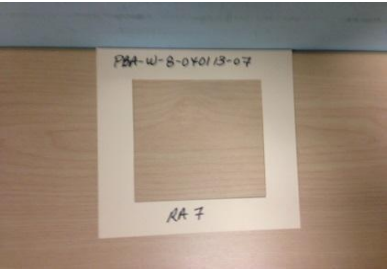

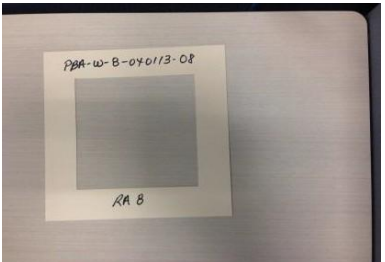
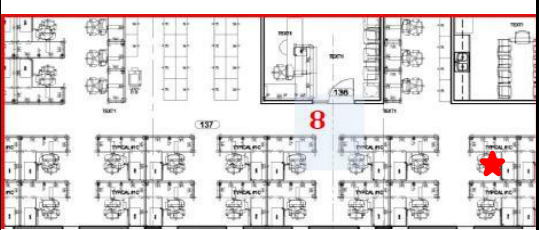
LEVEL 8



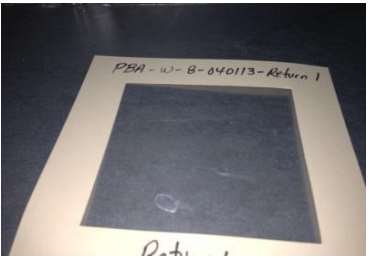
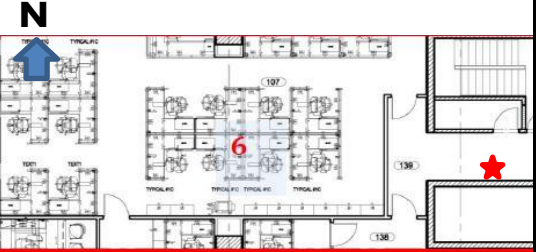


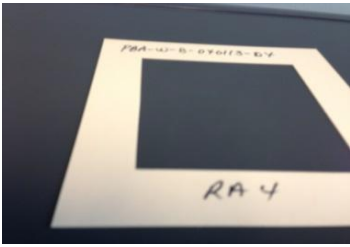

Non-porous Surfaces Wipe Dust Samples Data \*


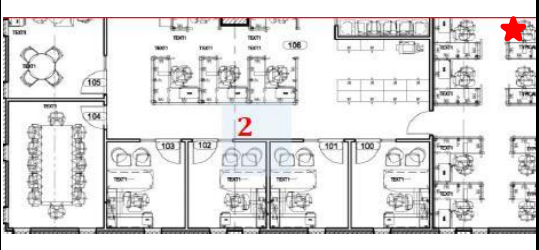
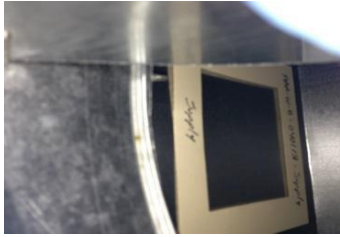

Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Location/Component
PBA-W-08-040113-1	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 1 (Private office to NE) elevated cabinet
PBA-W-08-040113-2	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 2 (Conference to SW) shelf
PBA-W-08-040113-3	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 3 (Hallway to center) floor

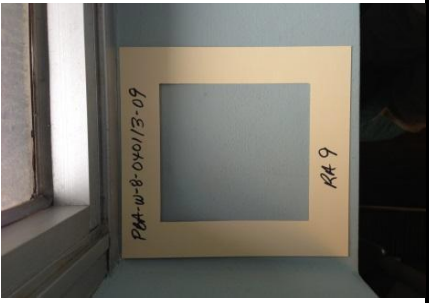




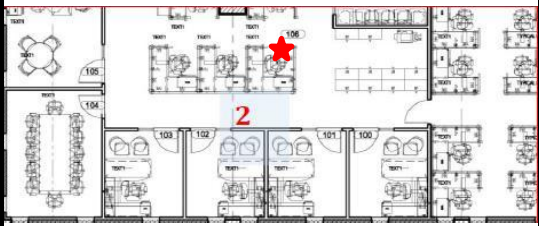
PBA-W-08-040113-4	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 4 (Private office to E) elevated cabinet
-------------------	----------	-------------------------------	---	--	--

PBA-W-08-040113-5	5-Apr-13	3,000 S/CM2 (3 CHRYSTOLE STRUCTURES)			Random Area # 5 (Conference to NW) small table
PBA-W-08-040113-6	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 6 (Private office to W) elevated cabinet
PBA-W-08-040113-7	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 7 (Private multi-office to N) table
PBA-W-08-040113-8	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 8 (Cubicles to S) desk







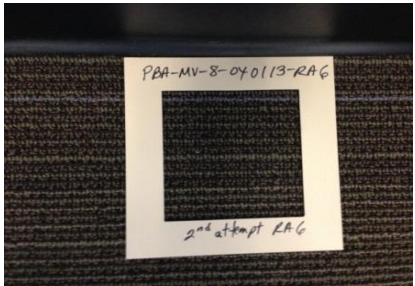
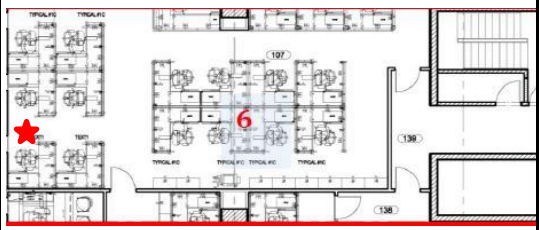
PBA-W-08-040113-9	5-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 9 (Private office to SE) window frame
<b><u>Air Conditioning (A/C) Returns and Supply Wipe Dust Samples</u></b>					
Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Component
PBA-W-08-040113-R1	5-Apr-13	<990 S/CM2 (NONE DETECTED)			A/C return (Lobby to W)
PBA-W-08-040113-R2	5-Apr-13	<990 S/CM2 (NONE DETECTED)			A/C return (Lobby to E)
PBA-W-08-040113-R3	5-Apr-13	<990 S/CM2 (NONE DETECTED)			A/C return (Break room to SE)

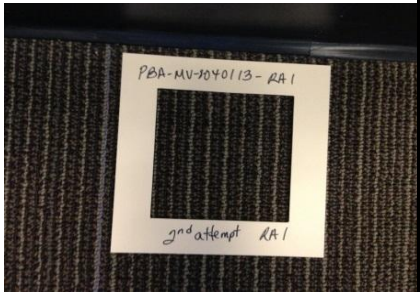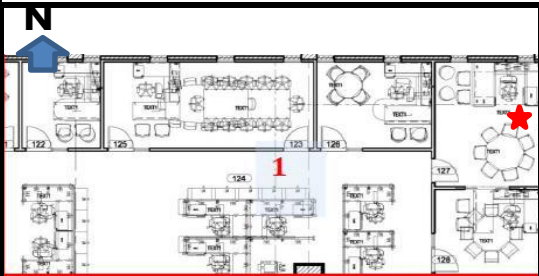



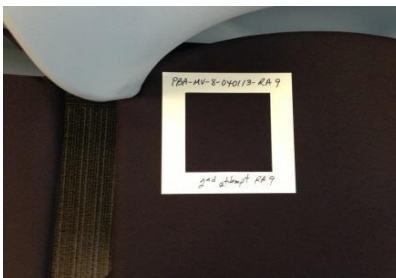
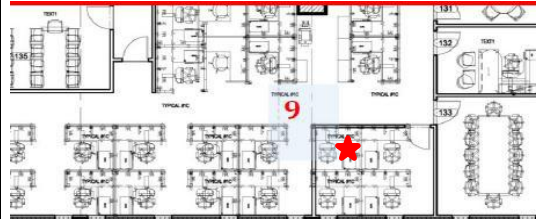
PBA-W-08-040113-R4	5-Apr-13	<990 S/CM2 (NONE DETECTED)			A/C return (Cubicles to SW)
PBA-W-08-040113-S	5-Apr-13	<990 S/CM2 (NONE DETECTED)			A/C supply (Cubicle office to SE)

**Porous Surfaces Microvac Wipe Dust Samples Data\***

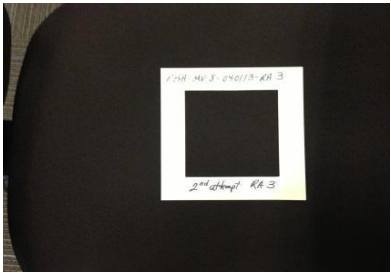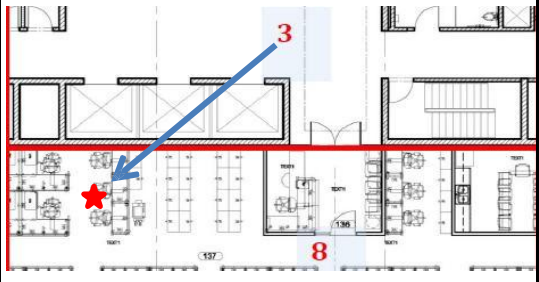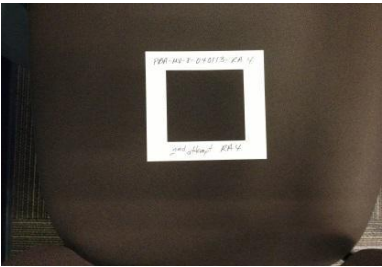PBA-MV-08-040113-1	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 1 (Private office to NE) carpet
PBA-MV-08-040113-2	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 2 (Cubicle office to SW) carpet


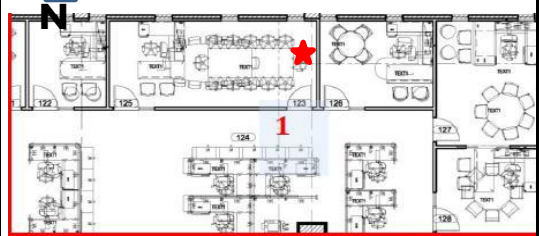


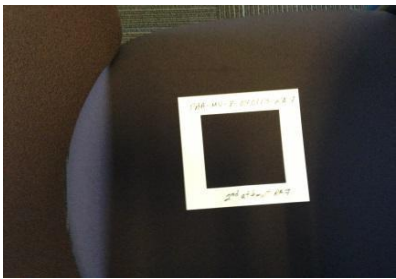


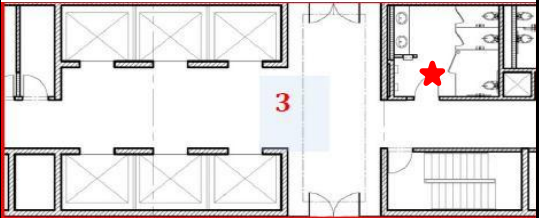



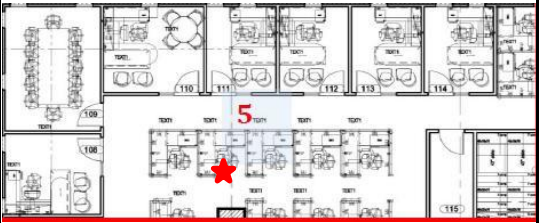
PBA-MV-08-040113-3	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 3 (Open cubicle at RA 8 to S) chair; no porous surfaces were identified in RA 3
PBA-MV-08-040113-4	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 4 (Private office to E) chair
PBA-MV-08-040113-5	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 5 (Private office to NW) carpet
PBA-MV-08-040113-6	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 6 (Cubicle office to W) carpet




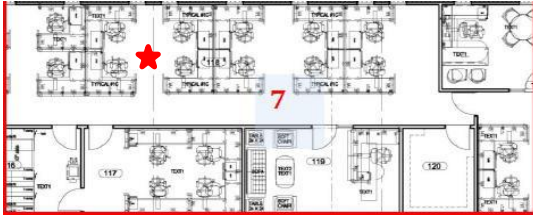


PBA-MV-08-040113-7	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 7 (Private office to N) chair
PBA-MV-08-040113-8	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 8 (Open cubicle to S) carpet
PBA-MV-08-040113-9	1-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 9 (Private office to SE) chair



Air Samples Data\*

Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Component
PBA-A-08-040113-1	1-Apr-13	< 0.00072 F/CC			Random Area # 1 (Conference room to NE)
PBA-A-08-040113-2	1-Apr-13	< 0.00074 F/CC			Random Area # 2 (Open cubicle to SW)

PBA-A-08-040113-3	1-Apr-13	< 0.0007 F/CC			Random Area # 3 (Women restroom to center)
PBA-A-08-040113-4	1-Apr-13	< 0.00072 F/CC			Random Area # 4 (Hallway to E)
PBA-A-08-040113-5	1-Apr-13	< 0.00073 F/CC			Random Area # 5 (Open cubicle to NW)

PBA-A-08-040113-6	1-Apr-13	< 0.00074 F/CC			Random Area # 6 (Open cubicle to W)
PBA-A-08-040113-7	1-Apr-13	< 0.00073 F/CC			Random Area # 7 (Open cubicles to N)
PPBA-A-08-040113-8	1-Apr-13	< 0.00075 F/CC			Random Area # 8 (Reception area to S)

PBA-A-08-040113-9

1-Apr-13

< 0.00072 F/CC



Random Area # 9  
(Conference room to  
SE)

**THIRD CLEANUP SEQUENCE**  
**LEVELS STAIRS TO LEVEL G**






**There are no Diagrams for the Stairs**





STAIRS

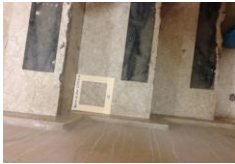Sample				
PBA-W-SES-032713-G	27-Mar-13	4,900 S/CM2 (5 CHRYSTILE STRUCTURES)	 N	SE Stairway Level G
PBA-W-NWS-032713-P	27-Mar-13	<990 S/CM2 (NONE DETECTED)		NW Stairway Level P
PBA-W-SES-032713-2	27-Mar-13	<990 S/CM2 (NONE DETECTED)		SE Stairway Level 2
PBA-W-NWS-032713-3	27-Mar-13	4,900 S/CM2 (5 CHRYSTILE STRUCTURES)		NW Stairway Level 3
PBA-W-SES-032713-4	27-Mar-13	<990 S/CM2 (NONE DETECTED)		SE Stairway Level 4
PBA-W-NWS-032713-5	27-Mar-13	3,000 S/CM2 (3 CHRYSTILE STRUCTURES)		NW Stairway Level 5


PBA-W-SES-032713-6	27-Mar-13	<990 S/CM2 (NONE DETECTED)	PICTURE NOT AVAILABLE	SE Stairway Level 6
PBA-W-NWS-032713-7	27-Mar-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE DETECTED)		SE Stairway Level 7
PBA-W-SES-032713-8	27-Mar-13	<990 S/CM2 (NONE DETECTED)		SE Stairway Level 8
PBA-W-NWS-032713-9	27-Mar-13	2,000 S/CM2 (2 CHRYSOTILE STRUCTURES)	 N	NW Stairway Level 9
PBA-W-SES-032713-10	27-Mar-13	3,000 S/CM2 (3 CHRYSOTILE STRUCTURES)		SE Stairway Level 10
PBA-W-NWS-032713-11	27-Mar-13	<990 S/CM2 (NONE DETECTED)		NW Stairway Level 11
PBA-W-SES-032713-12	27-Mar-13	<990 S/CM2 (NONE DETECTED)		SE Stairway Level 12


Number	Dat	Result	Picture	Location/Component
PBA-W-NWS-032713-13	27-Mar-13	<990 S/CM2 (NONE DETECTED)		NW Stairway Level 13
PBA-W-SES-032713-14	27-Mar-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE DETECTED)		SE Stairway Level 14
PBA-W-NWS-032713-15	27-Mar-13	<990 S/CM2 (NONE DETECTED)		NW Stairway Level 15
PBA-W-SES-032713-16	27-Mar-13	<990 S/CM2 (NONE DETECTED)		SE Stairway Level 16
PBA-W-NWS-032713-17	27-Mar-13	<990 S/CM2 (NONE DETECTED)		NW Stairway Level 17

Stairs Air Samples




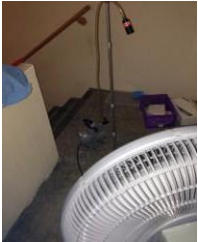
AIR SAMPLES DATA - FIRST ATTEMPT (PASSED)				
Sample Number	Date	Result	Picture	Component
PBA-A-SES-032713-G	27-Mar-13	0.0014 F/CC		SE Stairway Level G
PBA-A-NWS-032713-P	27-Mar-13	< 0.00075F/CC		NW Stairway Level P
PBA-A-SES-032713-2	27-Mar-13	0.0011 F/CC		SE Stairway Level 2
PBA-A-NWS-032713-3	27-Mar-13	< 0.00075 F/CC		NW Stairway Level 3






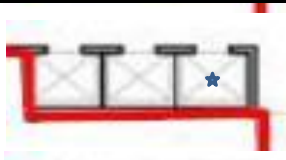

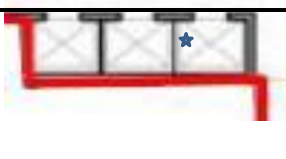






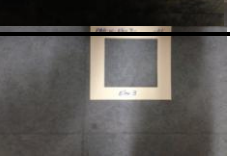
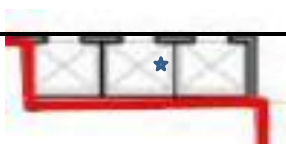
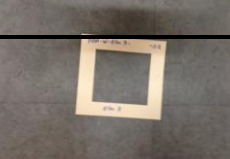

PBA-A-SES-032713-4	27-Mar-13	0.00095 F/CC		SE Stairway Level 4
AIR SAMPLES DATA - FIRST ATTEMPT (PASSED) - Cont.				
Sample Number	Date	Result	Picture	Component
PBA-A-NWS-032713-5	27-Mar-13	< 0.00075 F/CC		NW Stairway Level 5
PBA-A-SES-032713-6	27-Mar-13	< 0.00074 F/CC		SE Stairway Level 6
PBA-A-NWS-032713-7	27-Mar-13	< 0.00074 F/CC		SE Stairway Level 7

PBA-A-SES-032713-8	27-Mar-13	< 0.00075 F/CC		SE Stairway Level 8
--------------------	-----------	----------------	---	---------------------

PBA-A-NWS-032713-9	27-Mar-13	0.00074 F/CC		NW Stairway Level 9
PBA-A-SES-032713-10	27-Mar-13	< 0.00075 F/CC		SE Stairway Level 10
PBA-A-NWS-032713-11	27-Mar-13	< 0.00074 F/CC		NW Stairway Level 11
PBA-A-SES-032713-12	27-Mar-13	0.0011 F/CC		SE Stairway Level 12
PBA-A-NWS-032713-13	27-Mar-13	0.00081 F/CC		NW Stairway Level

AIR SAMPLES DATA - FIRST ATTEMPT (PASSED) - Cont.				
Sample Number	Date	Result	Picture	Component
PBA-A-SES-032713-14	27-Mar-13	0.00087 F/CC		SE Stairway Level 14
PBA-A-NWS-032713-15	27-Mar-13	< 0.00073 F/CC		NW Stairway Level 15
PBA-A-SES-032713-16	27-Mar-13	< 0.00073 F/CC		SE Stairway Level 16
PBA-A-NWS-032713-17	27-Mar-13	< 0.00072 F/CC		NW Stairway Level 17

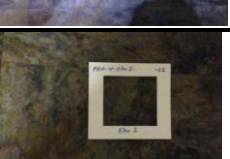

WIPE DUST SAMPLES DATA- FIRST ATTEMPT (PASSED)						
Sample Number	Date	Result	Picture		Diagram (Approx. sample location)	Component
PBA-W-Elev1-041213-1	12-Apr-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE)				Elevator 1 floor to east
PBA-W-Elev1-041213-2	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 1 floor to center
PBA-W-Elev1-041213-3	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 1 floor to west
PBA-W-Elev2-041213-1	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 2 floor to east
PBA-W-Elev2-041213-2	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 2 floor to center
PBA-W-Elev2-041213-3	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 2 floor to west
PBA-W-Elev3-041213-1	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 3 floor to east
PBA-W-Elev3-041213-2	12-Apr-13	<990 S/CM2 (NONE DETECTED)				Elevator 3 floor to center



PBA-W-Elev3-041213-3

12-Apr-13

<990 S/CM2 (NONE DETECTED)



ment Building North Tower



Elevator 3 floor to west

AIR SAMPLES DATA - FIRST ATTEMPT (PASSED)








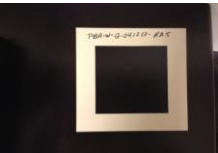



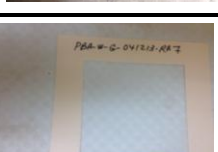

Sample Number	Date	Result	Picture	Diagram (Approx. sample location)	Component
PBA-A-Elev1-111712-1	12-Apr-13	< 0.00074 F/CC			Air - Elevator 1
PBA-A-Elev2-111712-2	12-Apr-13	< 0.00075 F/CC			Air - Elevator 2
PBA-A-Elev3-111712-3	12-Apr-13	< 0.00075 F/CC			Air - Elevator 3

Minillas Government Building North Tower  
San Juan, P.R.

RA=Random Area

Location: Minillas North Tower

Area or Level: Level Ground

NON-POROUS SURFACES WIPE DUST SAMPLES DATA - FIRST ATTEMPT (PASSED)						
Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Location/Component	
PBA-W-G-041213-1	12-Apr-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE)			Random Area # 1 (Electrical room to center) equipment top	
PBA-W-G-041213-2	12-Apr-13	4,900 S/CM2 (5 CHRYSOTILE STRUCTURES)			Random Area # 2 (Cargo hallway to NW) floor	
PBA-W-G-041213-3	12-Apr-13	2,000 S/CM2 (2 CHRYSOTILE STRUCTURES)			Random Area # 3 (Hallway to E) floor	
PBA-W-G-041213-4	12-Apr-13	3,000 S/CM2 (3 CHRYSOTILE STRUCTURES)			Random Area # 4 (Entrance to lobby) cabinet	
PBA-W-G-041213-5	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 5 (Private office to N) desk	
PBA-W-G-041213-6	12-Apr-13	3,000 S/CM2 (3 CHRYSOTILE STRUCTURES)			Random Area # 6 (Lobby to center) floor	
PBA-W-G-041213-7	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 7 (Lactancy room to S) refrigerator top	

Minillas Government Building North Tower  
San Juan, P.R.



RA=Random Area

Location: Minillas North Tower

Area or Level: Level Ground

PBA-W-G-041213-8	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 8 (Men restroom to SE) hand dryer
PBA-W-G-041213-9	12-Apr-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE)			Random Area # 9 (Multioffice to E) elevated cabinet

A/C SUPPLY WIPE DUST SAMPLES DATA - FIRST ATTEMPT (PASSED)

Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Component
PBA-W-G-041213-S	12-Apr-13	<990 S/CM2 (NONE DETECTED)			A/C return (Lobby to W)







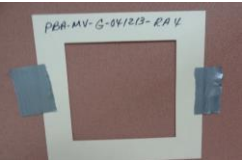

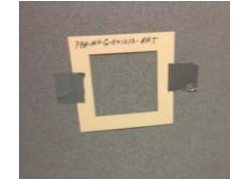
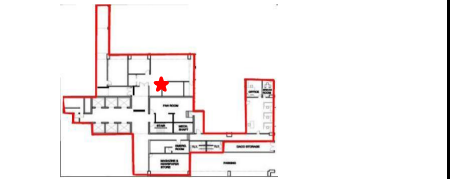


Minillas Government Building North Tower  
San Juan, P.R.

RA=Random Area

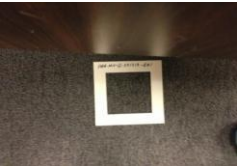Location: Minillas North Tower

Area or Level: Level Ground

POROUS SURFACES MICROVAC DUST SAMPLES DATA - FIRST ATTEMPT (PASSED)


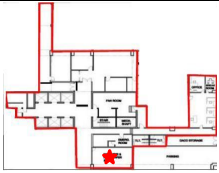

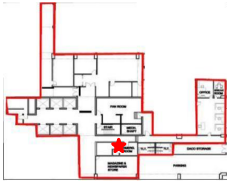

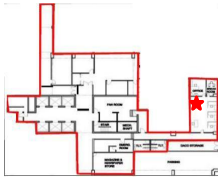
Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Component
PBA-MV-G-041213-1	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 1 (Conference at RA 5 to N) carpet; no porous surfaces were identified in RA 1
PBA-MV-G-041213-2	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 2 (Cargo hallway to NW) porous wall
PBA-MV-G-041213-3	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 3 (Entrance to multioffice to E) partition
PBA-MV-G-041213-4	12-Apr-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE)			Random Area # 4 (Multioffice at RA9 to E) partition; no porous surfaces were identified in RA 4
PBA-MV-G-041213-5	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 5 (Cubicle to center) partition
PBA-MV-G-041213-6	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 6 (Private office to N) chair

Minillas Government Building North Tower  
San Juan, P.R.

RA=Random Area

Location: Minillas North Tower


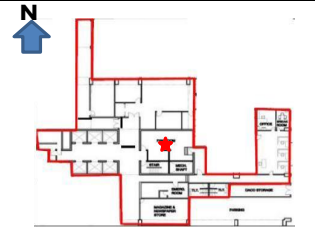
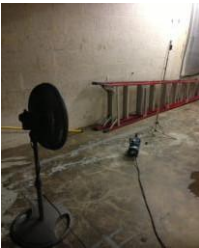





Area or Level: Level Ground

PBA-MV-G-041213-7	12-Apr-13	990 S/CM2 (1 CHRYSOTILE STRUCTURE)			Random Area # 7 (Store to S) cardboard box
PBA-MV-G-041213-8	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 8 (Lactancy room to S) partition
PBA-MV-G-041213-9	12-Apr-13	<990 S/CM2 (NONE DETECTED)			Random Area # 9 (Multioffice to E) partition

Minillas Government Building North Tower  
San Juan, P.R.

RA=Random Area

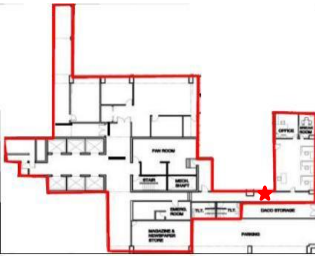Location: Minillas North Tower  
Area or Level: Level Ground

AIR SAMPLES DATA - FIRST ATTEMPT (PASSED)					
Sample Number	Date	Result	Picture	RA Diagram (Approx. sample location)	Component
PBA-A-G-041213-1	12-Apr-13	< 0.00071 F/CC			Random Area # 1 (Fan mechanical room to center)
PBA-A-G-041213-2	12-Apr-13	< 0.00073 F/CC			Random Area # 2 (Cargo hallway to N)
PBA-A-G-041213-3	12-Apr-13	< 0.00073 F/CC			Random Area # 3 (Hallway to E)
PBA-A-G-041213-4	12-Apr-13	0.00088 F/CC			Random Area # 4 (Entrance lobby to S)








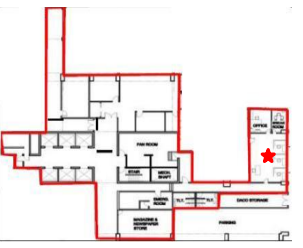


Minillas Government Building North Tower  
San Juan, P.R.

RA=Random Area

Location: Minillas North Tower

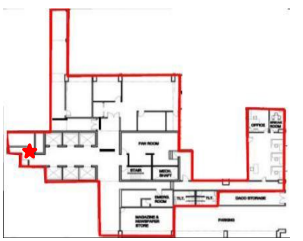Area or Level: Level Ground

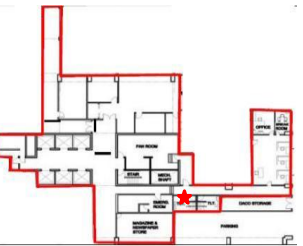PBA-A-G-041213-5	12-Apr-13	< 0.00071 F/CC			Random Area # 5 (Open office to N)
PBA-A-G-041213-6	12-Apr-13	< 0.00072 F/CC			Random Area # 6 (Storage area to W)
PBA-A-G-041213-7	12-Apr-13	< 0.00068 F/CC			Random Area # 7 (Store to S)
PPBA-A-G-041213-8	12-Apr-13	< 0.0007 F/CC			Random Area # 8 (Women restroom to SE)
PBA-A-G-041213-9	12-Apr-13	< 0.0007 F/CC			Random Area # 9 (Multioffice to E)